

Inspection report

Client :	Sotech International	Tel:	+334 83454732	Fax:	--
Attn:	Mr. Alain	Supplier:			
Inspection Date:	2022-05-09	<input type="checkbox"/> 1 st / 2 nd Re-inspection (Previous Report No.)			
Product Description:	Vacuum Cleaner				
Manufacturer Name:					
Manufacturer Location:					
Manufacturer Contact:					
Service Required:	<input checked="" type="checkbox"/> FRI (Final Random Inspection)	<input type="checkbox"/> DPI (During Production Inspection)	<input type="checkbox"/>		



P/O No.	Item No.	Order Qty.	Shipment Qty.:	Sales destination	Carton Qty.:	Inspected Qty.	Packed CTN (%)	Production (%)	Sample Size
2022024(81767)	TAS-755	2 600pcs	2 600pcs	France	2 600ctns	2 600pcs	100	100	33pcs
2022025(81768)	TAS-759	2 600pcs	2 600pcs		2 600ctns	2 600pcs	100	100	33pcs
01022022 (81769)	TAS-755	555pcs	555pcs		555ctns	555pcs	100	100	7pcs
	TAS-759	555pcs	555pcs		555ctns	555pcs	100	100	7pcs

INSPECTION RESULT:	<input checked="" type="checkbox"/> PASS <input type="checkbox"/> FAIL <input type="checkbox"/> PENDING (if Fail or Pending) due to remarks of:
ON-SITE CC (Construction check) INFORMATION:	<input type="checkbox"/> N/A <input checked="" type="checkbox"/> The On-site CC for this item was performed on 2022-05-09 as per our report no. 4388568.00-22 with the result - <input checked="" type="checkbox"/> PASS <input type="checkbox"/> FAIL <input type="checkbox"/> PENDING


A-1) : AQL and Defects Finding					
Inspection Sampling Standard Adopted: <input checked="" type="checkbox"/> ISO 2859-1			Nonconformity (defective)		
Inspection Plan:	Single sampling plans for normal Inspection		Critical	Major	Minor
Inspection Level:	Fixed	AQL:	Not Allowed	2.5	4.0
Inspection with:	<input type="checkbox"/> approved sample	Sample Size:	80	80	80
<input type="checkbox"/> specific check list	<input checked="" type="checkbox"/> general check list				
Defect Description					
Dirty mark on surface TAS-759					1
Scratch mark on surface TAS-759					1
Scratch mark on surface TAS-755					2
Total Found:			0	0	4
Max. Allowed:			0	5	7

The report reflects the findings at the time and place of inspection. This report does not relieve the sellers/manufacturers from their contractual liabilities or prejudice the buyer's right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment. This report is not used for social proof function in China market.

A-2: Remarks and Comments								
	Please confirm							Status
1	For all inspected samples, rating label was not smooth. Because there was an injection port under the rating label. Factory reworked rating label and provided guarantee letter, then accepted by client .							Information
2	Production code on gift box and rating label was 'NIS-782', but 'IYA-782' was required by the PO. Accepted by client.							Information
3	Spare part:							Information
	PO no.	Gift box	Two parts Tube	Floor / carpet brush	2 in 1 nozzle	Flexible hose	Washable sponge filter	HEPA filter
	2022024	15pcs	10pcs	5pcs	10pcs	5pcs	30pcs	20pcs
	2022025	15pcs	10pcs	5pcs	10pcs	5pcs	30pcs	20pcs
	01022022	15pcs / item	10pcs / item	5pcs / item	10pcs / item	5pcs / item	30pcs / item	20pcs / item
4	No PO no. on the package and rating label.							Information
5	LVD and CDF were provided by the factory.							Information
6	Production code: 'NIS-782' on gift box and rating label.							Information

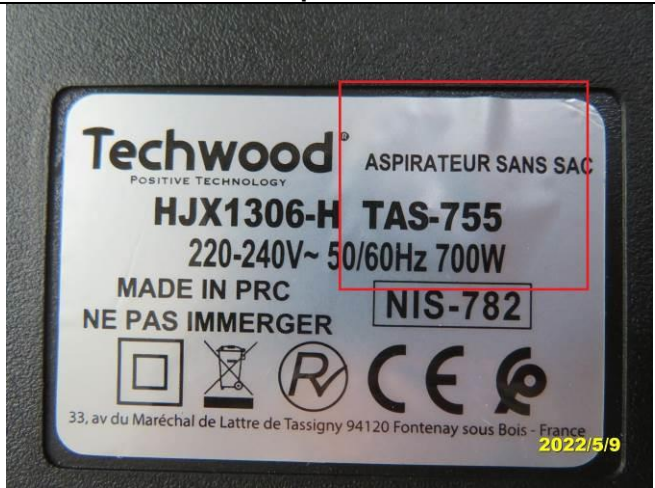A-3. Picture with description for Remarks.	
	
1. Remark 1: Rating label was not smooth	2. Remark 1: Rating label was not smooth

The report reflects the findings at the time and place of inspection. This report does not relieve the sellers/manufacturers from their contractual liabilities or prejudice the buyer's right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment. This report is not used for social proof function in China market.

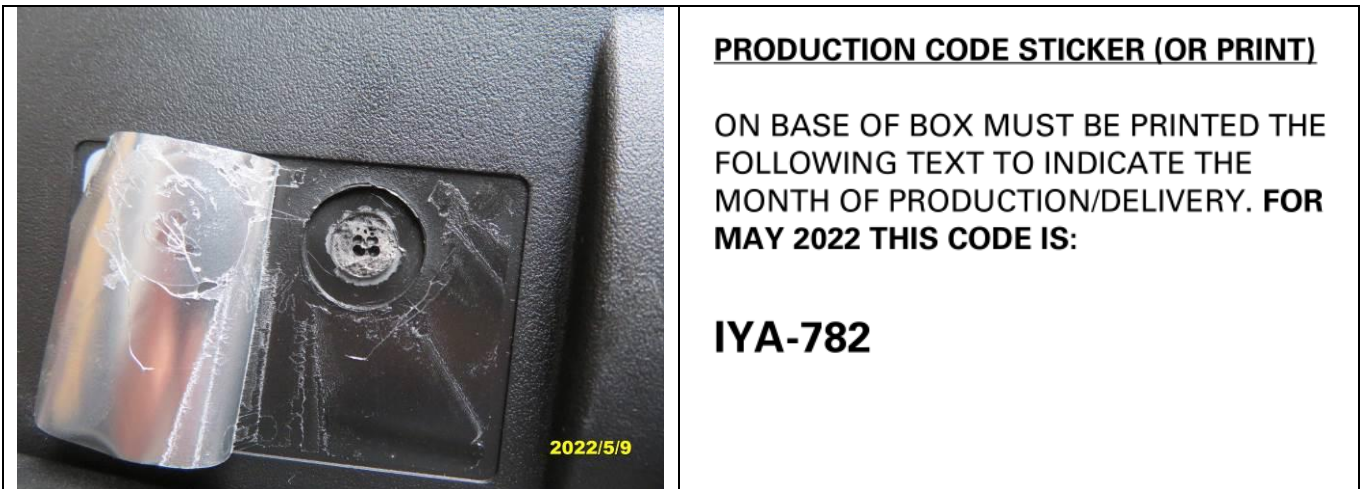

PRODUCTION CODE STICKER (OR PRINT)

ON BASE OF BOX MUST BE PRINTED THE FOLLOWING TEXT TO INDICATE THE MONTH OF PRODUCTION/DELIVERY. **FOR MAY 2022 THIS CODE IS:**

IYA-782

3. Remark 1: Injection port under the rating label

4. Remark 2: Production code 'IYA-782' on PO



5. Remark 2: Production code 'NIS-782' on RL

6. Remark 2: Production code 'NIS-782' on RL

Inspected by	:	Ernest Yao	Signature	:	<i>Ernest Yao</i>
Reviewed by	:	Gavin hu	Signature	:	<i>Gavin hu</i>

The report reflects the findings at the time and place of inspection. This report does not relieve the sellers/manufacturers from their contractual liabilities or prejudice the buyer's right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment. This report is not used for social proof function in China market.

B. Quantity/Specification/Product requirement verification

B-1) Check inspection lot size against:

<input checked="" type="checkbox"/> Purchase order	<input checked="" type="checkbox"/> Conformed	<input type="checkbox"/> Not conformed
<input checked="" type="checkbox"/> Inspection booking form	<input checked="" type="checkbox"/> Conformed	<input type="checkbox"/> Not conformed
<input type="checkbox"/> Packing list	<input type="checkbox"/> Conformed	<input type="checkbox"/> Not conformed

B-2) Check product description/ colour /style against:

<input checked="" type="checkbox"/> Purchase order	<input type="checkbox"/> Conformed	<input checked="" type="checkbox"/> Not conformed
<input type="checkbox"/> Product specification	<input type="checkbox"/> Conformed	<input type="checkbox"/> Not conformed
<input type="checkbox"/> Reference artwork	<input type="checkbox"/> Conformed	<input type="checkbox"/> Not conformed
<input type="checkbox"/> Golden sample	<input type="checkbox"/> Conformed	<input type="checkbox"/> Not conformed
<input type="checkbox"/> (others:please specify the sender and receiving date)	<input type="checkbox"/> Conformed	<input type="checkbox"/> Not conformed

B-3) Packing material

Export carton	New export carton	<input checked="" type="checkbox"/>
Fasting	Metal staples	<input type="checkbox"/>
Sealing	Transparent gummed tape	<input checked="" type="checkbox"/>
	Opaque gummed tape	<input type="checkbox"/>
	Paper tape	<input type="checkbox"/>
Strapping	Nylon	<input type="checkbox"/>
Material	Ply of cardboard	<input type="checkbox"/> 3ply (single wall) <input checked="" type="checkbox"/> 5ply (double wall) <input type="checkbox"/> 7ply (triple wall)
Others	Poly foam inside packing	<input type="checkbox"/> Yes <input checked="" type="checkbox"/> No

B-4) Packaging information

TAS-759

	Qty per selling unit	Carton size (cm)			N.W. (kg)	G.W. (kg)
		L(cm)	W(cm)	H(cm)		
Gift Box	1pc	37.0	27.0	26.0	3.55	4.15
Inner carton	N/A	N/A	N/A	N/A	N/A	N/A
Outer carton	N/A	N/A	N/A	N/A	N/A	N/A

TAS-755

	Qty per selling unit	Carton size (cm)			N.W. (kg)	G.W. (kg)
		L(cm)	W(cm)	H(cm)		
Gift Box	1pc	37.0	27.0	26.0	3.55	4.20
Inner carton	N/A	N/A	N/A	N/A	N/A	N/A
Outer carton	N/A	N/A	N/A	N/A	N/A	N/A

The report reflects the findings at the time and place of inspection. This report does not relieve the sellers/manufacturers from their contractual liabilities or prejudice the buyer's right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment. This report is not used for social proof function in China market.

B-5) Barcode check

Overall result: <input checked="" type="checkbox"/> Pass <input type="checkbox"/> Fail <input type="checkbox"/> N/A (no barcodes were found on product or packing.)				
1.	Barcode scanning performed on (S-1): 5pcs			
2.	Barcode readability result: <input checked="" type="checkbox"/> Pass <input type="checkbox"/> Fail			
	Barcode scanner brand and model number: CIPHER LAB/8017-L			
3.	Barcode number:			
	<input checked="" type="checkbox"/> on gift box:	TAS-755	3760301554561	<input type="checkbox"/> on carton: N/A
	<input checked="" type="checkbox"/> on gift box:	TAS-758	3760301554578	<input type="checkbox"/> on carton: N/A
4.	Did the Barcodes on inspected samples conform to specifications/PO requirement:			
	<input type="checkbox"/> Conformed <input type="checkbox"/> Not conformed <input checked="" type="checkbox"/> N/A			

B-6) Shipping marks: N/A

For export carton	front side marks <input type="checkbox"/>	side marks <input type="checkbox"/>
For inner box	front side marks <input type="checkbox"/>	side marks <input type="checkbox"/>

B-7) Color / style / material Conform to Golden Sample?

<input type="checkbox"/> Yes
<input type="checkbox"/> No, please see remark
<input checked="" type="checkbox"/> N/A, no Golden sample

C. ON-SITE CHECKING

Test performed	Sample size	Result	Comments
Hi-pot test (Fixed)	80pcs	Pass	3,300 V, 2 s, 5mA, no breakdown.
Basic function test (Fixed)	80pcs	Pass	230 V~, 50 Hz, switch on/off
Smell check (Fixed)	80pcs	Pass	No abnormal smell
Full function check (S-3)	20pcs	Pass	230 V~, 50 Hz, operation as normal use.
Input power consumption check (S-3)	20pcs	Pass	230 V~, 50 Hz: 651-694W
Vacuum capacity check (S-3)	20pcs	Pass	230 V~, 50 Hz: 19.4-21.1Kpa
Internal check (S-1)	5pcs	Pass	No damage, pressure mark, rust, crack
Suction power check (S-1)	5pcs	Pass	131.7-143.6W
Air flow check (S-1)	5pcs	Pass	1.22-1.29m ³ /min
Noise check (S-1)	5pcs	Pass	67.1-70.3dB
Application check	2pcs	Pass	230 V~, 50 Hz
Endurance test (S-1)	5pcs	Pass	230 V~, 50 Hz
Power cord length measurement	2pcs	Pass	400-402cm (without plug)
Rub test	2pcs	Pass	Cloth with water and hexane, rub for 15s.
3M tape check	2pcs	Pass	3M type 810 tape check, no printing peel off
Strain relief test	2pcs	Pass	60 N, 25 times, displacement less than 2 mm
Stability check	2pcs	Pass	No overturn at 10° slope.

The report reflects the findings at the time and place of inspection. This report does not relieve the sellers/manufacturers from their contractual liabilities or prejudice the buyer's right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment. This report is not used for social proof function in China market.

D. OTHER INFORMATION

	Please note
1.	80 Cartons were randomly sampled from the batch of above item subjected for inspection
2.	<input type="checkbox"/> Selected carton number:
3.	<input checked="" type="checkbox"/> Carton no. was not assigned.

E. Critical component data

	Component	Trade Mark	Model	Technical data	Conformity mark	Results
1.	Power Plug	Not identified	ZJ-02	16 A, 250 V~	VDE	Pass
2.	Power Cord	Yuyao Zhongjian	H05VVH2-F	2 x 0,75 mm ²	VDE	Pass
3.	Internal wire	HUIERNA	1015	600 V, 105 °C, 18AWG	UL (E354214)	Pass
4.	Switch	TONGDE	KAN-J4	250 V~, 8(8)A, T85	TUV/SUD	Pass
5.	X2 Capacitor	AID	MEX	0,22uF, 275V~, X2, 40/085/21/C	VDE	Pass
6.	Lead wire of motor	HUIERNA	1015	600 V, 105 °C, 18AWG	UL (E354214)	Pass
7.	Motor	Not identified	HJN-D-70-1	220-240V~, 50/60 Hz, 700W, Class 120, Stator: 1.928Ω; 2.001Ω (aluminum winding) Rotor (diagonal): 3.988Ω. Tested at: 22°C	Test with appliance	Pass

Remarks: Winding resistance of motor was found in TUV/Rh LVD Report (Report No.: 14714945 019), see as below: Stator: 2,008Ω aluminum winding; Rotor: 4,021Ω (diagonal) test at 23,1 °C

Remark: Above components are tested against CDF under TUV/Rh test report#: 14714945 019.

The report reflects the findings at the time and place of inspection. This report does not relieve the sellers/manufacturers from their contractual liabilities or prejudice the buyer's right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment. This report is not used for social proof function in China market.

F. Pictures



1.Products in warehouse



2.Selected samples

Item: TAS-759



3.Gift box



4.Gift box



5.Gift box



6.Gift box

The report reflects the findings at the time and place of inspection. This report does not relieve the sellers/manufacturers from their contractual liabilities or prejudice the buyer's right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment. This report is not used for social proof function in China market.



7. Gift box



9. Gift box



11. QR code on gift box



8. Gift box



10. Barcode on gift box



12. Information on gift box


The report reflects the findings at the time and place of inspection. This report does not relieve the sellers/manufacturers from their contractual liabilities or prejudice the buyer's right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment. This report is not used for social proof function in China market.



13. Open view of gift box



14. Packing details in gift box

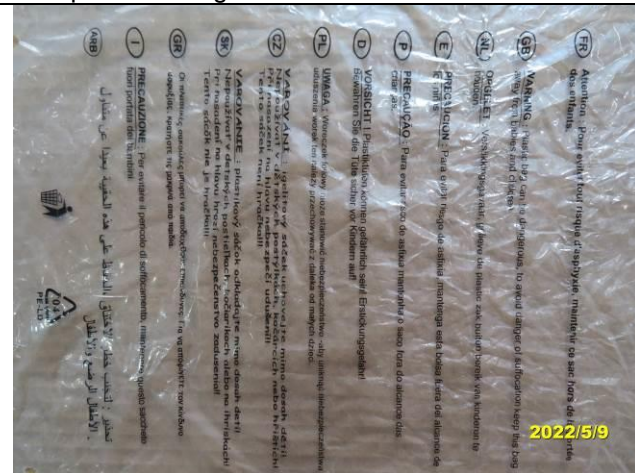

15. Warning on poly bag



16. Product and accessories



17. Manuals and leaflet




18. Floor brush

The report reflects the findings at the time and place of inspection. This report does not relieve the sellers/manufacturers from their contractual liabilities or prejudice the buyer's right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment. This report is not used for social proof function in China market.



19. Floor brush

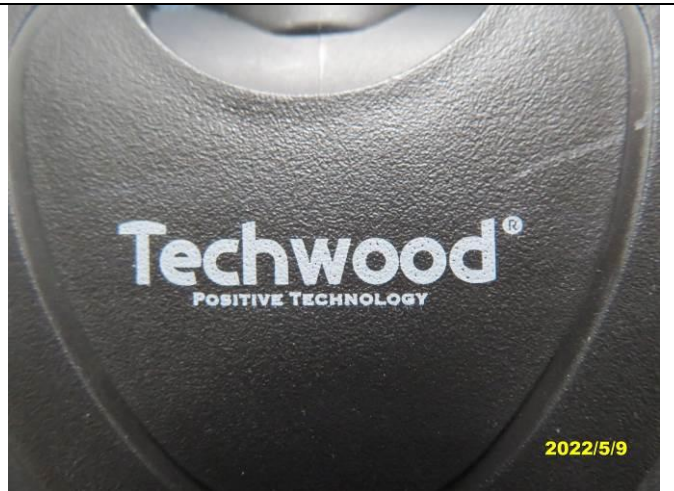

20. Logo on floor brush



21. 2 in 1 nozzle



22. Tubes



23. Flexible hose



24. Air flow control on handle

The report reflects the findings at the time and place of inspection. This report does not relieve the sellers/manufacturers from their contractual liabilities or prejudice the buyer's right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment. This report is not used for social proof function in China market.



25.Connector on flexible hose



26.Plastic protection part on product



27.Plastic protection part detached



28. Product view



29.Product view



30.Product view

The report reflects the findings at the time and place of inspection. This report does not relieve the sellers/manufacturers from their contractual liabilities or prejudice the buyer's right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment. This report is not used for social proof function in China market.



31.Product view



32.Product view



33.Product view



34.Product view



35. Assembly product



36. Assembly product

The report reflects the findings at the time and place of inspection. This report does not relieve the sellers/manufacturers from their contractual liabilities or prejudice the buyer's right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment. This report is not used for social proof function in China market.



37. Switch



38. Cord rewinding button



39. Rating label



40. Product without dust container



41. Dust container



42. Logo on dust container

The report reflects the findings at the time and place of inspection. This report does not relieve the sellers/manufacturers from their contractual liabilities or prejudice the buyer's right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment. This report is not used for social proof function in China market.



43. Max level on dust container



44. Dust container detached part



45. Plug



46. Power cord



47. Air outlet



48. Air outlet

The report reflects the findings at the time and place of inspection. This report does not relieve the sellers/manufacturers from their contractual liabilities or prejudice the buyer's right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment. This report is not used for social proof function in China market.



49. Air outlet



50. Internal view



51. Internal view



52. Internal view



53. Internal view



54. Internal view

The report reflects the findings at the time and place of inspection. This report does not relieve the sellers/manufacturers from their contractual liabilities or prejudice the buyer's right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment. This report is not used for social proof function in China market.



55. Internal view



56. Internal view



57. Motor



58. Label on motor



59. Rotor and stator



60. Switch

The report reflects the findings at the time and place of inspection. This report does not relieve the sellers/manufacturers from their contractual liabilities or prejudice the buyer's right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment. This report is not used for social proof function in China market.



61.Capacitor



62. Internal wire

Item: TAS-755



63.Gift box



64.Gift box



65.Gift box




66.Gift box

The report reflects the findings at the time and place of inspection. This report does not relieve the sellers/manufacturers from their contractual liabilities or prejudice the buyer's right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment. This report is not used for social proof function in China market.



67. Gift box

68. Gift box

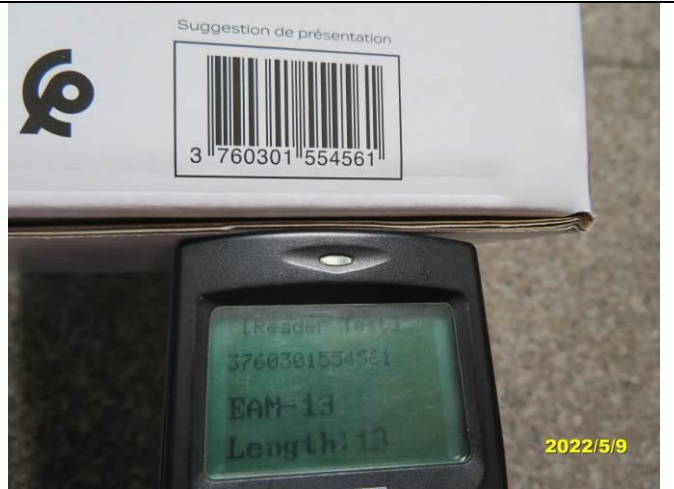

69. Gift box

70. Barcode on gift box



71. QR code on gift box

72. Information on gift box


The report reflects the findings at the time and place of inspection. This report does not relieve the sellers/manufacturers from their contractual liabilities or prejudice the buyer's right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment. This report is not used for social proof function in China market.



73. Open view of gift box



74. Packing details in gift box

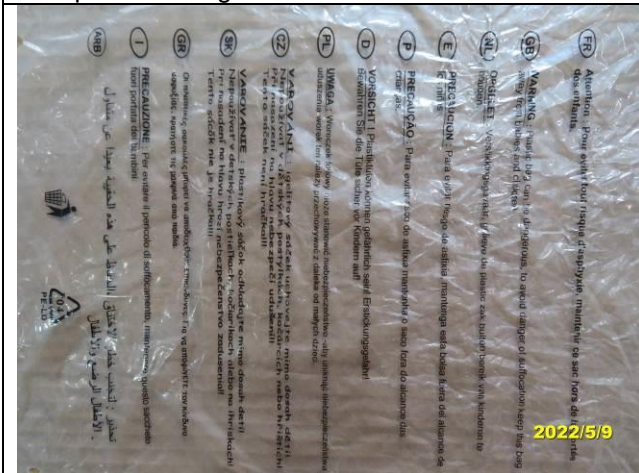

75. Warning on poly bag



76. Product and accessories



77. Manuals and leaflet




78. Floor brush

The report reflects the findings at the time and place of inspection. This report does not relieve the sellers/manufacturers from their contractual liabilities or prejudice the buyer's right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment. This report is not used for social proof function in China market.



79. Floor brush

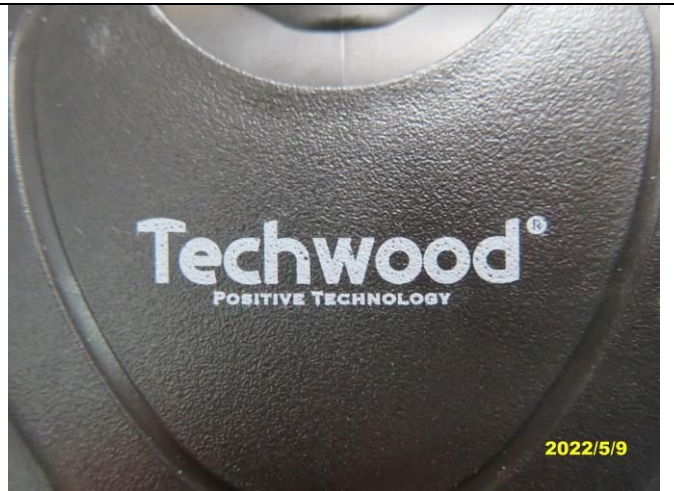

80. Logo on floor brush



81. 2 in 1 nozzle



82. Tubes



83. Flexible hose



84. Air flow control on handle

The report reflects the findings at the time and place of inspection. This report does not relieve the sellers/manufacturers from their contractual liabilities or prejudice the buyer's right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment. This report is not used for social proof function in China market.



85.Connector on flexible hose



86.Plastic protection part on product



87.Plastic protection part detached



88. Product view



89.Product view



90.Product view

The report reflects the findings at the time and place of inspection. This report does not relieve the sellers/manufacturers from their contractual liabilities or prejudice the buyer's right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment. This report is not used for social proof function in China market.



91.Product view



92.Product view



93.Product view



94.Product view



95. Assembly product



96. Assembly product

The report reflects the findings at the time and place of inspection. This report does not relieve the sellers/manufacturers from their contractual liabilities or prejudice the buyer's right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment. This report is not used for social proof function in China market.



97. Switch



98. Cord rewinding button



99. Rating label



100. Product without dust container



101. Dust container



102. Logo on dust container

The report reflects the findings at the time and place of inspection. This report does not relieve the sellers/manufacturers from their contractual liabilities or prejudice the buyer's right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment. This report is not used for social proof function in China market.



103. Max level on dust container



104. Dust container detached part



105. Plug



106. Power cord



107. Air outlet



108. Air outlet

The report reflects the findings at the time and place of inspection. This report does not relieve the sellers/manufacturers from their contractual liabilities or prejudice the buyer's right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment. This report is not used for social proof function in China market.



109. Air outlet



110. Internal view



111. Internal view



112. Internal view



113. Hi-pot test



114. Power consumption test

The report reflects the findings at the time and place of inspection. This report does not relieve the sellers/manufacturers from their contractual liabilities or prejudice the buyer's right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment. This report is not used for social proof function in China market.




115. Vacuum capacity check



116. Full function test (suction power, airflow)



117. Endurance test

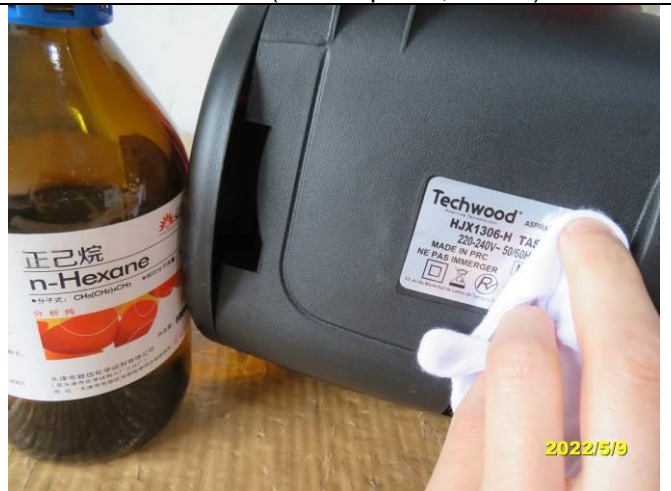

118. Rub test



119. 3M tape check



120. Strain relief test

The report reflects the findings at the time and place of inspection. This report does not relieve the sellers/manufacturers from their contractual liabilities or prejudice the buyer's right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment. This report is not used for social proof function in China market.



121. Application test



122. Cord length measurement test



123. Spare part



124. Spare part



125. Dirty mark on surface-minor TAS-759



126. Scratch mark on surface-minor TAS-759

The report reflects the findings at the time and place of inspection. This report does not relieve the sellers/manufacturers from their contractual liabilities or prejudice the buyer's right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment. This report is not used for social proof function in China market.



127.Scratch mark on surface-minor TAS-755



128.Scratch mark on surface-minor TAS-755

-END OF REPORT-

The report reflects the findings at the time and place of inspection. This report does not relieve the sellers/manufacturers from their contractual liabilities or prejudice the buyer's right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment. This report is not used for social proof function in China market.