



Report No.: 4913621.01-5

Report Date: 2024-01-04

This is to supersede our report 4913621.00-5 issued on 2023-12-29

# Inspection report

Client:	Sotech International	Tel:	331 5873 1160	Fax:	331 4881 1970
Attn:	MR. ALAIN / MS MICHELE	Supplier:	--		
Inspection Date:	2023-12-28	<input type="checkbox"/> 1 <sup>st</sup> / 2 <sup>nd</sup> Re-inspection (Previous Report No.: N/A)			
Product Description:	Coffee Machine				
Manufacturer Name:	Foshan City Shunde District Donlim Intelligent Electrical Appliances Technology Co., Ltd.				
Manufacturer Location:	Shunye East Road, Shunde District, Foshan City, Guangdong Province, China				
Manufacturer Contact:	Mr. Bai				
Service Required:	<input checked="" type="checkbox"/> <b>FRI</b> (Final Random Inspection)		<input type="checkbox"/> <b>DPI</b> (During Production Inspection)		<input type="checkbox"/>

P/O No.	Item No.	Order Qty.	Shipment Qty.	Sales destination	Carton Qty.	Inspected Qty.	Packed CTN (%)	Production (%)	Sample Size
20231809 (82300)	TCA-1315AEX	400pcs	400pcs	--	400ctns	400pcs	100%	100%	50pcs



<b>INSPECTION RESULT:</b>	<input checked="" type="checkbox"/> <b>PASS</b> <input type="checkbox"/> <b>FAIL</b> <input type="checkbox"/> <b>PENDING</b> (If Fail or Pending) due to remarks of:
<b>ON-SITE CC (Construction check) INFORMATION:</b>	<input checked="" type="checkbox"/> <b>N/A</b> <input type="checkbox"/> The On-site CC for this item was performed on (N/A) as per our report no. (N/A) with the result - <input type="checkbox"/> <b>PASS</b> <input type="checkbox"/> <b>FAIL</b> <input type="checkbox"/> <b>PENDING</b>

## A-1): AQL and Defects Finding

Inspection Sampling Standard Adopted: <input checked="" type="checkbox"/> ISO 2859-1		Nonconformity (defective)			
Inspection Plan:	Single sampling plans for normal Inspection	Critical	Major	Minor	
Inspection Level:	<b>G II</b>	AQL:	<b>Not Allowed</b>	<b>2.5</b>	<b>4.0</b>
Inspection with:	<input type="checkbox"/> approved sample <input type="checkbox"/> specific check list <input checked="" type="checkbox"/> general check list	Sample Size:	<b>50</b>	<b>50</b>	<b>50</b>
Defect Description					
Poor sticking (slant) on the rating label.		0	1	0	
Scratch mark on the housing.		0	0	2	
Scratch mark on plate drawer.		0	0	1	
<b>Total Found:</b>		<b>0</b>	<b>1</b>	<b>3</b>	
<b>Max. Allowed:</b>		<b>0</b>	<b>3</b>	<b>5</b>	

The report reflects the findings at the time and place of inspection. This report does not relieve the sellers/manufacturers from their contractual liabilities or prejudice the buyer's right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment. This report is not used for social proof function in China market.

**A-2: Remarks and Comments**

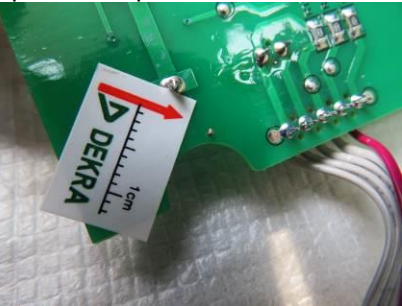
	Please confirm	Status				
1	<p>After thermal fuse test, melting was found on the heating element bracket.</p>  <p>Accepted by client email dated 2024-01-04.</p>	Information				
2	<p>1pc out of 5pcs internal check samples was found with soldering slag on control PCB.</p>  <p>Accepted by client email dated 2024-01-04.</p>	Information				
3	<p>Actual rated frequency was “50Hz” instead of “50-60Hz” stated on PO.</p> <table border="1" data-bbox="224 1222 1334 1310"> <tr> <td><b>220-240V~ 50Hz 1350W</b></td> <td><b>220-240V 50-60HZ 1350W</b></td> </tr> <tr> <td>Actual rated frequency was “50Hz”</td> <td>“50-60Hz” stated on PO</td> </tr> </table> <p>Accepted by client email dated 2024-01-04.</p>	<b>220-240V~ 50Hz 1350W</b>	<b>220-240V 50-60HZ 1350W</b>	Actual rated frequency was “50Hz”	“50-60Hz” stated on PO	Information
<b>220-240V~ 50Hz 1350W</b>	<b>220-240V 50-60HZ 1350W</b>					
Actual rated frequency was “50Hz”	“50-60Hz” stated on PO					
4	<p>For the poly bag which packing the drip tray and plate drawer, there was no warning text while the opening perimeter was more than 38cm.</p>  <p>Accepted by client email dated 2024-01-04.</p>	Information				
5	<p>Actual there was no warming function for the drip tray, but “Cup warming tray” was stated on gift box.</p>	Information				

The report reflects the findings at the time and place of inspection. This report does not relieve the sellers/manufacturers from their contractual liabilities or prejudice the buyer's right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment. This report is not used for social proof function in China market.



**Report No.:** 4913621.01-5

**Report Date:** 2024-01-04

*This is to supersede our report 4913621.00-5 issued on 2023-12-29*

		<ul style="list-style-type: none"> <li>Espresso, Double espresso, Americano, ...</li> <li>✓ Grain grinder 200g</li> <li>✓ 15 different grinding finenesses</li> <li>✓ Cup warming tray ←</li> <li>✓ Empty grain tank indicator</li> <li>✓ Empty water tank indicator</li> <li>Capacity: 1.5L</li> <li>✓ 220-240V~ 50Hz ✓ 1350W</li> </ul>	
<b>6</b>	<p>Actual there was no warming function for the drip tray</p> <p>Accepted by client email dated 2024-01-04.</p>		Information
<b>7</b>	<p>No spare part was provided during inspection.</p>		Information
<b>7</b>	<p>The factory provided alcohol instead of N-Hexane for rubbing test, and the test result was positive.</p>		Information

<b>A-3: Picture with description for Remarks: Nil</b>	
Nil	Nil
1. N/A	2. N/A

<b>Inspected by</b>	:	Michael WANG	<b>Signature</b>	:	
<b>Reviewed by</b>	:	Sanky Liu	<b>Signature</b>	:	

The report reflects the findings at the time and place of inspection. This report does not relieve the sellers/manufacturers from their contractual liabilities or prejudice the buyer's right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment. This report is not used for social proof function in China market.



Report No.: 4913621.01-5

Report Date: 2024-01-04

This is to supersede our report 4913621.00-5 issued on 2023-12-29

**B. Quantity/Specification/Product requirement verification**

**B-1) Check inspection lot size against:**

<input checked="" type="checkbox"/> Purchase order	<input checked="" type="checkbox"/> Conformed	<input type="checkbox"/> Not conformed
<input checked="" type="checkbox"/> Inspection booking form	<input checked="" type="checkbox"/> Conformed	<input type="checkbox"/> Not conformed
<input type="checkbox"/> Packing list	<input type="checkbox"/> Conformed	<input type="checkbox"/> Not conformed

**B-2) Check product description/ colour /style against:**

<input checked="" type="checkbox"/> Purchase order	<input type="checkbox"/> Conformed	<input checked="" type="checkbox"/> Not conformed
<input type="checkbox"/> Product specification	<input type="checkbox"/> Conformed	<input type="checkbox"/> Not conformed
<input type="checkbox"/> Reference artwork	<input type="checkbox"/> Conformed	<input type="checkbox"/> Not conformed
<input type="checkbox"/> Golden sample	<input type="checkbox"/> Conformed	<input type="checkbox"/> Not conformed
<input type="checkbox"/> (others:please specify the sender and receiving date)	<input type="checkbox"/> Conformed	<input type="checkbox"/> Not conformed

**B-3) Packing material**

Export carton	New export carton	<input checked="" type="checkbox"/>
Fasting	Metal staples	<input type="checkbox"/>
Sealing	Transparent gummed tape	<input checked="" type="checkbox"/>
	Opaque gummed tape	<input type="checkbox"/>
	Paper tape	<input type="checkbox"/>
Strapping	Nylon	<input type="checkbox"/>
Material	Ply of cardboard	<input type="checkbox"/> 3ply (single wall)
		<input checked="" type="checkbox"/> 5ply (double wall)
		<input type="checkbox"/> 7ply (triple wall)
Others	Poly foam inside packing	<input checked="" type="checkbox"/> Yes <input type="checkbox"/> No

**B-4) Packaging information**

	Qty per selling unit	Carton size (cm)			N.W. (kg)	G.W. (kg)
		L(cm)	W(cm)	H(cm)		
Gift Box	1pc	46.4	24.1	37.1	7.541	8.495
Outer carton	1pc	48.1	25.5	39.1	8.495	9.192

**B-5) Barcode check**

Overall result: <input checked="" type="checkbox"/> Pass <input type="checkbox"/> Fail <input type="checkbox"/> N/A (no barcodes were found on product or packing)	
1.	Barcode scanning performed on (S-1): 3pcs
2.	Barcode readability result: <input checked="" type="checkbox"/> Pass <input type="checkbox"/> Fail
	Barcode scanner brand and model number: SZI-473
3.	Barcode number:
	<input checked="" type="checkbox"/> on gift box: 3760301555971 <input checked="" type="checkbox"/> on carton: 3760301555971
4.	Did the Barcodes on inspected samples conform to specifications/PO requirement: <input type="checkbox"/> Conformed <input type="checkbox"/> Not conformed <input checked="" type="checkbox"/> N/A

**B-6) Shipping marks: Yes**

For export carton	front side marks <input checked="" type="checkbox"/>	side marks <input checked="" type="checkbox"/>
For inner box	front side marks <input type="checkbox"/>	side marks <input type="checkbox"/>

The report reflects the findings at the time and place of inspection. This report does not relieve the sellers/manufacturers from their contractual liabilities or prejudice the buyer's right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment. This report is not used for social proof function in China market.



Report No.: 4913621.01-5

Report Date: 2024-01-04

This is to supersede our report 4913621.00-5 issued on 2023-12-29

**B-7) Color / style / material Conform to Golden Sample?**

<input type="checkbox"/> Yes
<input type="checkbox"/> No, please see remark
<input checked="" type="checkbox"/> N/A, no Golden sample

**C. ON-SITE CHECKING**

Test performed	Sample size	Result	Comments
Hi-pot check	50pcs	Pass	1500V, 5mA, 2S, no breakdown
Earth continuity check	5pcs	Pass	12V, 25A, less than 0.1ohm. Note: need to open the unit to conduct the test
Basic function check	50pcs	Pass	Switch on / off at 230V, 50Hz
Smell check	50pcs	Pass	No abnormal smell
Full function check	5pcs	Pass	According to instruction manual and package artwork
Input power consumption check	5pcs	Pass	1250-1276W at 230VAC, 50Hz
Internal check	3pcs	-	Check internal workmanship
Endurance check	3pcs	Pass	At 230V, 50Hz, 10 cycles
Rub check	3pcs	Information	15S with water, then 15S with alcohol
Tape check	3pcs	Pass	With 3M #810 tape
Strain relief check	3pcs	N/A	100N, 25times, displacement less than 2mm
Stability check	3pcs	Pass	At 15° inclined plane, not overturn
Power cord length check	3pcs	Pass	94.8-95.1cm without plug
Application check	2pcs	Pass	Actual use
Water taste test	5pcs	Pass	To check whether there is any abnormal smell or taste in boiled water
Coffee brewing temperature check	2pcs	Reference	82/81°C.
Thermal fuse check	1pc	-	1.15 times of power input, short circuit the thermostat and power on the unit, the thermal fuse function was good (opened), no safety issue after checking
Critical component check	1pc	Pass	Check against CDF

**D. OTHER INFORMATION**

	Please note																																																		
1.	50 Cartons were randomly sampled from the batch of above item subjected for inspection																																																		
2.	<input checked="" type="checkbox"/> Selected carton number: <table border="1" style="width: 100%; text-align: center;"> <tr> <td>197</td><td>399</td><td>383</td><td>233</td><td>333</td><td>268</td><td>39</td><td>168</td><td>103</td><td>318</td> </tr> <tr> <td>214</td><td>228</td><td>171</td><td>313</td><td>8</td><td>397</td><td>291</td><td>252</td><td>143</td><td>348</td> </tr> <tr> <td>219</td><td>17</td><td>255</td><td>58</td><td>271</td><td>225</td><td>82</td><td>69</td><td>274</td><td>319</td> </tr> <tr> <td>380</td><td>320</td><td>114</td><td>162</td><td>90</td><td>37</td><td>391</td><td>189</td><td>112</td><td>361</td> </tr> <tr> <td>159</td><td>161</td><td>360</td><td>280</td><td>302</td><td>347</td><td>147</td><td>43</td><td>78</td><td>102</td> </tr> </table>	197	399	383	233	333	268	39	168	103	318	214	228	171	313	8	397	291	252	143	348	219	17	255	58	271	225	82	69	274	319	380	320	114	162	90	37	391	189	112	361	159	161	360	280	302	347	147	43	78	102
197	399	383	233	333	268	39	168	103	318																																										
214	228	171	313	8	397	291	252	143	348																																										
219	17	255	58	271	225	82	69	274	319																																										
380	320	114	162	90	37	391	189	112	361																																										
159	161	360	280	302	347	147	43	78	102																																										
3.	<input type="checkbox"/> Carton no. was not assigned.																																																		

The report reflects the findings at the time and place of inspection. This report does not relieve the sellers/manufacturers from their contractual liabilities or prejudice the buyer's right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment. This report is not used for social proof function in China market.



Report No.: 4913621.01-5

Report Date: 2024-01-04

This is to supersede our report 4913621.00-5 issued on 2023-12-29

**E. Critical component data**

	Component	Trade Mark	Model	Technical data	Conformity mark	Results
1.	Plug	LIAN DUNG	LT-322	16A 250V~	VDE	Pass
2.	Power cord	LIAN DUNG	H05VV-F	3G0.75mm <sup>2</sup>	VDE	Pass
3.	Connector	LIAN DUNG	LT-511	10A 250V	VDE	Pass
4.	Appliance inlet	ZX	AS-01	10A 250V	VDE	Pass
5.	Power switch	ZX	KCD1-B2	250V 10(6)A T105	TUV	Pass
6.	Micro switch	ZX	KW11-3Z	AC250V 5A T125 5E4	TUV	Pass
7.	Micro switch	DONGNAN	KW4A(S)	AC250V 5(2)A T125 5E4	VDE	Pass
8.	Flowmeter	--	AB32-S21P012C-11R	--	Tested appliance with	Pass
9.	Pump	Jiayin	JYPC-5B05	AC220-240V 50Hz 58W Class H	Tested appliance with	Pass
10.	Protector for pump	--	BR-B5D	100°C	VDE	Pass
11.	Heating element	--	CM9002	230V 1300W	Tested appliance with	Pass
12.	Thermostat	--	KSD301-G	250V~10A 135°C	TUV	Pass
13.	Thermal fuse	--	SF214R0	216°C 15A	Tested appliance with	Pass
14.	Solenoid valve	Jiayin	JYZ-3	AC230V 50Hz 9-12VA 0.02-2.0MPa Class H	TUV	Pass
15.	Grinder motor	--	KH44/33-A	DC220-240V 150W Class 155	Tested appliance with	Pass
16.	Gear DC motor	--	JS-530T	DC12V	Tested appliance with	Pass
17.	Brewing motor	--	KH37/39-E	DC220-240V Class 155	Tested appliance with	Pass
18.	PCB	--	KB-6150	94V-0 130°C	Tested appliance with & ULE123995	Pass
19.	X capacitor (CX1)	--	MPX	0.1μF 275V~ T110	VDE	Pass
20.	X capacitor (CX2)	--	MPX	0.33μF 275V~ T110	VDE	Pass
21.	Varistor	--	10D471K	--	VDE	Pass
22.	Relay	SANYOU	SJ-SH-112DMH2	10A 250V	VDE	Pass
23.	Relay	SANYOU	SM-S-112DM	16A 250V	VDE	Pass
24.	Fuse	--	932	T6.3AL 250V	VDE	Pass
25.	PTC thermistor	--	GR265 800	--	--	Pass
26.	Thermal protector on PCB	--	C17AM021A5P	--	Tested appliance with	Pass

Remark: Above components are tested against CDF under BV test report#: BAHR-EGZ-P23070170.

The report reflects the findings at the time and place of inspection. This report does not relieve the sellers/manufacturers from their contractual liabilities or prejudice the buyer's right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment. This report is not used for social proof function in China market.

This is to supersede our report 4913621.00-5 issued on 2023-12-29

**F. Pictures**

	
<p>1. Warehouse</p>	<p>2. Export carton view</p>
	
<p>3. Shipping mark</p>	<p>4. Barcode</p>
	
<p>5. Side mark</p>	<p>6. Side mark</p>

The report reflects the findings at the time and place of inspection. This report does not relieve the sellers/manufacturers from their contractual liabilities or prejudice the buyer's right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment. This report is not used for social proof function in China market.

This is to supersede our report 4913621.00-5 issued on 2023-12-29



7. Carton packing view



8. Gift box view



9. Gift box view



10. Gift box view



11. Gift box view



12. Gift box view

The report reflects the findings at the time and place of inspection. This report does not relieve the sellers/manufacturers from their contractual liabilities or prejudice the buyer's right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment. This report is not used for social proof function in China market.

This is to supersede our report 4913621.00-5 issued on 2023-12-29



13. Gift box view




14. Gift box details



15. Gift box details



16. Gift box details

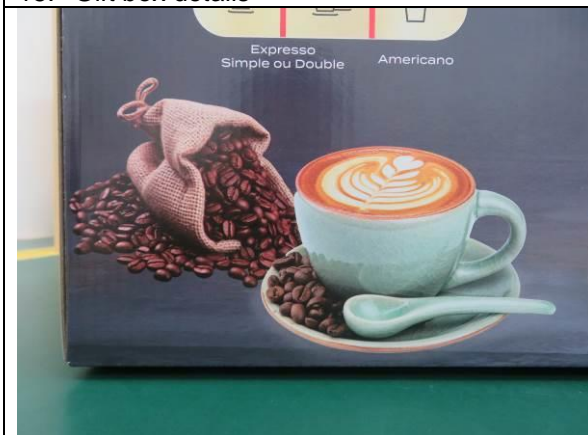

17. Gift box details



18. Gift box details

The report reflects the findings at the time and place of inspection. This report does not relieve the sellers/manufacturers from their contractual liabilities or prejudice the buyer's right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment. This report is not used for social proof function in China market.

This is to supersede our report 4913621.00-5 issued on 2023-12-29



19. Gift box details



20. Gift box details



21. Gift box details



22. Gift box details



23. Gift box details



24. Gift box details

The report reflects the findings at the time and place of inspection. This report does not relieve the sellers/manufacturers from their contractual liabilities or prejudice the buyer's right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment. This report is not used for social proof function in China market.

This is to supersede our report 4913621.00-5 issued on 2023-12-29



25. Gift box details



26. Gift box details



27. Gift box details



28. Gift box details



29. Gift box details




30. Gift box details

The report reflects the findings at the time and place of inspection. This report does not relieve the sellers/manufacturers from their contractual liabilities or prejudice the buyer's right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment. This report is not used for social proof function in China market.

This is to supersede our report 4913621.00-5 issued on 2023-12-29



31. Gift box details

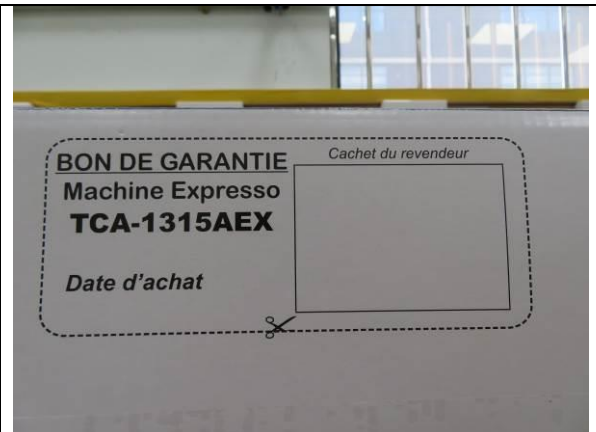

32. Gift box details



33. Gift box open view



34. Gift box layer









35. Packing



36. Packing

The report reflects the findings at the time and place of inspection. This report does not relieve the sellers/manufacturers from their contractual liabilities or prejudice the buyer's right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment. This report is not used for social proof function in China market.


This is to supersede our report 4913621.00-5 issued on 2023-12-29

	
<p>37. Packing</p>	<p>38. Packing</p>
	
<p>39. Poly bag (packing for IM)</p>	<p>40. Poly bag (packing for IM)</p>
	
<p>41. Poly bag (packing for drip tray and power cord set)</p>	<p>42. Poly bag (packing for drip tray)</p>


The report reflects the findings at the time and place of inspection. This report does not relieve the sellers/manufacturers from their contractual liabilities or prejudice the buyer's right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment. This report is not used for social proof function in China market.




43. Poly bag (packing for drip tray)

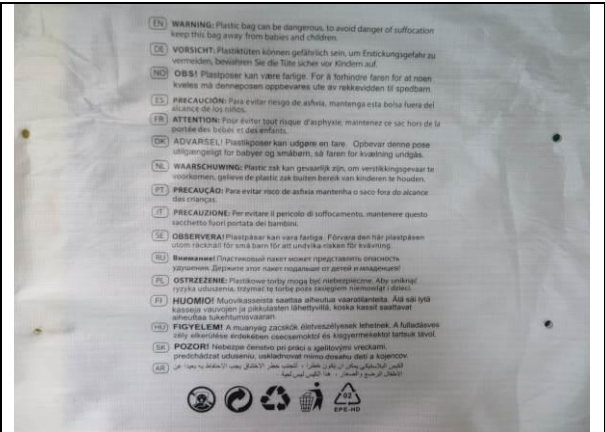

44. Poly bag (packing for main unit)

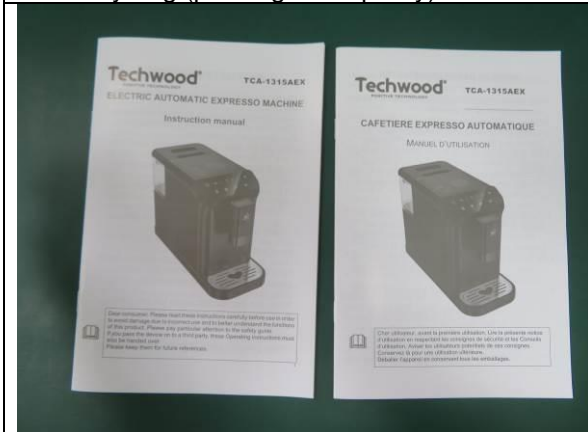

45. IM

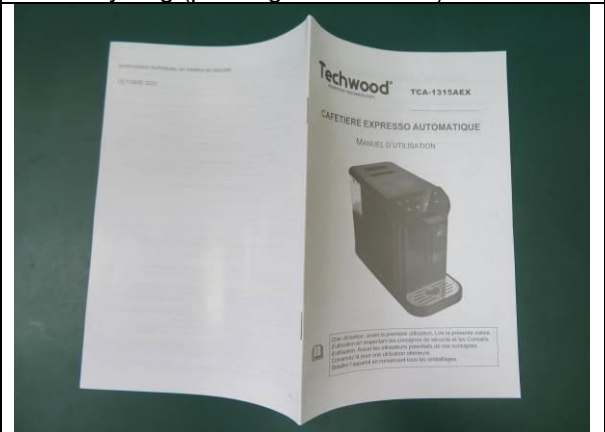

46. IM




47. IM



48. Capital letter height of safety part of IM

The report reflects the findings at the time and place of inspection. This report does not relieve the sellers/manufacturers from their contractual liabilities or prejudice the buyer's right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment. This report is not used for social proof function in China market.


This is to supersede our report 4913621.00-5 issued on 2023-12-29

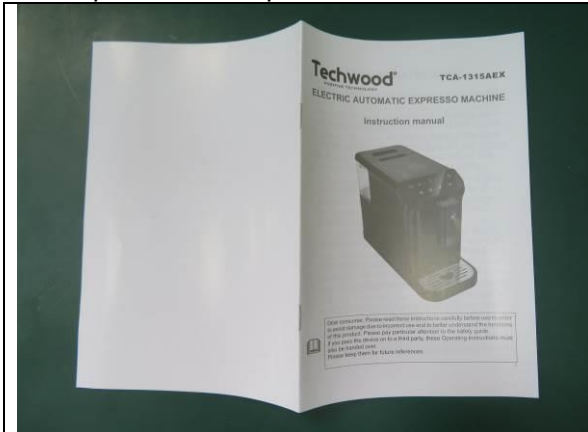

49. IM



50. IM

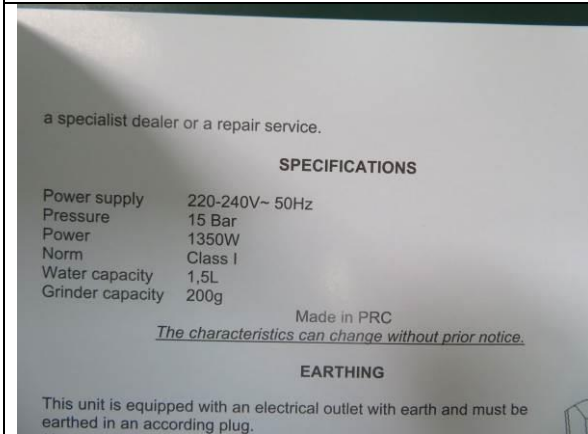

51. IM



52. Product view



53. Drip tray



54. Drip tray

The report reflects the findings at the time and place of inspection. This report does not relieve the sellers/manufacturers from their contractual liabilities or prejudice the buyer's right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment. This report is not used for social proof function in China market.

This is to supersede our report 4913621.00-5 issued on 2023-12-29

	
<p>55. Plate drawer</p>	<p>56. Plate drawer</p>
	
<p>57. Plate drawer</p>	<p>58. Plate drawer</p>
	
<p>59. Printing of plate drawer</p>	<p>60. Brush</p>

The report reflects the findings at the time and place of inspection. This report does not relieve the sellers/manufacturers from their contractual liabilities or prejudice the buyer's right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment. This report is not used for social proof function in China market.

This is to supersede our report 4913621.00-5 issued on 2023-12-29

	
<p>61. Brush</p>	<p>62. Brush</p>
	
<p>63. Power cord set</p>	<p>64. Connector</p>
	
<p>65. Connector</p>	<p>66. Connector</p>

The report reflects the findings at the time and place of inspection. This report does not relieve the sellers/manufacturers from their contractual liabilities or prejudice the buyer's right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment. This report is not used for social proof function in China market.

This is to supersede our report 4913621.00-5 issued on 2023-12-29



67. Plug



68. Power cord



69. Product view



70. Product view



71. Product view



72. Product view

The report reflects the findings at the time and place of inspection. This report does not relieve the sellers/manufacturers from their contractual liabilities or prejudice the buyer's right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment. This report is not used for social proof function in China market.

This is to supersede our report 4913621.00-5 issued on 2023-12-29



73. Product view



74. Product view



75. Product view



76. Product view



77. Product view



78. Product view

The report reflects the findings at the time and place of inspection. This report does not relieve the sellers/manufacturers from their contractual liabilities or prejudice the buyer's right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment. This report is not used for social proof function in China market.

*This is to supersede our report 4913621.00-5 issued on 2023-12-29*



79. Product view



80. Product view



81. Product view



82. Product view



83. Product view



84. Product view

The report reflects the findings at the time and place of inspection. This report does not relieve the sellers/manufacturers from their contractual liabilities or prejudice the buyer's right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment. This report is not used for social proof function in China market.

This is to supersede our report 4913621.00-5 issued on 2023-12-29



85. Product view



86. Product view



87. Product view



88. Product view



89. Product view



90. Product view

The report reflects the findings at the time and place of inspection. This report does not relieve the sellers/manufacturers from their contractual liabilities or prejudice the buyer's right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment. This report is not used for social proof function in China market.


*This is to supersede our report 4913621.00-5 issued on 2023-12-29*



91. Product view



92. Product view

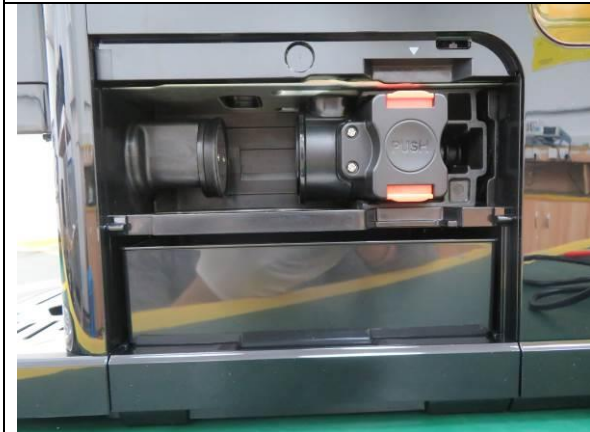

93. Product view



94. Product view



95. Product view



96. Product view

The report reflects the findings at the time and place of inspection. This report does not relieve the sellers/manufacturers from their contractual liabilities or prejudice the buyer's right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment. This report is not used for social proof function in China market.

*This is to supersede our report 4913621.00-5 issued on 2023-12-29*



97. Product view




98. Product view



99. Product view



100. Product view

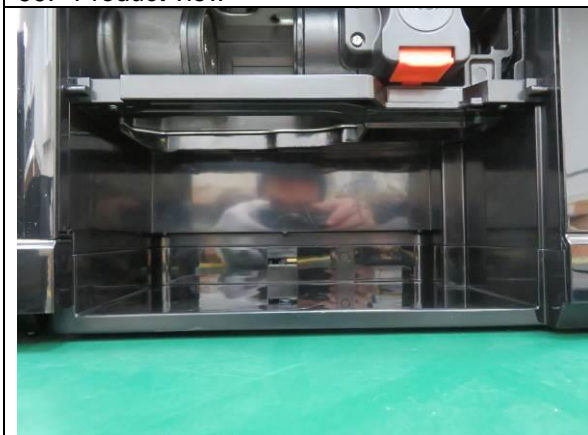

101. Product view




102. Product view

The report reflects the findings at the time and place of inspection. This report does not relieve the sellers/manufacturers from their contractual liabilities or prejudice the buyer's right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment. This report is not used for social proof function in China market.

*This is to supersede our report 4913621.00-5 issued on 2023-12-29*



103. Product view

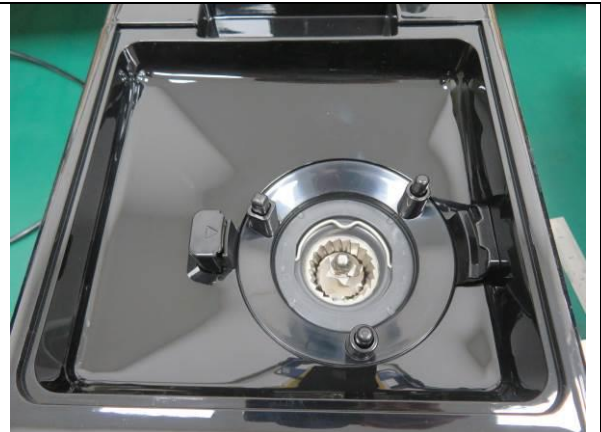

104. Product view



105. Product view



106. Product view








107. Product view



108. Bean container cover

The report reflects the findings at the time and place of inspection. This report does not relieve the sellers/manufacturers from their contractual liabilities or prejudice the buyer's right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment. This report is not used for social proof function in China market.

*This is to supersede our report 4913621.00-5 issued on 2023-12-29*

	
<p>109. Infuser</p>	<p>110. Infuser</p>
	
<p>111. Infuser</p>	<p>112. Infuser</p>
	
<p>113. Infuser</p>	<p>114. Infuser</p>







The report reflects the findings at the time and place of inspection. This report does not relieve the sellers/manufacturers from their contractual liabilities or prejudice the buyer's right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment. This report is not used for social proof function in China market.

*This is to supersede our report 4913621.00-5 issued on 2023-12-29*

	
<p>115. Door</p>	<p>116. Grind setting</p>
	
<p>117. Grind setting</p>	<p>118. Grounds collector and manifold support</p>
	
<p>119. Grounds collector and manifold support</p>	<p>120. Grounds collector and manifold support</p>

The report reflects the findings at the time and place of inspection. This report does not relieve the sellers/manufacturers from their contractual liabilities or prejudice the buyer's right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment. This report is not used for social proof function in China market.

*This is to supersede our report 4913621.00-5 issued on 2023-12-29*

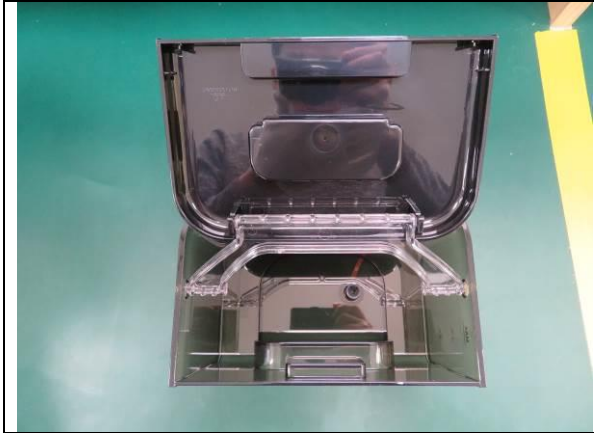	
<p>121. Grounds collector and manifold support</p>	<p>122. Grounds collector and manifold support</p>
	
<p>123. Water tank</p>	<p>124. Water tank</p>
	
<p>125. Water tank</p>	<p>126. Water tank</p>

The report reflects the findings at the time and place of inspection. This report does not relieve the sellers/manufacturers from their contractual liabilities or prejudice the buyer's right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment. This report is not used for social proof function in China market.

*This is to supersede our report 4913621.00-5 issued on 2023-12-29*



127. Water tank



128. Silkscreen



129. Brand logo



130. Water gauge



131. On / off switch



132. Appliance inlet

The report reflects the findings at the time and place of inspection. This report does not relieve the sellers/manufacturers from their contractual liabilities or prejudice the buyer's right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment. This report is not used for social proof function in China market.


This is to supersede our report 4913621.00-5 issued on 2023-12-29




133. Rating label




134. Internal view

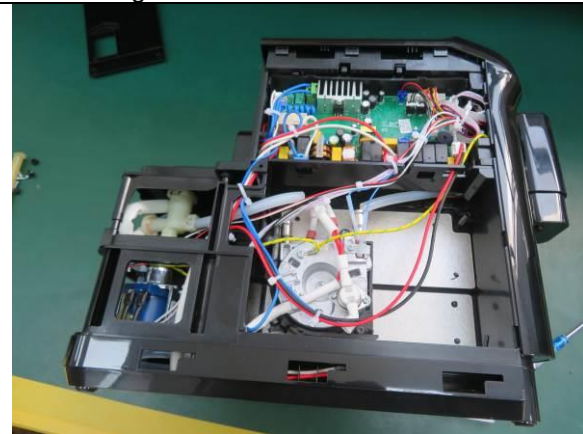


135. Internal view

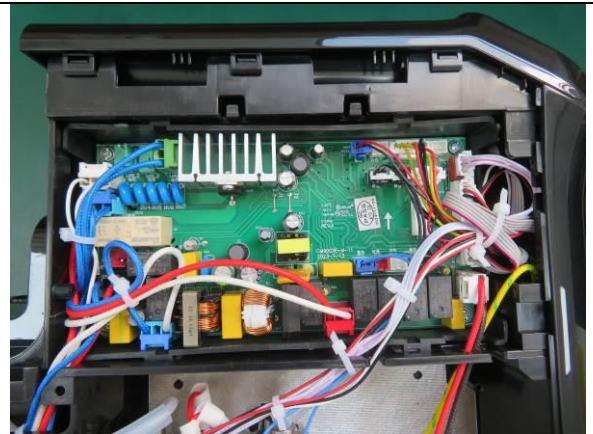

136. Internal view

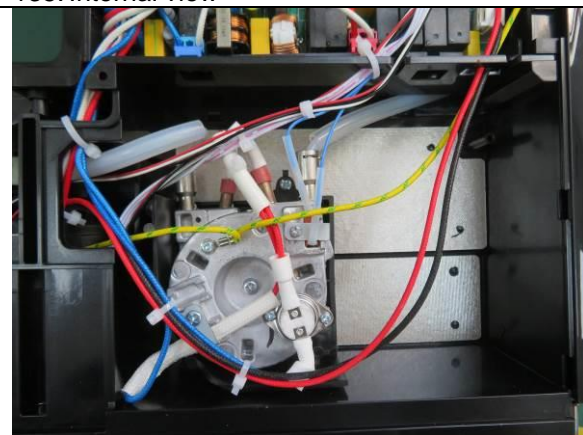

137. Internal view

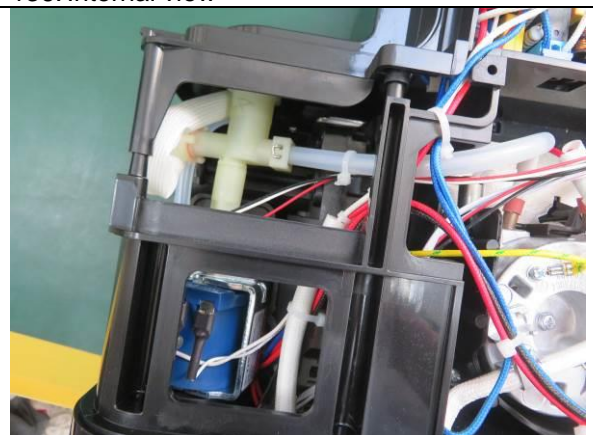


138. Internal view

The report reflects the findings at the time and place of inspection. This report does not relieve the sellers/manufacturers from their contractual liabilities or prejudice the buyer's right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment. This report is not used for social proof function in China market.

*This is to supersede our report 4913621.00-5 issued on 2023-12-29*



139. Internal view

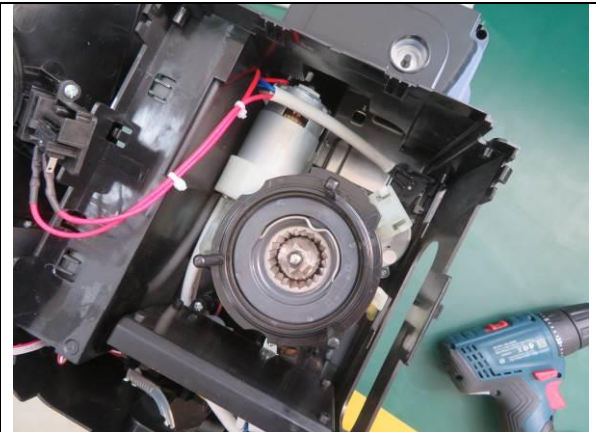


140. Internal view




141. Internal view



142. Internal view

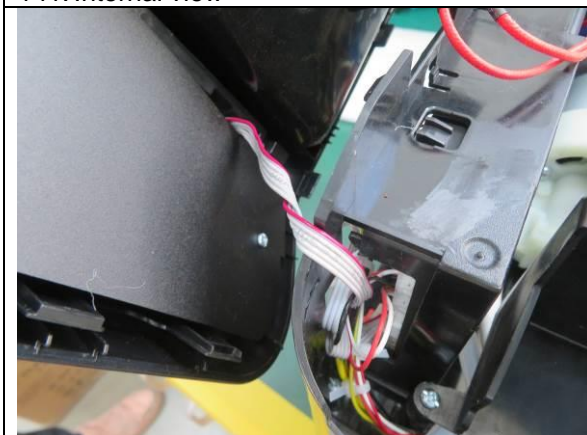

143. Internal view

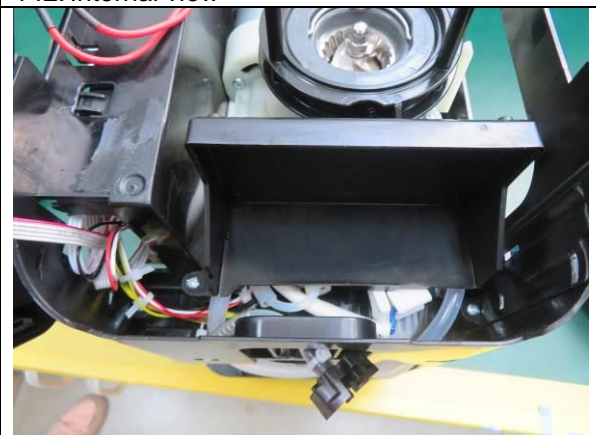


144. Internal view

The report reflects the findings at the time and place of inspection. This report does not relieve the sellers/manufacturers from their contractual liabilities or prejudice the buyer's right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment. This report is not used for social proof function in China market.


This is to supersede our report 4913621.00-5 issued on 2023-12-29



145. Internal view

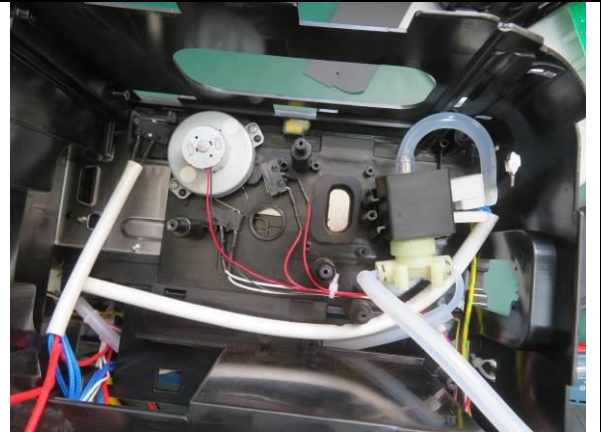


146. Internal view

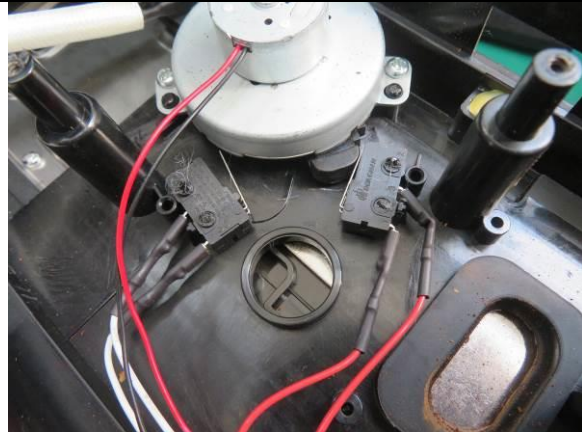

147. Internal view



148. Internal view

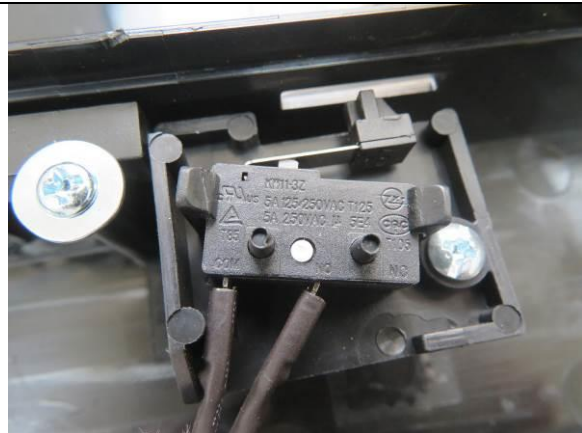


149. Internal view



150. Control PCB

The report reflects the findings at the time and place of inspection. This report does not relieve the sellers/manufacturers from their contractual liabilities or prejudice the buyer's right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment. This report is not used for social proof function in China market.


This is to supersede our report 4913621.00-5 issued on 2023-12-29

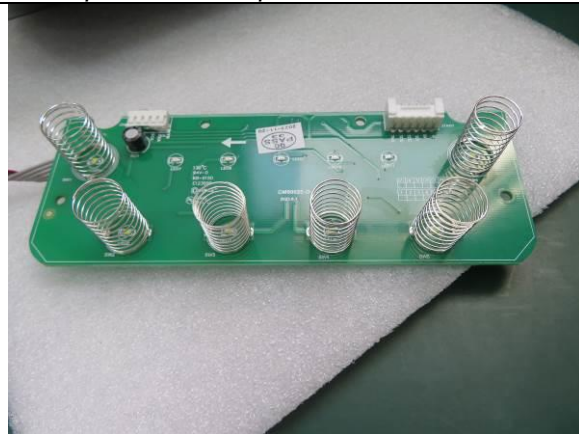


151. Control PCB




152. Control PCB

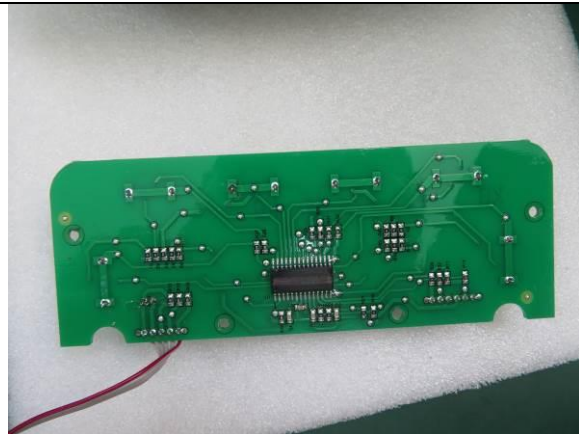


153. Control PCB

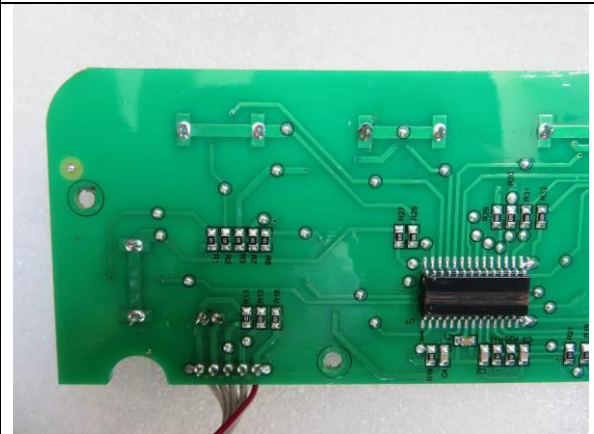

154. Control PCB

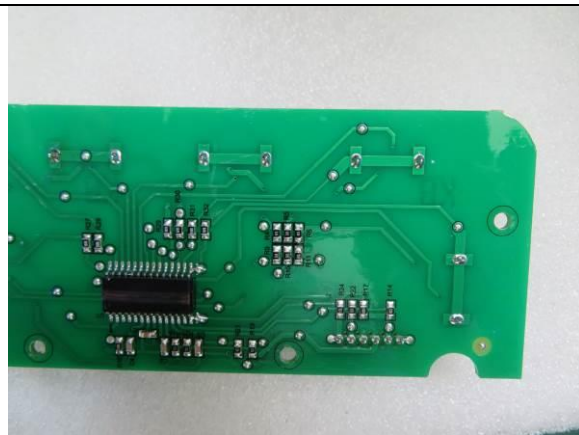


155. Control PCB

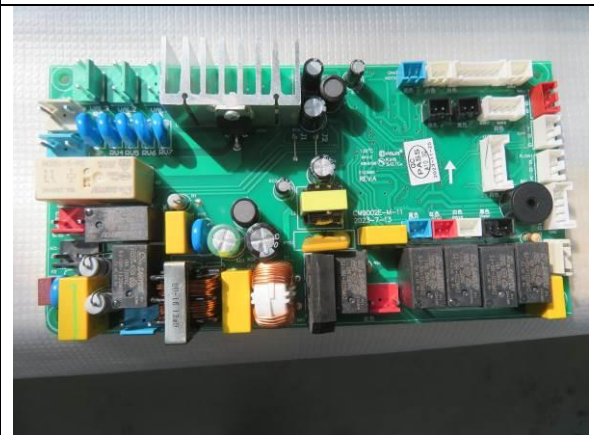


156. Main PCB

The report reflects the findings at the time and place of inspection. This report does not relieve the sellers/manufacturers from their contractual liabilities or prejudice the buyer's right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment. This report is not used for social proof function in China market.


This is to supersede our report 4913621.00-5 issued on 2023-12-29

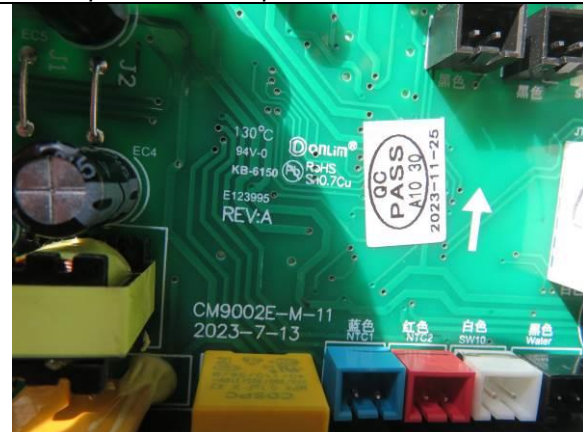


157. Main PCB

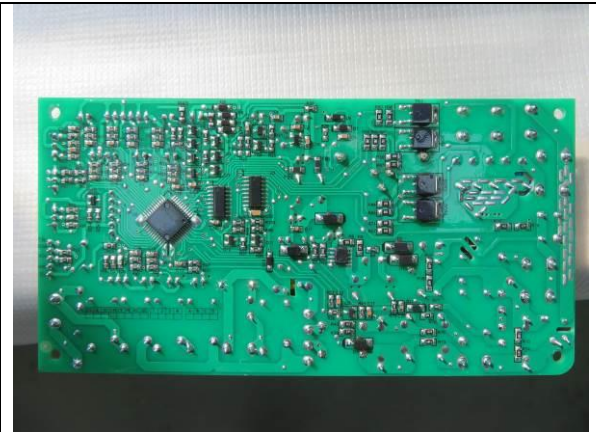


158. Main PCB

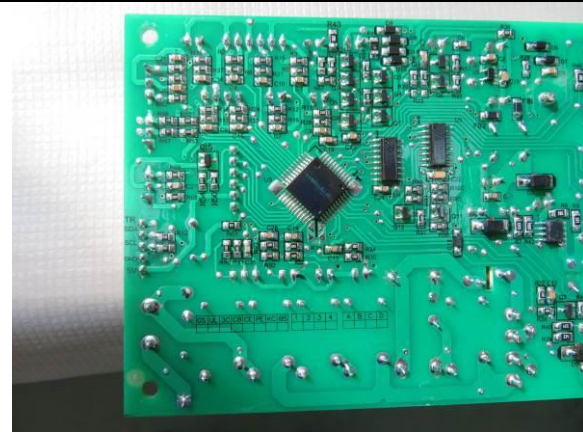


159. Main PCB

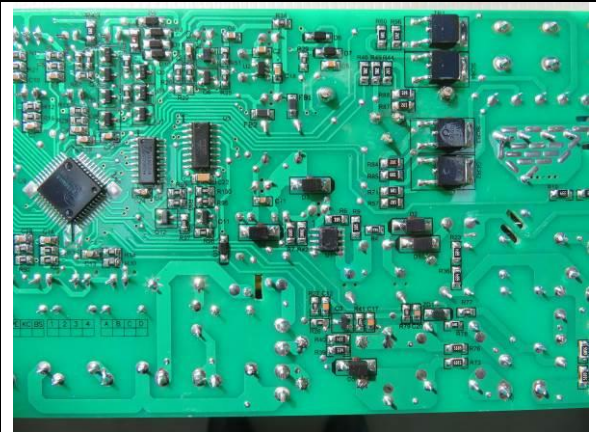

160. Main PCB

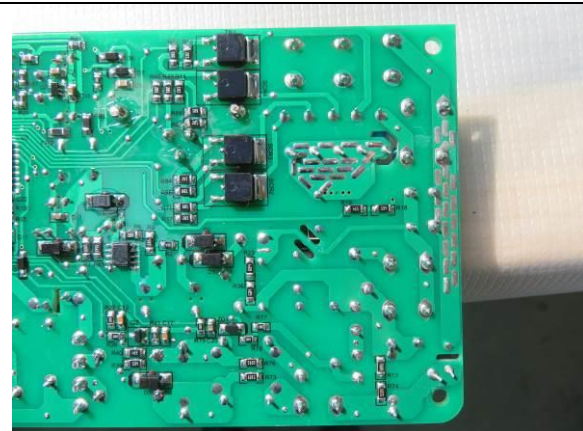


161. Main PCB

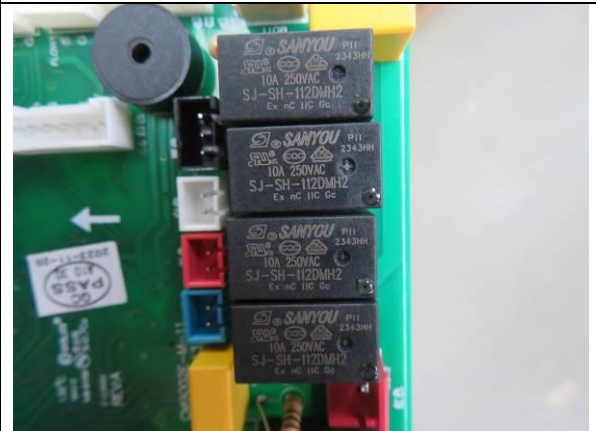


162. Relay

The report reflects the findings at the time and place of inspection. This report does not relieve the sellers/manufacturers from their contractual liabilities or prejudice the buyer's right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment. This report is not used for social proof function in China market.


This is to supersede our report 4913621.00-5 issued on 2023-12-29

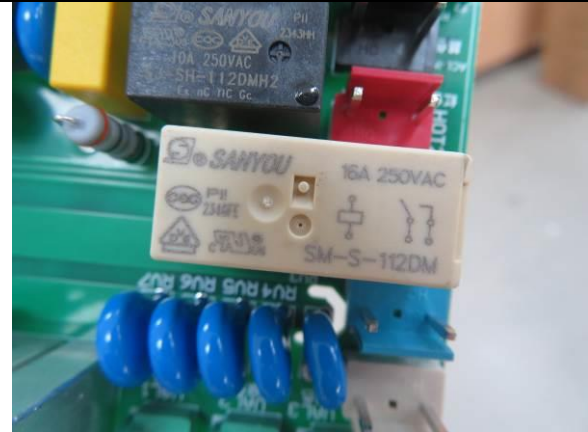


163. Relay

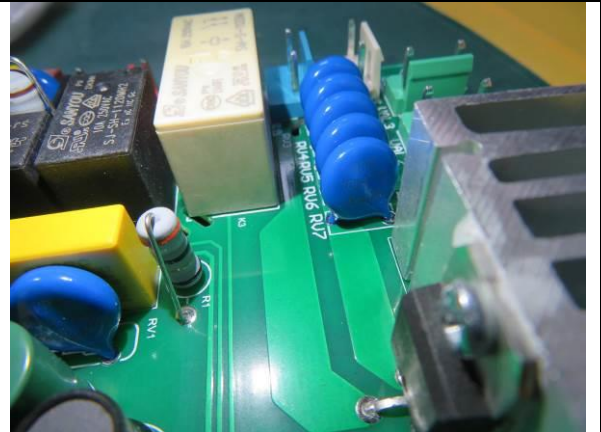


164. Varistor

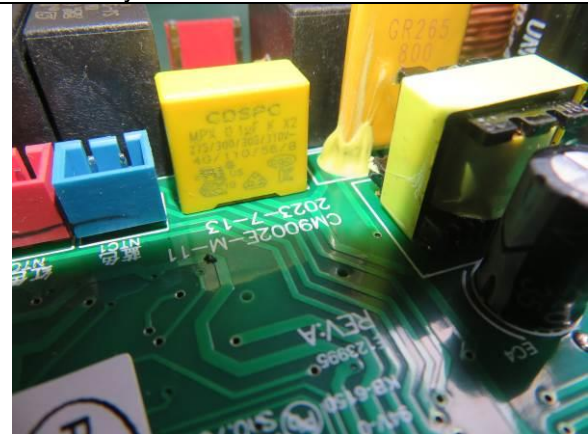


165. X capacitor

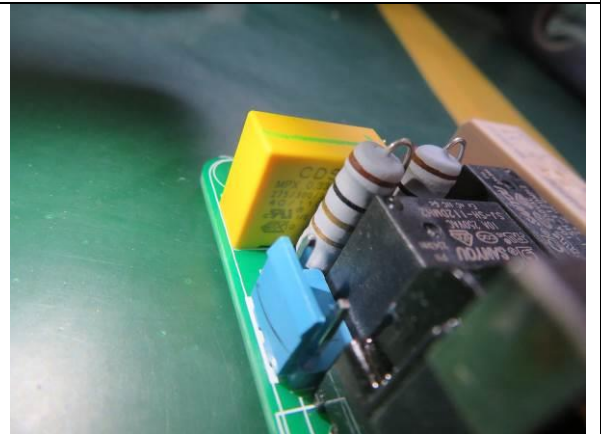

166. X capacitor

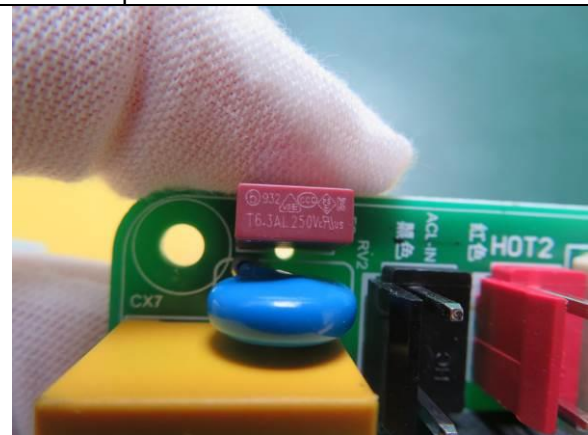


167. Current fuse

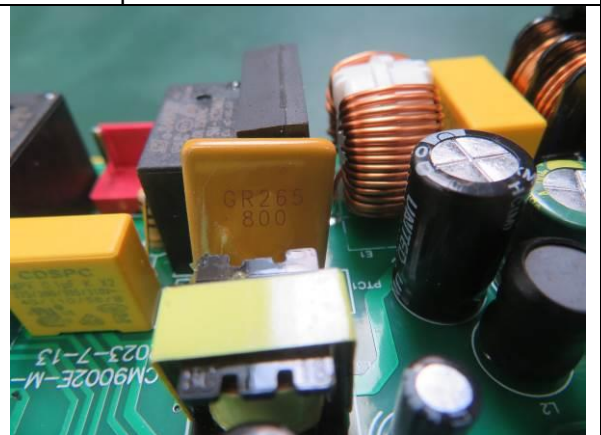

168. PTC thermistor

The report reflects the findings at the time and place of inspection. This report does not relieve the sellers/manufacturers from their contractual liabilities or prejudice the buyer's right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment. This report is not used for social proof function in China market.

This is to supersede our report 4913621.00-5 issued on 2023-12-29

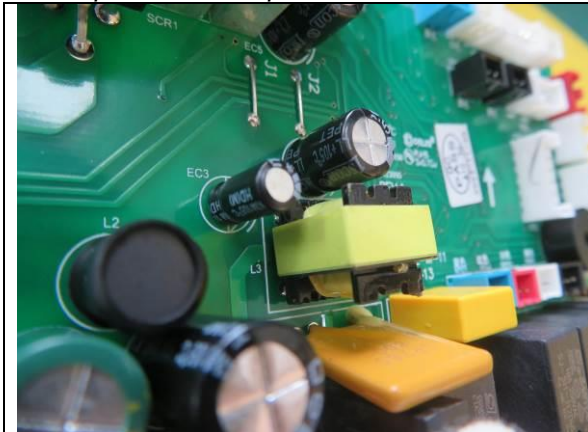

169. Transformer




170. Solenoid valve



171. Grind motor



172. Grind motor

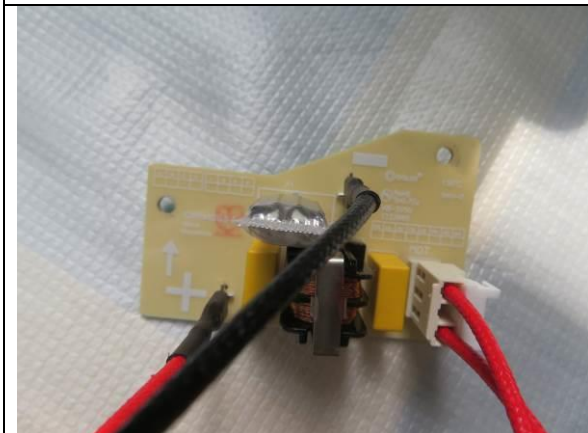


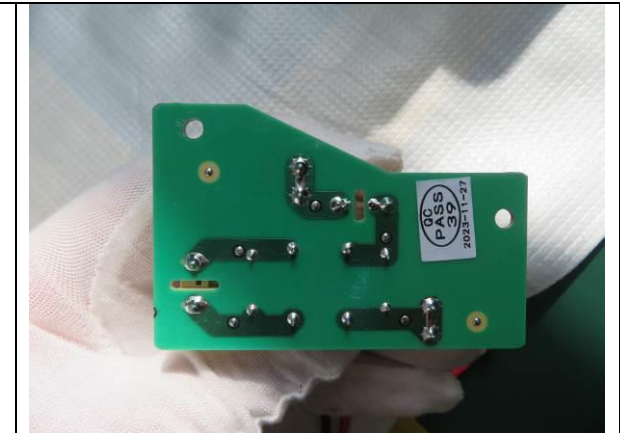
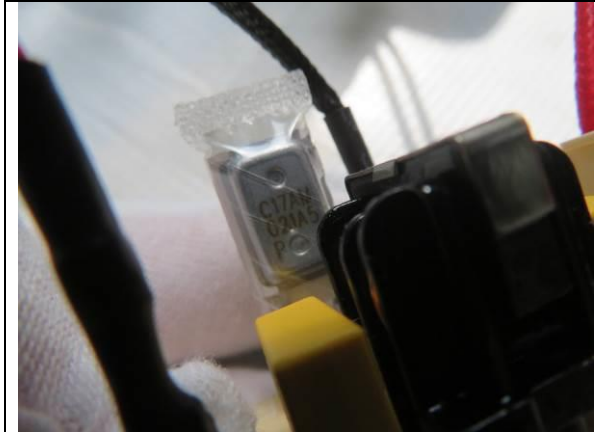
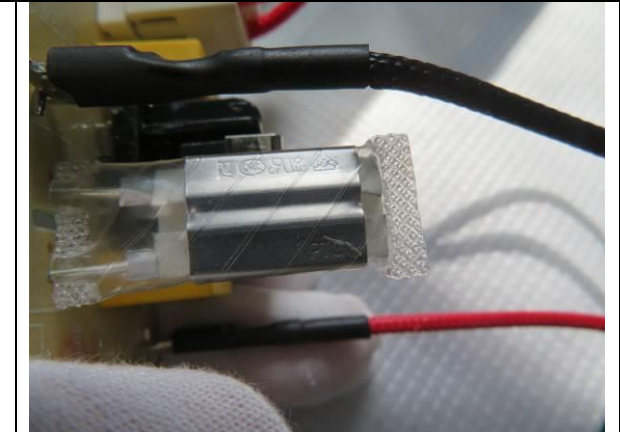

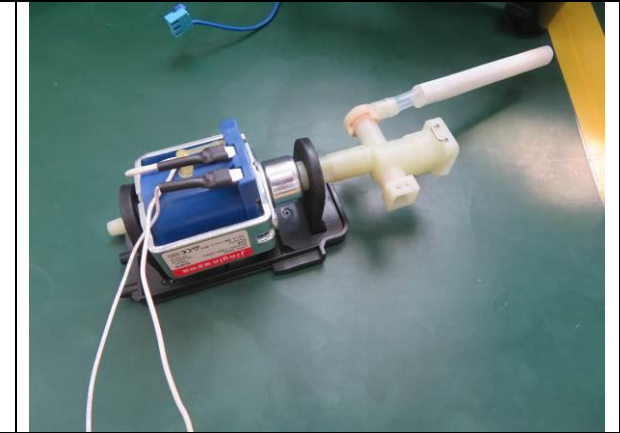
173. PCB



174. PCB

The report reflects the findings at the time and place of inspection. This report does not relieve the sellers/manufacturers from their contractual liabilities or prejudice the buyer's right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment. This report is not used for social proof function in China market.

*This is to supersede our report 4913621.00-5 issued on 2023-12-29*


	
<p>175. PCB</p>	<p>176. PCB</p>
	
<p>177. Thermal protector on PCB</p>	<p>178. Thermal protector on PCB</p>
	
<p>179. X capacitor</p>	<p>180. Pump</p>

The report reflects the findings at the time and place of inspection. This report does not relieve the sellers/manufacturers from their contractual liabilities or prejudice the buyer's right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment. This report is not used for social proof function in China market.


This is to supersede our report 4913621.00-5 issued on 2023-12-29



181. Pump

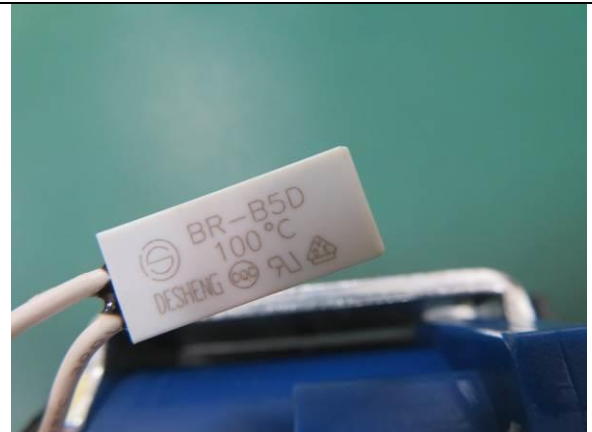

182. Protector for pump

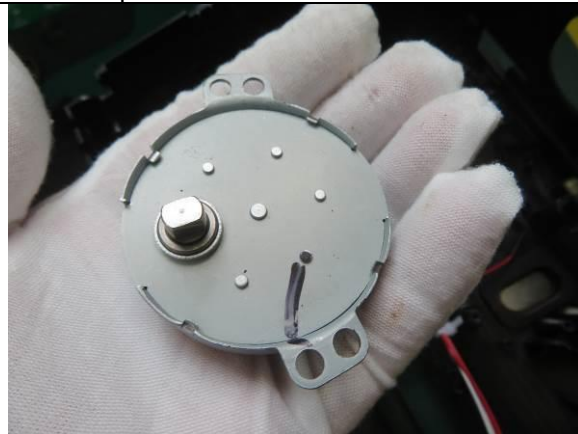


183. Gear DC motor



184. Gear DC motor



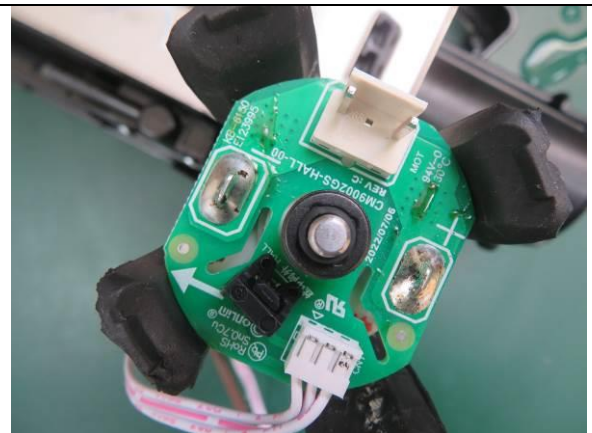


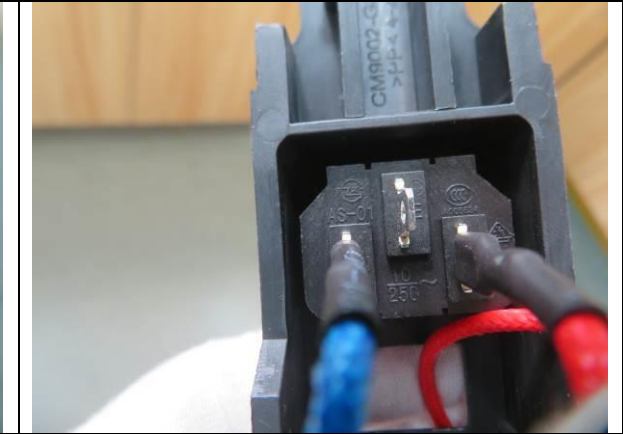


185. Gear DC motor



186. PCB on brewing motor

The report reflects the findings at the time and place of inspection. This report does not relieve the sellers/manufacturers from their contractual liabilities or prejudice the buyer's right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment. This report is not used for social proof function in China market.

This is to supersede our report 4913621.00-5 issued on 2023-12-29


	
<p>187. Brewing motor</p>	<p>188. Power switch</p>
	
<p>189. Power switch</p>	<p>190. Appliance inlet</p>
	
<p>191. Appliance inlet</p>	<p>192. Flowmeter</p>

The report reflects the findings at the time and place of inspection. This report does not relieve the sellers/manufacturers from their contractual liabilities or prejudice the buyer's right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment. This report is not used for social proof function in China market.


This is to supersede our report 4913621.00-5 issued on 2023-12-29



193. Heating element

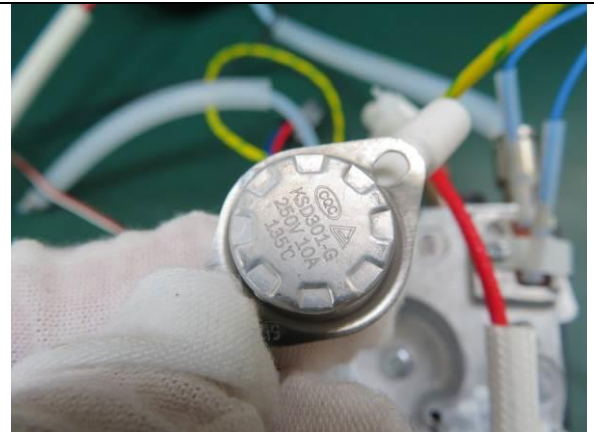

194. Thermostat

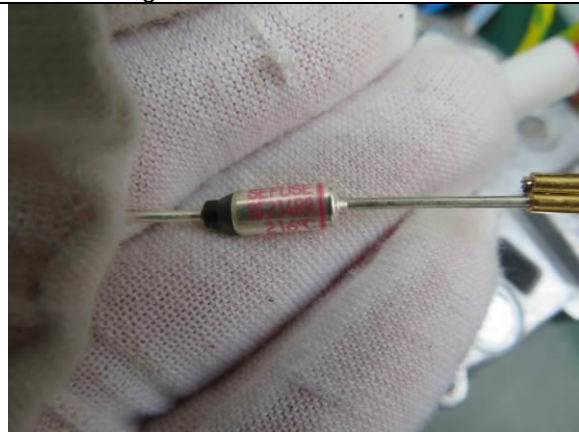

195. Thermal link



196. Thermal link




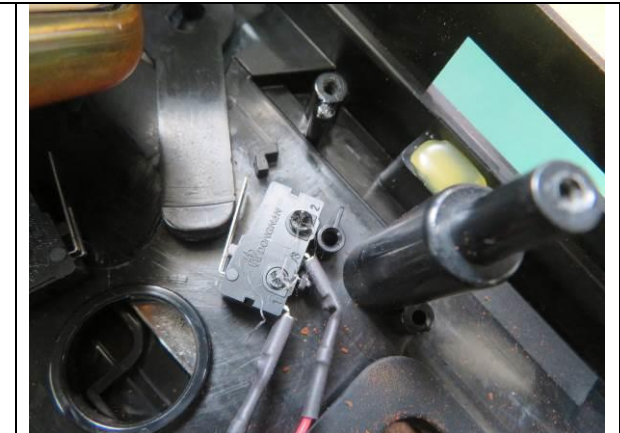
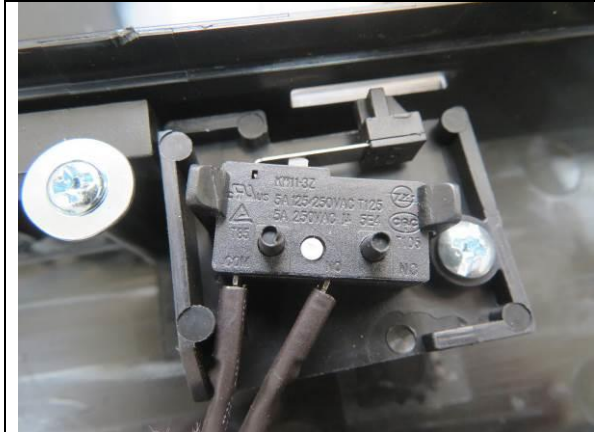
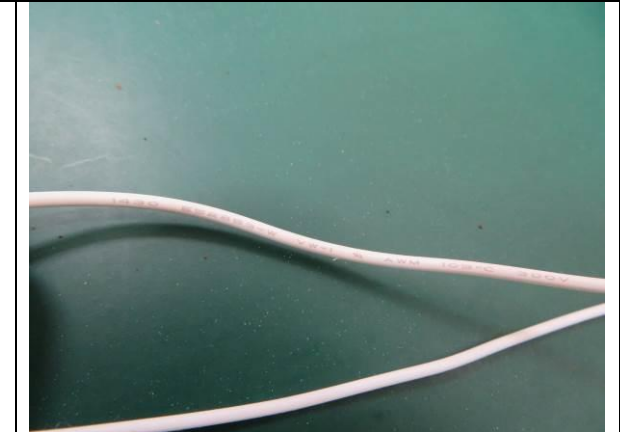


197. Micro switch



198. Micro switch

The report reflects the findings at the time and place of inspection. This report does not relieve the sellers/manufacturers from their contractual liabilities or prejudice the buyer's right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment. This report is not used for social proof function in China market.

*This is to supersede our report 4913621.00-5 issued on 2023-12-29*

	
<p>199. Micro switch</p>	<p>200. Micro switch</p>
	
<p>201. Micro switch</p>	<p>202. Internal wire</p>
	
<p>203. Internal wire</p>	<p>204. Internal wire</p>

The report reflects the findings at the time and place of inspection. This report does not relieve the sellers/manufacturers from their contractual liabilities or prejudice the buyer's right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment. This report is not used for social proof function in China market.


This is to supersede our report 4913621.00-5 issued on 2023-12-29



205. Internal wire



206. Internal wire

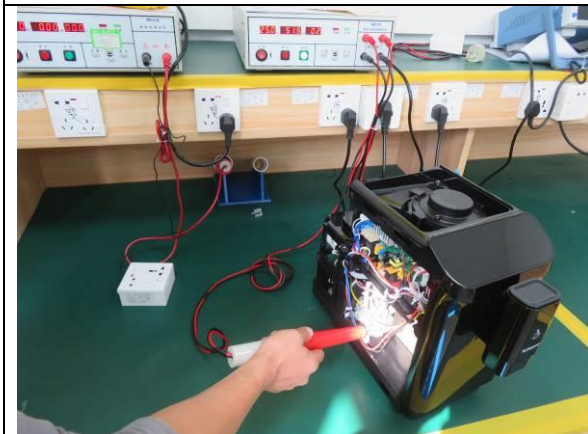

207. Earth continuity test



208. Earth continuity test



209. Hi-pot test



210. Hi-pot test

The report reflects the findings at the time and place of inspection. This report does not relieve the sellers/manufacturers from their contractual liabilities or prejudice the buyer's right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment. This report is not used for social proof function in China market.

This is to supersede our report 4913621.00-5 issued on 2023-12-29



211. Input power consumption check



212. Input power consumption check



213. Function check



214. Function check




215. Function check



216. Function check

The report reflects the findings at the time and place of inspection. This report does not relieve the sellers/manufacturers from their contractual liabilities or prejudice the buyer's right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment. This report is not used for social proof function in China market.

This is to supersede our report 4913621.00-5 issued on 2023-12-29

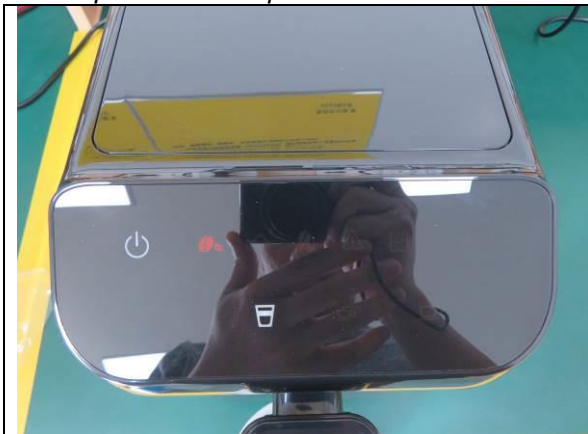

217. Function check



218. Function check



219. Function check



220. Function check



221. Function check



222. Function check

The report reflects the findings at the time and place of inspection. This report does not relieve the sellers/manufacturers from their contractual liabilities or prejudice the buyer's right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment. This report is not used for social proof function in China market.

*This is to supersede our report 4913621.00-5 issued on 2023-12-29*



223. Endurance check



224. Pre-heating time



225. Application check



226. Fine grinding



227. Coarsest grinding



228. Application check

The report reflects the findings at the time and place of inspection. This report does not relieve the sellers/manufacturers from their contractual liabilities or prejudice the buyer's right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment. This report is not used for social proof function in China market.


This is to supersede our report 4913621.00-5 issued on 2023-12-29



229. Brewing temperature check



230. Application check

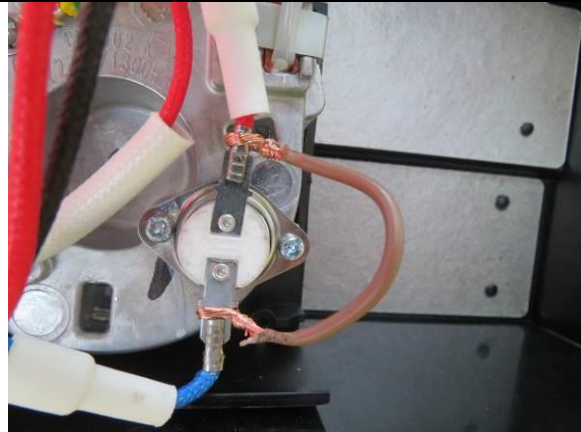

231. Thermal fuse function check



232. Thermal fuse function check



233. Thermal fuse function check



234. Tape check

The report reflects the findings at the time and place of inspection. This report does not relieve the sellers/manufacturers from their contractual liabilities or prejudice the buyer's right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment. This report is not used for social proof function in China market.

This is to supersede our report 4913621.00-5 issued on 2023-12-29



235. Rub check



236. Rub check



237. Stability check



238. Power cord length check



239. CE / WEEE symbol size check



240. CE / WEEE symbol size check

The report reflects the findings at the time and place of inspection. This report does not relieve the sellers/manufacturers from their contractual liabilities or prejudice the buyer's right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment. This report is not used for social proof function in China market.


This is to supersede our report 4913621.00-5 issued on 2023-12-29




241. CE / WEEE symbol size check



242. CE / WEEE symbol size check

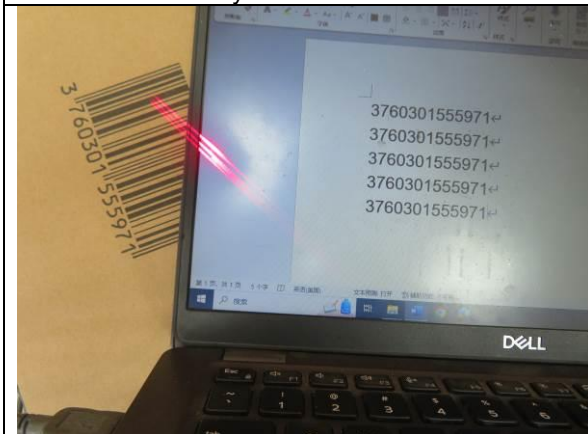

243. Barcode verification

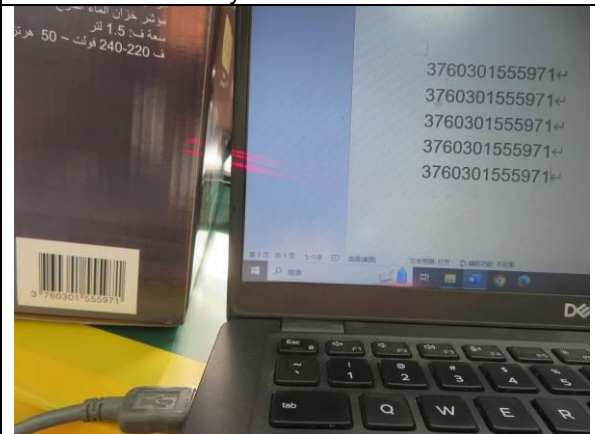

244. Barcode verification



245. QR code check



246. QR code check

The report reflects the findings at the time and place of inspection. This report does not relieve the sellers/manufacturers from their contractual liabilities or prejudice the buyer's right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment. This report is not used for social proof function in China market.

This is to supersede our report 4913621.00-5 issued on 2023-12-29



247. Capacity check



248. Capacity check



249. Smell check



250. Major defect: Poor sticking (slant) on the rating label




251. Minor defect: Scratch mark on the housing



252. Minor defect: Scratch mark on the housing

The report reflects the findings at the time and place of inspection. This report does not relieve the sellers/manufacturers from their contractual liabilities or prejudice the buyer's right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment. This report is not used for social proof function in China market.

*This is to supersede our report 4913621.00-5 issued on 2023-12-29*

	<p>No photo.</p>
<p>253. Minor defect: Scratch mark on plate drawer</p>	<p>254. N/A</p>

**-END OF REPORT-**

The report reflects the findings at the time and place of inspection. This report does not relieve the sellers/manufacturers from their contractual liabilities or prejudice the buyer's right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment. This report is not used for social proof function in China market.