



Report No.: 4907024.01-6

Report Date: 2023-07-28

This is to supersede our report 4907024.00-6 issued on 2023-07-28

Inspection report

Client:	Sotech International	Tel:	--	Fax:	--
Attn:	Alain	Supplier:	--		
Inspection Date:	2023-07-27	<input type="checkbox"/> 1 st / 2 nd Re-inspection (Previous Report No.: N/A)			
Product Description:	Rice cooker				
Manufacturer Name:	Guangdong Gaobo Electric Appliance Co., Ltd.				
Manufacturer Location:	West Industrial Park, Liangdong Town, Lianjiang City, Guangdong Province, China				
Manufacturer Contact:	Mr. ZHANG				
Service Required:	<input checked="" type="checkbox"/> FRI (Final Random Inspection)	<input type="checkbox"/> DPI (During Production Inspection)	<input type="checkbox"/>		


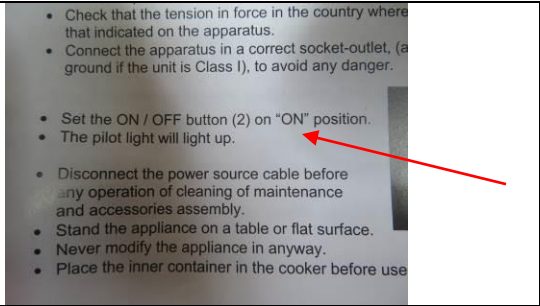

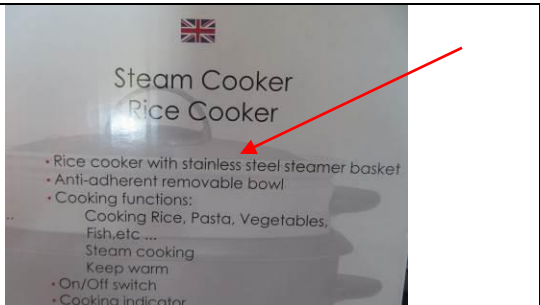
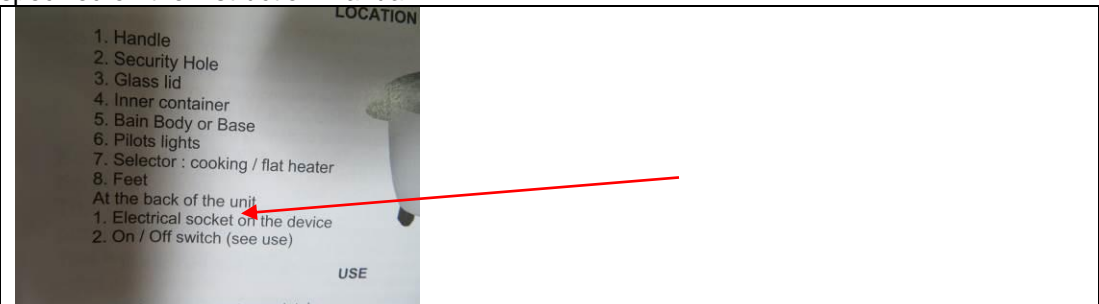
P/O No.	Item No.	Order Qty.	Shipment Qty.	Sales destination	Carton Qty.	Inspected Qty.	Packed CTN (%)	Production (%)	Sample Size
20230503	TCR-105	1200pcs	1200pcs	France	300ctns	1200pcs	100%	100%	28pcs
20230503	TCR-156	1200pcs	1200pcs	France	300ctns	1200pcs	100%	100%	28pcs
20230503	TCRV-2504	1000pcs	1000pcs	France	250ctns	1000pcs	100%	100%	24pcs
Total:		3400pcs	3400pcs	--	850ctns	3400pcs	100%	100%	80pcs

INSPECTION RESULT:	<input checked="" type="checkbox"/> PASS <input type="checkbox"/> FAIL <input type="checkbox"/> PENDING (If Fail or Pending) due to remarks of:
ON-SITE CC (Construction check) INFORMATION:	<input checked="" type="checkbox"/> N/A <input type="checkbox"/> The On-site CC for this item was performed on (N/A) as per our report no. (N/A) with the result - <input type="checkbox"/> PASS <input type="checkbox"/> FAIL <input type="checkbox"/> PENDING

A-1): AQL and Defects Finding

Inspection Sampling Standard Adopted: <input checked="" type="checkbox"/> ISO 2859-1		Nonconformity (defective)		
Inspection Plan:	Single sampling plans for normal Inspection	Critical	Major	Minor
Inspection Level:	Fixed	AQL: Not Allowed	2.5	4.0
Inspection with:	<input type="checkbox"/> approved sample <input type="checkbox"/> specific check list <input checked="" type="checkbox"/> general check list	Sample Size:	80	80
Defect Description				
For item TCR-105, sample size 28pcs				
Glue residual on control panel.		0	0	1
Dent mark on main housing.		0	0	1
For item TCR-156, sample size 28pcs				
Poor coating on inner pot.		0	1	0
Scratch mark on control panel.		0	0	1
Slightly poor silk-screen printing on the letter of "C".		0	0	1
For item TCRV-2504, sample size 24pcs				
Scratch mark on control panel.		0	0	1
Total Found:		0	1	5
Max. Allowed:		0	5	7

The report reflects the findings at the time and place of inspection. This report does not relieve the sellers/manufacturers from their contractual liabilities or prejudice the buyer's right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment. This report is not used for social proof function in China market.


A-2: Remarks and Comments		
	Please confirm	Status
1	<p>For operating the item TCR-156 and TCRV-2504, actual the button should be set on “I” position instead of “ON” position specified on instruction manual.</p>   <p>Actual button with “I” marking Instruction manual information</p> <p>Accepted by client email dated 2023-07-28.</p>	Information
2	<p>For item TCRV-2504, actual the steamer was aluminium instead of “stainless steel” specified on gift box.</p>   <p>Actual steamer Gift box information</p> <p>Accepted by client email dated 2023-07-28.</p>	Information
3	<p>For item TCR-105 and TCR-156, no socket was found on the actual product, but it was specified on the instruction manual.</p>  <p>Instruction manual information</p> <p>Accepted by client email dated 2023-07-28.</p>	Information
4	<p>For the illustration of instruction manual of item TCRV-2504, actual the indicator light for keep warm was “8”, while the description was “7”; and actual the indicator light for heating was “7”, while the description was “8”.</p>	Information

The report reflects the findings at the time and place of inspection. This report does not relieve the sellers/manufacturers from their contractual liabilities or prejudice the buyer's right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment. This report is not used for social proof function in China market.

Report No.: 4907024.01-6



Report Date: 2023-07-28

This is to supersede our report 4907024.00-6 issued on 2023-07-28

		<p style="text-align: right;">LOCATION</p> <ol style="list-style-type: none"> 1. Safety glass lid with handle 2. Steam Basket 3. Handles 4. Cooking Pot 5. Body of the unit 6. Control Panel 7. Indicator light for Keep warm 8. Indicator light for Heating 9. Selector cooking / food warmer 10. Non slip feet <p>At the back of the unit 1. On / Off switch (see use)</p> <p style="text-align: right;">USE</p>	
	<p>Illustration of manual</p>		<p>Description of manual</p>
<p>Accepted by client email dated 2023-07-28.</p>			
5	<p>For all items, actual frequency was 50/60Hz instead of "50Hz" specified on PI.</p>		Information
6	<p>The rated voltage and plug of inspected products conformed to the regulation of sales destination.</p>		Information
7	<p>CDF report was provided by the factory, report number GZES220400581402A1 issued by SGS.</p>		Information

A-3: Picture with description for Remarks: Nil

Nil	Nil
1. N/A	2. N/A

Inspected by	:	Michael WANG	Signature	:	
Reviewed by	:	Sanky Liu	Signature	:	

The report reflects the findings at the time and place of inspection. This report does not relieve the sellers/manufacturers from their contractual liabilities or prejudice the buyer's right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment. This report is not used for social proof function in China market.



Report No.: 4907024.01-6

Report Date: 2023-07-28

This is to supersede our report 4907024.00-6 issued on 2023-07-28

B. Quantity/Specification/Product requirement verification

B-1) Check inspection lot size against:

<input checked="" type="checkbox"/> Purchase order	<input checked="" type="checkbox"/> Conformed	<input type="checkbox"/> Not conformed
<input checked="" type="checkbox"/> Inspection booking form	<input checked="" type="checkbox"/> Conformed	<input type="checkbox"/> Not conformed
<input type="checkbox"/> Packing list	<input type="checkbox"/> Conformed	<input type="checkbox"/> Not conformed

B-2) Check product description/ colour /style against:

<input checked="" type="checkbox"/> Purchase order	<input type="checkbox"/> Conformed	<input checked="" type="checkbox"/> Not conformed
<input type="checkbox"/> Product specification	<input type="checkbox"/> Conformed	<input type="checkbox"/> Not conformed
<input type="checkbox"/> Reference artwork	<input type="checkbox"/> Conformed	<input type="checkbox"/> Not conformed
<input type="checkbox"/> Golden sample	<input type="checkbox"/> Conformed	<input type="checkbox"/> Not conformed
<input type="checkbox"/> (others:please specify the sender and receiving date)	<input type="checkbox"/> Conformed	<input type="checkbox"/> Not conformed

B-3) Packing material

Export carton	New export carton	<input checked="" type="checkbox"/>
Fasting	Metal staples	<input type="checkbox"/>
Sealing	Transparent gummed tape	<input checked="" type="checkbox"/>
	Opaque gummed tape	<input type="checkbox"/>
	Paper tape	<input type="checkbox"/>
Strapping	Nylon	<input type="checkbox"/>
Material	Ply of cardboard	<input type="checkbox"/> 3ply (single wall)
		<input checked="" type="checkbox"/> 5ply (double wall)
		<input type="checkbox"/> 7ply (triple wall)
Others	Poly foam inside packing	<input checked="" type="checkbox"/> Yes <input type="checkbox"/> No

B-4) Packaging information

For item TCR-105:

	Qty per selling unit	Carton size (cm)			N.W. (kg)	G.W. (kg)
		L(cm)	W(cm)	H(cm)		
Gift Box	1pc	24.0	24.0	21.5	1.509	1.790
Outer carton	4pcs	49.6	25.1	44.0	7.160	7.680

For item TCR-156:

	Qty per selling unit	Carton size (cm)			N.W. (kg)	G.W. (kg)
		L(cm)	W(cm)	H(cm)		
Gift Box	1pc	25.7	25.7	23.8	1.824	2.120
Outer carton	4pcs	53.0	26.6	49.0	8.480	9.160

For item TCRV-2504:

	Qty per selling unit	Carton size (cm)			N.W. (kg)	G.W. (kg)
		L(cm)	W(cm)	H(cm)		
Gift Box	1pc	29.0	29.0	30.2	2.497	2.880
Outer carton	4pcs	59.6	30.0	61.5	11.524	12.410

The report reflects the findings at the time and place of inspection. This report does not relieve the sellers/manufacturers from their contractual liabilities or prejudice the buyer's right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment. This report is not used for social proof function in China market.



Report No.: 4907024.01-6

Report Date: 2023-07-28

This is to supersede our report 4907024.00-6 issued on 2023-07-28

B-5) Barcode check

Overall result: <input checked="" type="checkbox"/> Pass <input type="checkbox"/> Fail <input type="checkbox"/> N/A (no barcodes were found on product or packing)			
1.	Barcode scanning performed on (S-1): 5pcs		
2.	Barcode readability result: <input checked="" type="checkbox"/> Pass <input type="checkbox"/> Fail		
	Barcode scanner brand and model number: SZI-473		
3.	Barcode number:		
	Item number	<input checked="" type="checkbox"/> on gift box:	<input checked="" type="checkbox"/> on carton:
	TCR-105	3760196091110	3760196091110
	TCR-156	3760196097778	3760196097778
	TCRV-2504	3760301551287	3760301551287
4.	Did the Barcodes on inspected samples conform to specifications/PO requirement:		
	<input type="checkbox"/> Conformed <input type="checkbox"/> Not conformed <input checked="" type="checkbox"/> N/A		

B-6) Shipping marks: Yes

For export carton	front side marks <input checked="" type="checkbox"/>	side marks <input checked="" type="checkbox"/>
For inner box	front side marks <input type="checkbox"/>	side marks <input type="checkbox"/>

B-7) Color / style / material Conform to Golden Sample?

<input type="checkbox"/> Yes
<input type="checkbox"/> No, please see remark
<input checked="" type="checkbox"/> N/A, no Golden sample

C. ON-SITE CHECKING

Test performed	Sample size	Result	Comments	
Hi-pot check	80pcs	Pass	1500V, 5mA, 2S	
Earth continuity check	80pcs	Pass	12V, 25A, less than 0.1ohm	
Basic function check	80pcs	Pass	Switch on / off	
Smell check	80pcs	Pass	No abnormal smell	
Full function check	20pcs	Pass	According to instruction manual and package artwork. Refer to remark	
Input power consumption check	20pcs	Pass	At 230V, 50Hz:	
			Item number	Power (W)
			TCR-105	381-396
			TCR-156	487-498
			TCRV-2504	926-941
Internal check	5pcs	Pass	Check internal workmanship	
Endurance check	5pcs	Pass	Boiling water for 4hours at rated voltage	
Rub check	5pcs	Pass	15S with water, then 15S with N-hexane	
Tape check	5pcs	Pass	With 3M #810 tape	
Strain relief check	5pcs	Pass	60N, 25times, displacement less than 2mm	
Stability check	5pcs	Pass	15° inclined plane, not overturn	
Power cord length check	5pcs	Reference	93.0-96.5cm without plug	
Critical component check	1pc/item	Pass	Per LVD / CDF	
Application check	1pc/item	Pass	Actual use	

The report reflects the findings at the time and place of inspection. This report does not relieve the sellers/manufacturers from their contractual liabilities or prejudice the buyer's right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment. This report is not used for social proof function in China market.



Report No.: 4907024.01-6

Report Date: 2023-07-28

This is to supersede our report 4907024.00-6 issued on 2023-07-28

D. OTHER INFORMATION

	Please note																																																												
1.	29 Cartons were randomly sampled from the batch of above item subjected for inspection																																																												
2.	<input checked="" type="checkbox"/> Selected carton number: <table border="1" style="width: 100%; border-collapse: collapse;"> <tr> <th colspan="10">For item TCR-105</th> </tr> <tr> <td>292</td><td>230</td><td>284</td><td>180</td><td>133</td><td>156</td><td>78</td><td>53</td><td>23</td><td>10</td> </tr> <tr> <th colspan="10">For item TCR-156</th> </tr> <tr> <td>250</td><td>287</td><td>147</td><td>105</td><td>168</td><td>87</td><td>25</td><td>3</td><td>202</td><td>60</td> </tr> <tr> <th colspan="10">For item TCRV-2504</th> </tr> <tr> <td>236</td><td>201</td><td>119</td><td>179</td><td>75</td><td>60</td><td>190</td><td>12</td><td>211</td><td>/</td> </tr> </table>	For item TCR-105										292	230	284	180	133	156	78	53	23	10	For item TCR-156										250	287	147	105	168	87	25	3	202	60	For item TCRV-2504										236	201	119	179	75	60	190	12	211	/
For item TCR-105																																																													
292	230	284	180	133	156	78	53	23	10																																																				
For item TCR-156																																																													
250	287	147	105	168	87	25	3	202	60																																																				
For item TCRV-2504																																																													
236	201	119	179	75	60	190	12	211	/																																																				
3.	<input type="checkbox"/> Carton no. was not assigned.																																																												

E. Critical component data

For item TCR-105:

	Component	Trade Mark	Model	Technical data	Conformity mark	Results
1.	Plug	--	YX301	16A 250V	VDE	Pass
2.	Power cord	YEXING	H05VV-F	3G 0.75mm ²	VDE	Pass
3.	Thermal link	--	AF192C	10A 250V	TUV	Pass
4.	Power switch	BEVAN	BR13	12(4)A 250V T120	TUV	Pass
5.	Temperature limiter	--	--	145	Tested appliance with	Pass
6.	Heating element	--	--	220-240V 400W	Tested appliance with	Pass
7.	Keep warm heater	--	--	220-240V 40W	Tested appliance with	Pass
8.	Internal wire	CIXI SHUANG HONG	3122	200°C 300V 24AWG	Tested appliance with	Pass

Remark: Above components are tested against CDF under [SGS] test report#: GZES220400581402A1.

For item TCR-156:

	Component	Trade Mark	Model	Technical data	Conformity mark	Results
9.	Plug	--	YX301	16A 250V	VDE	Pass
10.	Power cord	YEXING	H05VV-F	3G 0.75mm ²	VDE	Pass
11.	Thermal link	--	AF192C	10A 250V	TUV	Pass
12.	Power switch	BEVAN	BR13	12(4)A 250V T120	TUV	Pass
13.	Temperature limiter	--	--	145	Tested appliance with	Pass
14.	Heating element	--	--	220-240V 500W	Tested appliance with	Pass
15.	Keep warm heater	--	--	220-240V 40W	Tested appliance with	Pass
16.	Internal wire	CIXI SHUANG HONG	3122	200°C 300V 24AWG	Tested appliance with	Pass

Remark: Above components are tested against CDF under [SGS] test report#: GZES220400581402A1.

The report reflects the findings at the time and place of inspection. This report does not relieve the sellers/manufacturers from their contractual liabilities or prejudice the buyer's right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment. This report is not used for social proof function in China market.



Report No.: 4907024.01-6

Report Date: 2023-07-28

This is to supersede our report 4907024.00-6 issued on 2023-07-28

For item TCRV-2504:

	Component	Trade Mark	Model	Technical data	Conformity mark	Results
17.	Plug	--	YX301	16A 250V	VDE	Pass
18.	Power cord	YEXING	H05VV-F	3G 0.75mm ²	VDE	Pass
19.	Thermal link	--	AF216C	10A 250V	TUV	Pass
20.	Power switch	BEVAN	BR13	12(4)A 250V T120	TUV	Pass
21.	Temperature limiter	--	--	155	Tested appliance with	Pass
22.	Heating element	--	--	220-240V 900W	Tested appliance with	Pass
23.	Keep warm heater	--	--	220-240V 40W	Tested appliance with	Pass
24.	Internal wire	CIXI SHUANG HONG	H05SJ-K	0.75mm ² 180°C	Tested appliance with	Pass

Remark: Above components are tested against CDF under [SGS] test report#: GZES220400581402A1.

The report reflects the findings at the time and place of inspection. This report does not relieve the sellers/manufacturers from their contractual liabilities or prejudice the buyer's right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment. This report is not used for social proof function in China market.

Report No.: 4907024.01-6

Report Date: 2023-07-28

This is to supersede our report 4907024.00-6 issued on 2023-07-28

F. Pictures

	
<p>1. Warehouse</p>	<p>2. Warehouse</p>
	
<p>3. Export carton view (TCR-105)</p>	<p>4. Shipping mark</p>
	
<p>5. Barcode</p>	<p>6. Side mark</p>

The report reflects the findings at the time and place of inspection. This report does not relieve the sellers/manufacturers from their contractual liabilities or prejudice the buyer's right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment. This report is not used for social proof function in China market.



7. Side mark



8. Carton packing view



9. Gift box view



10. Marking on gift box



11. Marking on gift box



12. Marking on gift box

The report reflects the findings at the time and place of inspection. This report does not relieve the sellers/manufacturers from their contractual liabilities or prejudice the buyer's right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment. This report is not used for social proof function in China market.

This is to supersede our report 4907024.00-6 issued on 2023-07-28



13. Marking on gift box



14. Marking on gift box



15. Marking on gift box



16. Marking on gift box



17. Marking on gift box

18. Marking on gift box

The report reflects the findings at the time and place of inspection. This report does not relieve the sellers/manufacturers from their contractual liabilities or prejudice the buyer's right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment. This report is not used for social proof function in China market.

This is to supersede our report 4907024.00-6 issued on 2023-07-28



19. Marking on gift box



20. Marking on gift box



21. Marking on gift box



22. Marking on gift box



23. Marking on gift box

24. Marking on gift box

The report reflects the findings at the time and place of inspection. This report does not relieve the sellers/manufacturers from their contractual liabilities or prejudice the buyer's right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment. This report is not used for social proof function in China market.

This is to supersede our report 4907024.00-6 issued on 2023-07-28

	
<p>25. Marking on gift box</p>	<p>26. Marking on gift box</p>
	
<p>27. Marking on gift box</p>	<p>28. Marking on gift box</p>
	
<p>29. Marking on gift box</p>	<p>30. Packing</p>

The report reflects the findings at the time and place of inspection. This report does not relieve the sellers/manufacturers from their contractual liabilities or prejudice the buyer's right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment. This report is not used for social proof function in China market.

This is to supersede our report 4907024.00-6 issued on 2023-07-28




31. Packing



32. Packing



33. Packing

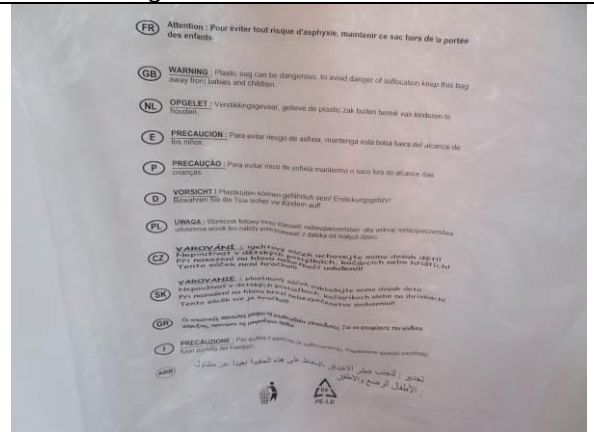

34. Warning text on poly bag



35. Vent hole on poly bag



36. All parts

The report reflects the findings at the time and place of inspection. This report does not relieve the sellers/manufacturers from their contractual liabilities or prejudice the buyer's right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment. This report is not used for social proof function in China market.


This is to supersede our report 4907024.00-6 issued on 2023-07-28



37. IM



38. IM

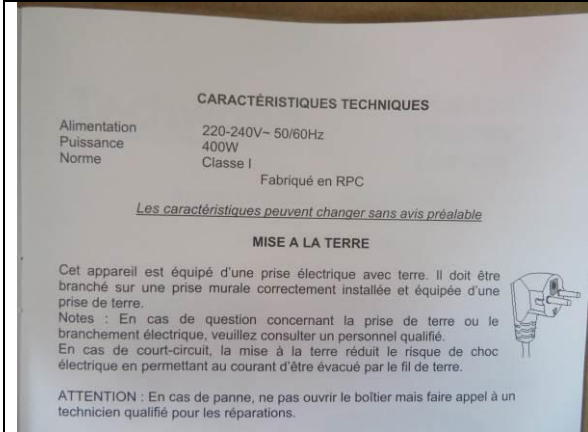

39. IM



40. Measuring cup and spoon









41. Measuring cup and spoon



42. Marking on spoon





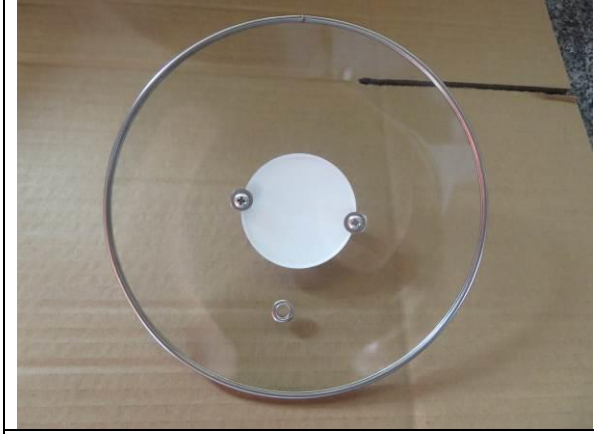

The report reflects the findings at the time and place of inspection. This report does not relieve the sellers/manufacturers from their contractual liabilities or prejudice the buyer's right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment. This report is not used for social proof function in China market.

This is to supersede our report 4907024.00-6 issued on 2023-07-28

	
<p>43. Marking on measuring cup</p>	<p>44. Marking on measuring cup</p>
	
<p>45. Marking on measuring cup</p>	<p>46. Lid</p>
	
<p>47. Lid</p>	<p>48. Inner pot</p>

The report reflects the findings at the time and place of inspection. This report does not relieve the sellers/manufacturers from their contractual liabilities or prejudice the buyer's right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment. This report is not used for social proof function in China market.

This is to supersede our report 4907024.00-6 issued on 2023-07-28

	
<p>49. Inner pot</p>	<p>50. Marking on inner pot</p>
	
<p>51. Main unit</p>	<p>52. Main unit</p>
	
<p>53. Main unit</p>	<p>54. Main unit</p>

The report reflects the findings at the time and place of inspection. This report does not relieve the sellers/manufacturers from their contractual liabilities or prejudice the buyer's right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment. This report is not used for social proof function in China market.

This is to supersede our report 4907024.00-6 issued on 2023-07-28

	
<p>55. Main unit</p>	<p>56. Main unit</p>
	
<p>57. Main unit</p>	<p>58. Earth symbol and cord entrance</p>
	
<p>59. Rating label</p>	<p>60. Product view</p>

The report reflects the findings at the time and place of inspection. This report does not relieve the sellers/manufacturers from their contractual liabilities or prejudice the buyer's right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment. This report is not used for social proof function in China market.

This is to supersede our report 4907024.00-6 issued on 2023-07-28



The report reflects the findings at the time and place of inspection. This report does not relieve the sellers/manufacturers from their contractual liabilities or prejudice the buyer's right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment. This report is not used for social proof function in China market.

This is to supersede our report 4907024.00-6 issued on 2023-07-28


	
<p>67. Product view</p>	<p>68. Control panel</p>
	
<p>69. Marking and brand logo</p>	<p>70. On / off button</p>
	
<p>71. Plug</p>	<p>72. Power cord</p>

The report reflects the findings at the time and place of inspection. This report does not relieve the sellers/manufacturers from their contractual liabilities or prejudice the buyer's right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment. This report is not used for social proof function in China market.

This is to supersede our report 4907024.00-6 issued on 2023-07-28




73. Internal view

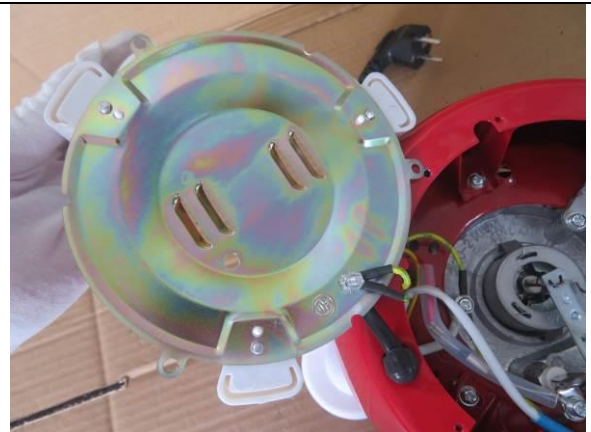

74. Internal view



75. Earth connection

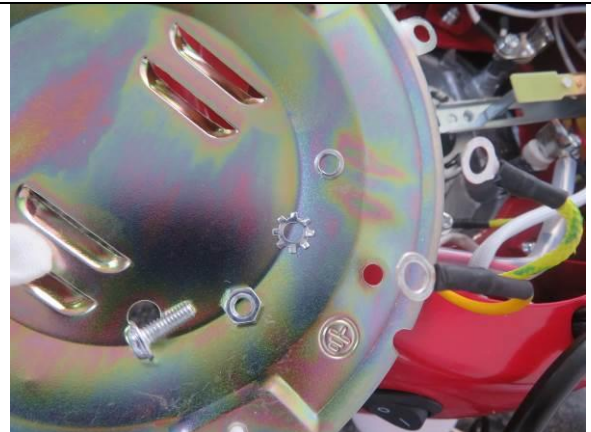

76. Earth connection




77. Internal view



78. Internal view


The report reflects the findings at the time and place of inspection. This report does not relieve the sellers/manufacturers from their contractual liabilities or prejudice the buyer's right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment. This report is not used for social proof function in China market.

This is to supersede our report 4907024.00-6 issued on 2023-07-28

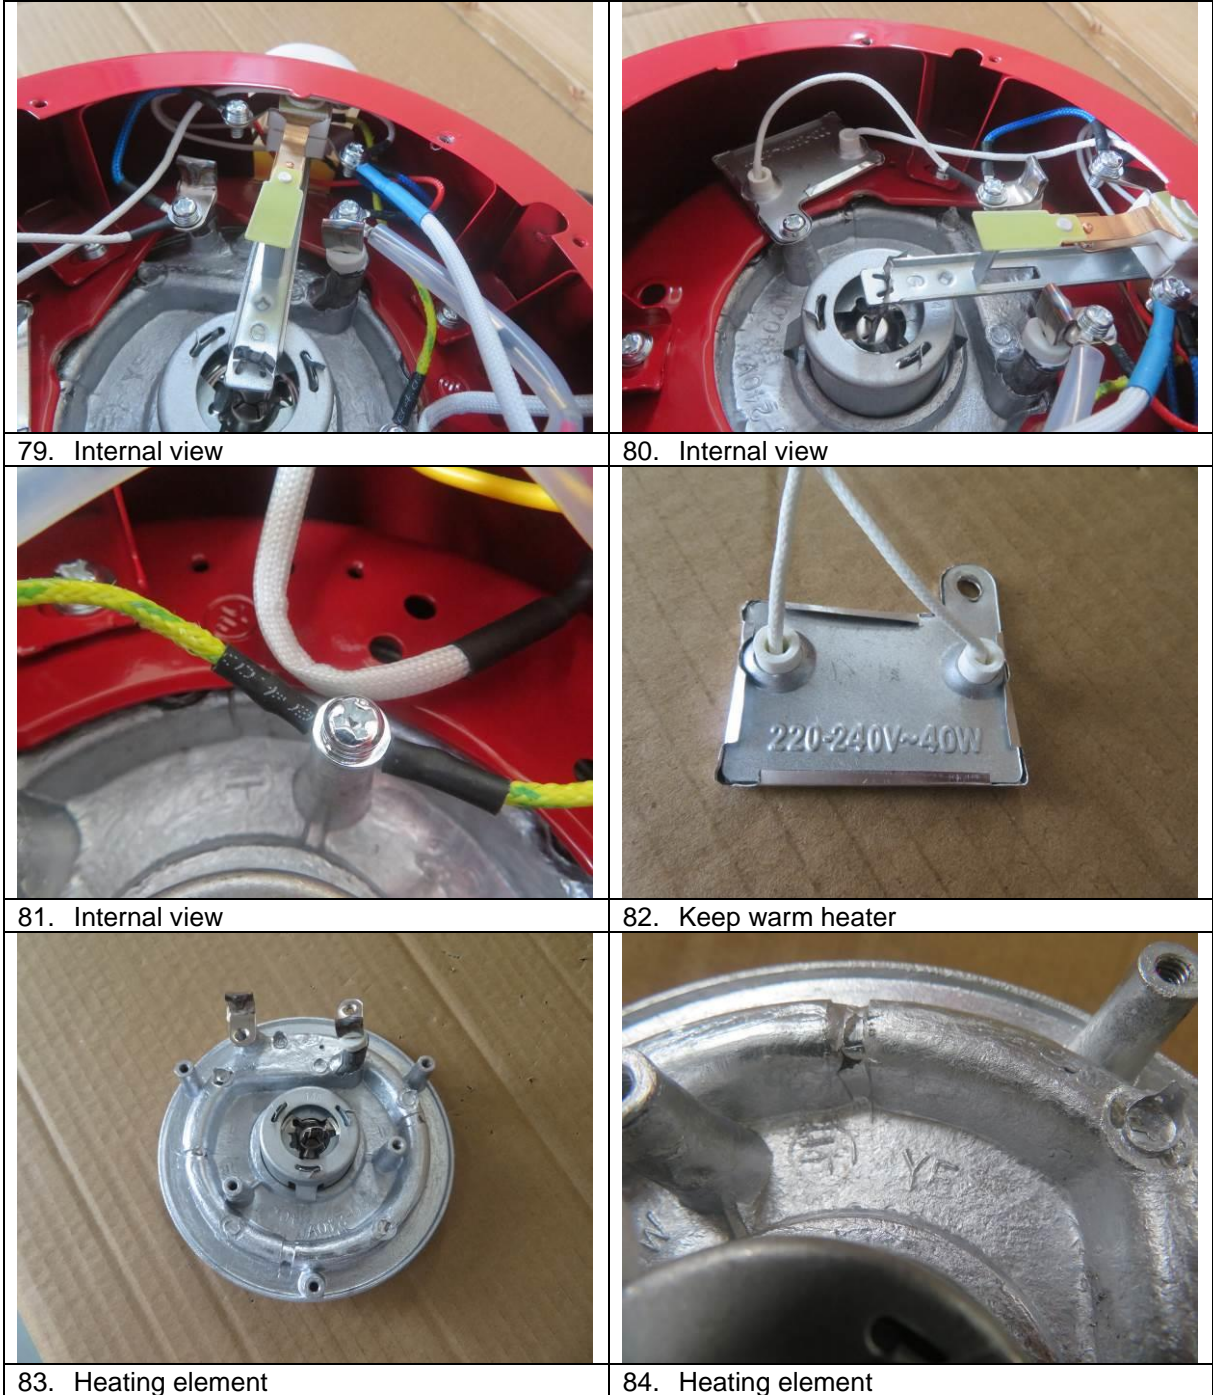





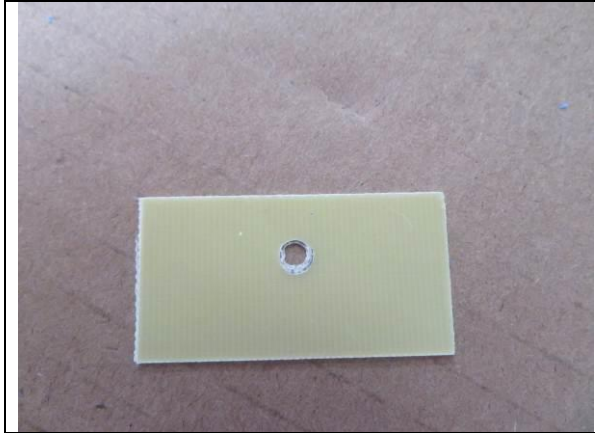

The report reflects the findings at the time and place of inspection. This report does not relieve the sellers/manufacturers from their contractual liabilities or prejudice the buyer's right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment. This report is not used for social proof function in China market.

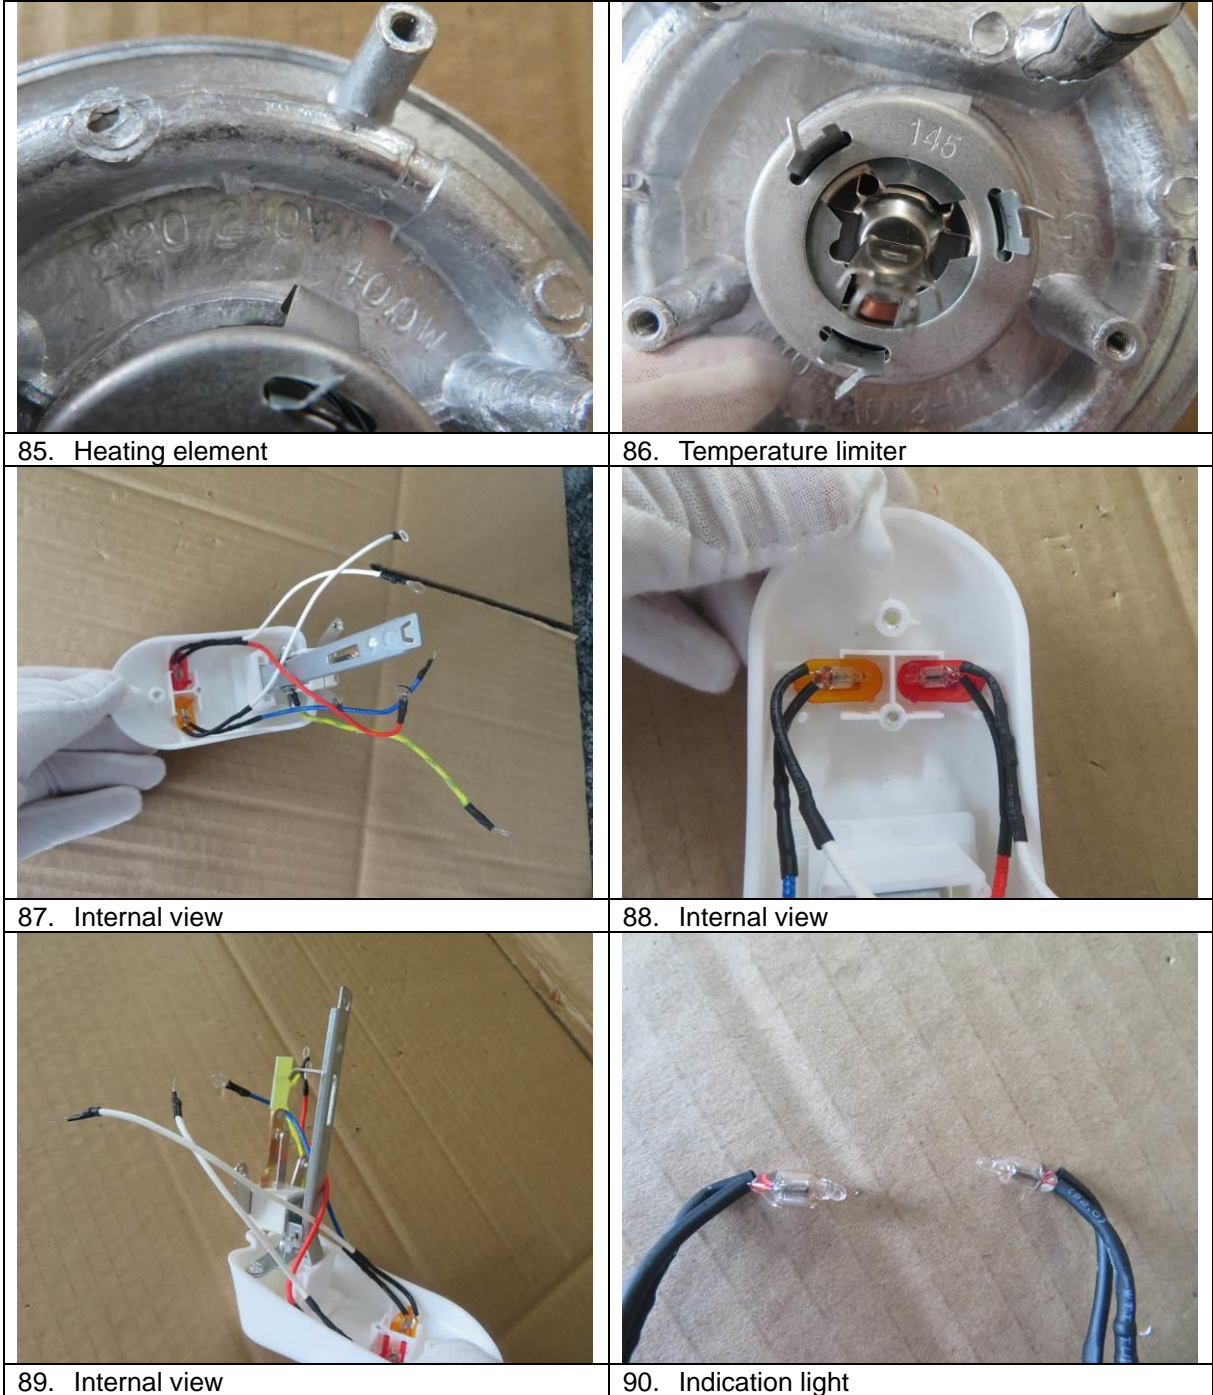This is to supersede our report 4907024.00-6 issued on 2023-07-28



The report reflects the findings at the time and place of inspection. This report does not relieve the sellers/manufacturers from their contractual liabilities or prejudice the buyer's right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment. This report is not used for social proof function in China market.

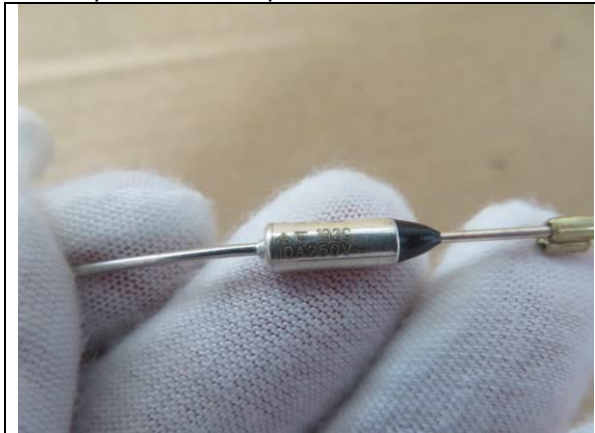This is to supersede our report 4907024.00-6 issued on 2023-07-28

	
<p>91. Thermal link</p>	<p>92. Thermal link</p>
	
<p>93. Power switch</p>	<p>94. PCB</p>
	
<p>95. PCB</p>	<p>96. Export carton view (TCR-156)</p>

The report reflects the findings at the time and place of inspection. This report does not relieve the sellers/manufacturers from their contractual liabilities or prejudice the buyer's right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment. This report is not used for social proof function in China market.

Report No.: 4907024.01-6

Report Date: 2023-07-28

This is to supersede our report 4907024.00-6 issued on 2023-07-28

	
<p>97. Shipping mark</p>	<p>98. Barcode</p>
	
<p>99. Side mark</p>	<p>100. Side mark</p>
	
<p>101. Carton packing view</p>	<p>102. Gift box view</p>

The report reflects the findings at the time and place of inspection. This report does not relieve the sellers/manufacturers from their contractual liabilities or prejudice the buyer's right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment. This report is not used for social proof function in China market.

This is to supersede our report 4907024.00-6 issued on 2023-07-28



103. Marking on gift box

104. Marking on gift box



105. Marking on gift box

106. Marking on gift box



107. Marking on gift box

108. Marking on gift box

The report reflects the findings at the time and place of inspection. This report does not relieve the sellers/manufacturers from their contractual liabilities or prejudice the buyer's right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment. This report is not used for social proof function in China market.

This is to supersede our report 4907024.00-6 issued on 2023-07-28



109. Marking on gift box




110. Marking on gift box



111. Marking on gift box



112. Marking on gift box

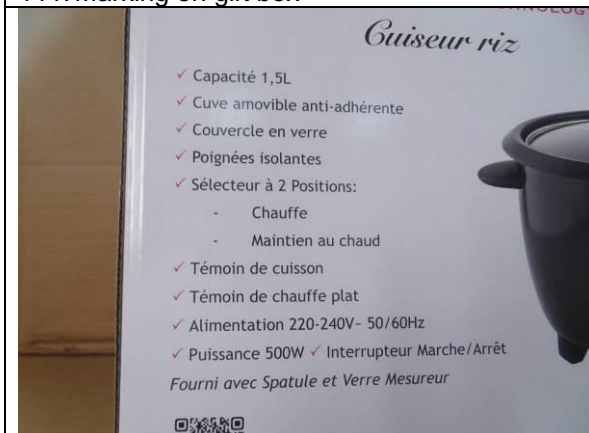

113. Marking on gift box



114. Marking on gift box

The report reflects the findings at the time and place of inspection. This report does not relieve the sellers/manufacturers from their contractual liabilities or prejudice the buyer's right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment. This report is not used for social proof function in China market.

This is to supersede our report 4907024.00-6 issued on 2023-07-28



115. Marking on gift box




116. Marking on gift box




117. Marking on gift box



118. Marking on gift box

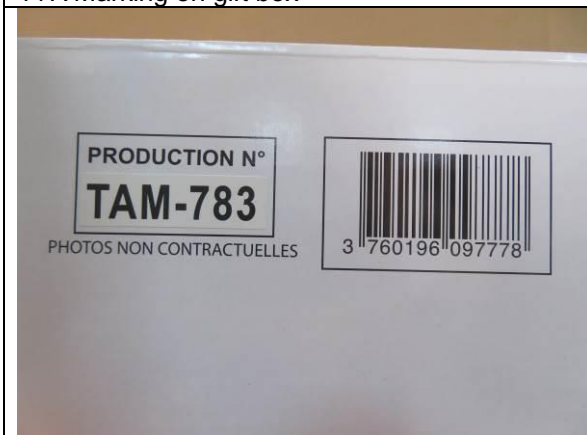

119. Marking on gift box

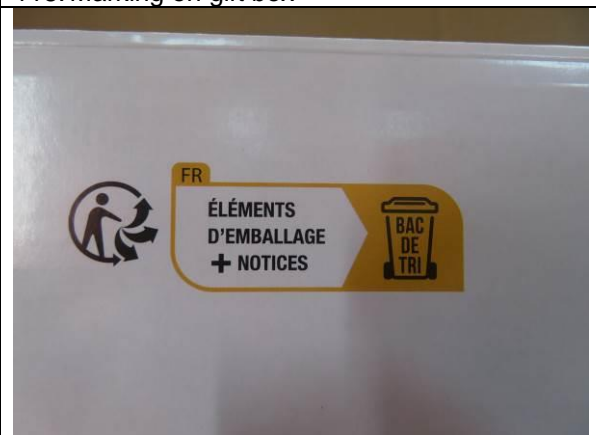

120. Marking on gift box

The report reflects the findings at the time and place of inspection. This report does not relieve the sellers/manufacturers from their contractual liabilities or prejudice the buyer's right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment. This report is not used for social proof function in China market.

This is to supersede our report 4907024.00-6 issued on 2023-07-28



121. Marking on gift box



122. Marking on gift box




123. Packing



124. Packing



125. Packing

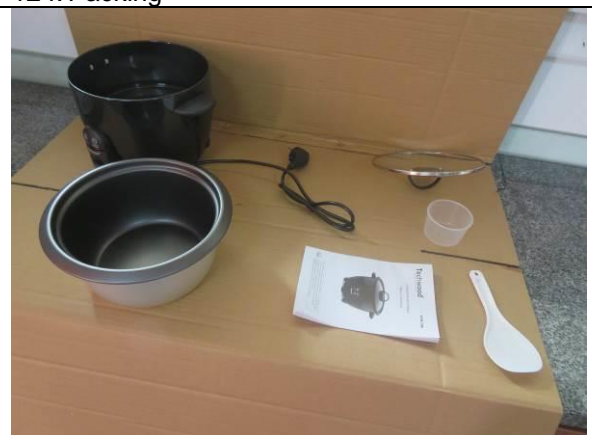


126. All parts

The report reflects the findings at the time and place of inspection. This report does not relieve the sellers/manufacturers from their contractual liabilities or prejudice the buyer's right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment. This report is not used for social proof function in China market.


This is to supersede our report 4907024.00-6 issued on 2023-07-28



127. IM

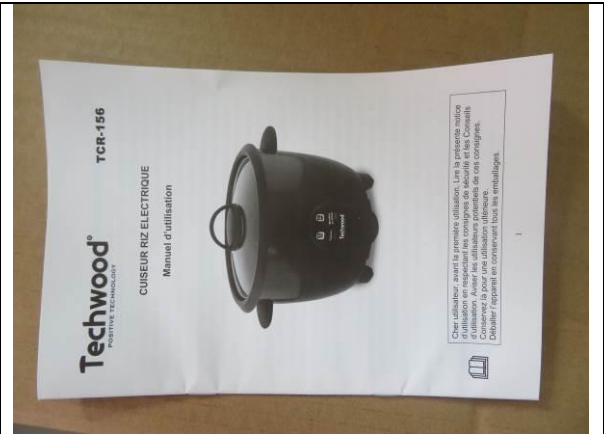

128. IM

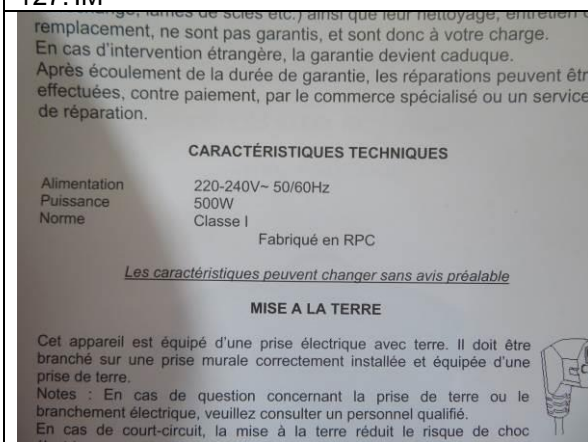

129. IM



130. Measuring cup and spoon









131. Measuring cup and spoon



132. Marking on spoon







The report reflects the findings at the time and place of inspection. This report does not relieve the sellers/manufacturers from their contractual liabilities or prejudice the buyer's right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment. This report is not used for social proof function in China market.

This is to supersede our report 4907024.00-6 issued on 2023-07-28

	
<p>133. Marking on measuring cup</p>	<p>134. Marking on measuring cup</p>
	
<p>135. Marking on measuring cup</p>	<p>136. Lid</p>
	
<p>137. Lid</p>	<p>138. Inner pot</p>

The report reflects the findings at the time and place of inspection. This report does not relieve the sellers/manufacturers from their contractual liabilities or prejudice the buyer's right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment. This report is not used for social proof function in China market.

This is to supersede our report 4907024.00-6 issued on 2023-07-28

	
<p>139. Inner pot</p>	<p>140. Marking on inner pot</p>
	
<p>141. Main unit</p>	<p>142. Main unit</p>
	
<p>143. Main unit</p>	<p>144. Main unit</p>

The report reflects the findings at the time and place of inspection. This report does not relieve the sellers/manufacturers from their contractual liabilities or prejudice the buyer's right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment. This report is not used for social proof function in China market.

This is to supersede our report 4907024.00-6 issued on 2023-07-28

	
<p>145. Main unit</p>	<p>146. Main unit</p>
	
<p>147. Main unit</p>	<p>148. Earth symbol and cord entrance</p>
	
<p>149. Rating label</p>	<p>150. Product view</p>

The report reflects the findings at the time and place of inspection. This report does not relieve the sellers/manufacturers from their contractual liabilities or prejudice the buyer's right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment. This report is not used for social proof function in China market.

This is to supersede our report 4907024.00-6 issued on 2023-07-28



The report reflects the findings at the time and place of inspection. This report does not relieve the sellers/manufacturers from their contractual liabilities or prejudice the buyer's right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment. This report is not used for social proof function in China market.

This is to supersede our report 4907024.00-6 issued on 2023-07-28

	
<p>157. Product view</p>	<p>158. Plug</p>
	
<p>159. Power cord</p>	<p>160. Control panel</p>
	
<p>161. Marking and brand logo</p>	<p>162. On / off button</p>

The report reflects the findings at the time and place of inspection. This report does not relieve the sellers/manufacturers from their contractual liabilities or prejudice the buyer's right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment. This report is not used for social proof function in China market.

This is to supersede our report 4907024.00-6 issued on 2023-07-28



163. Internal view



164. Internal view




165. Earth connection



166. Internal view




167. Internal view

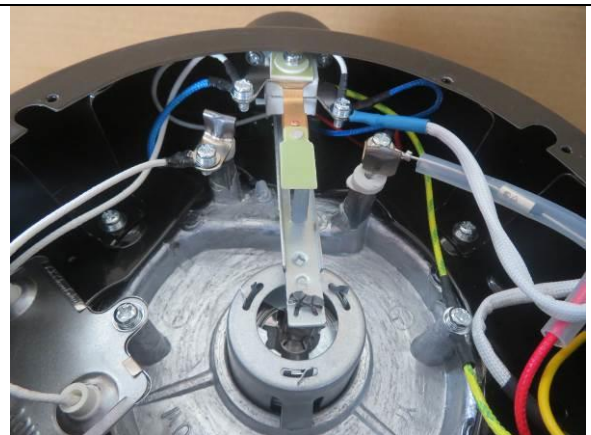

168. Internal view



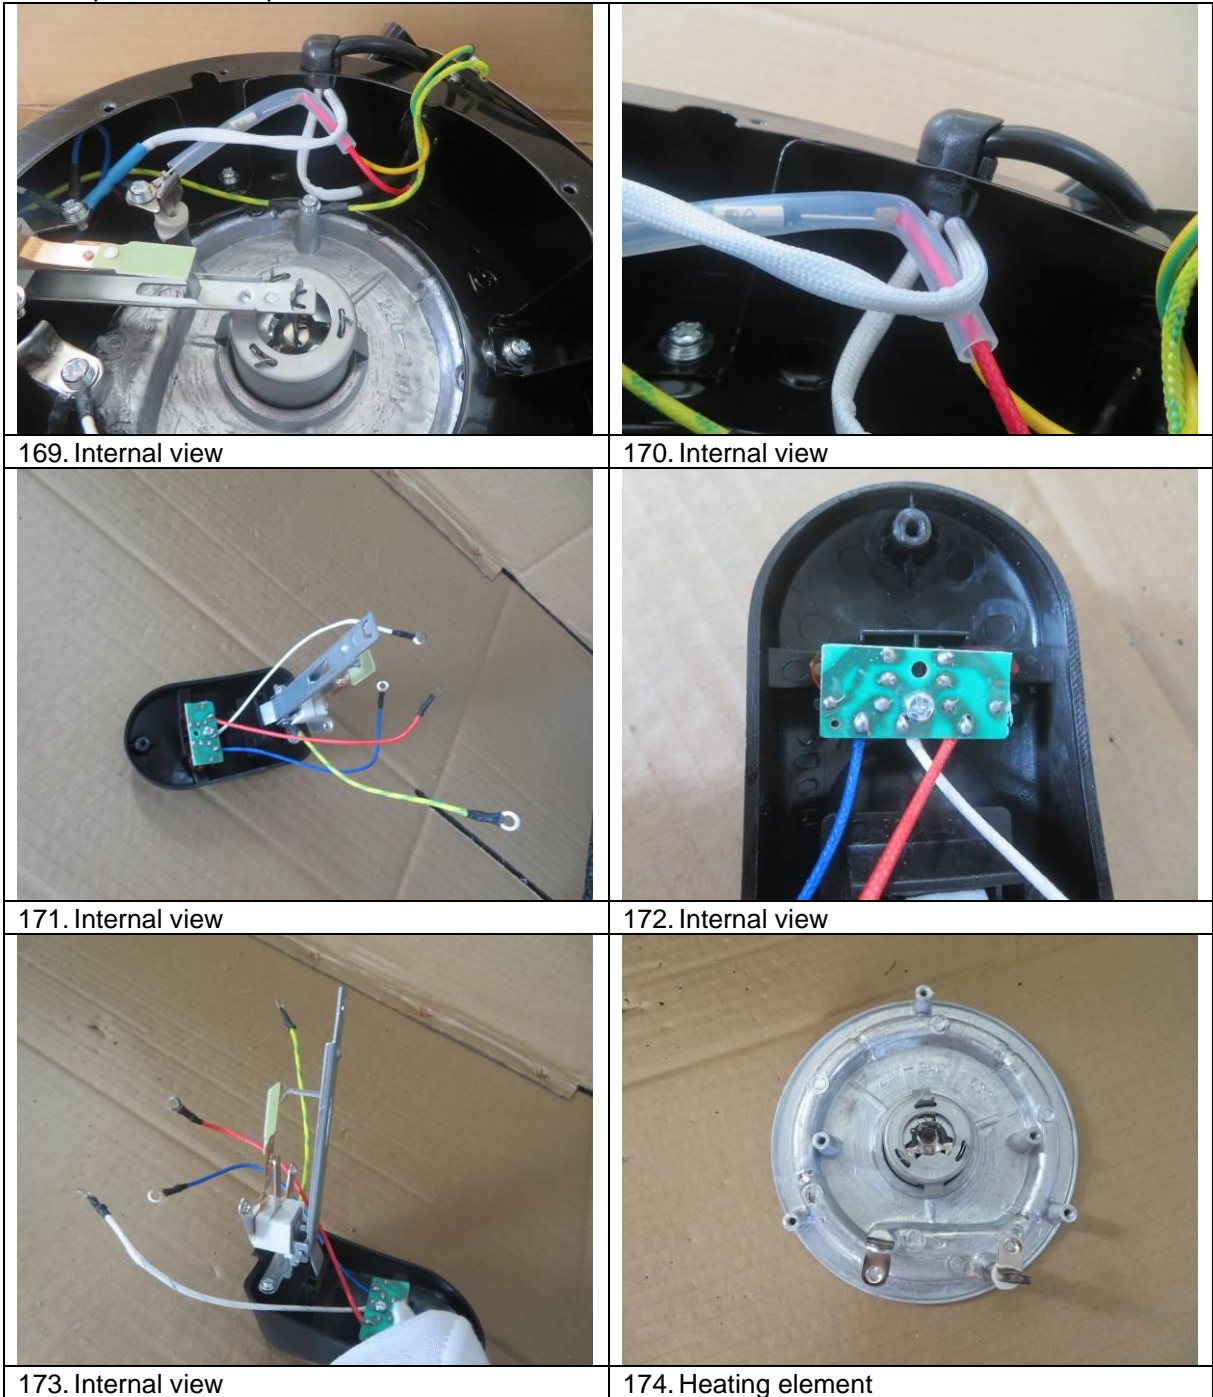



The report reflects the findings at the time and place of inspection. This report does not relieve the sellers/manufacturers from their contractual liabilities or prejudice the buyer's right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment. This report is not used for social proof function in China market.

This is to supersede our report 4907024.00-6 issued on 2023-07-28







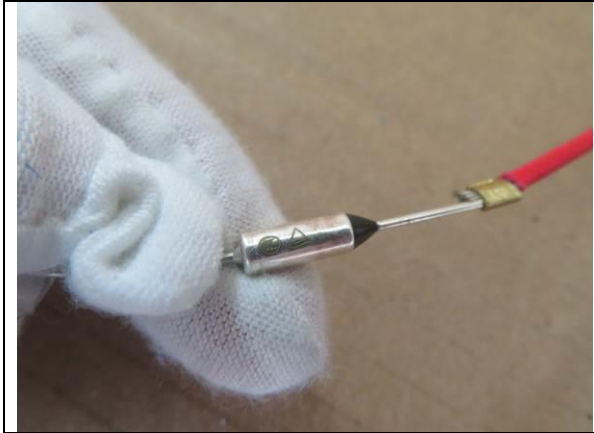

The report reflects the findings at the time and place of inspection. This report does not relieve the sellers/manufacturers from their contractual liabilities or prejudice the buyer's right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment. This report is not used for social proof function in China market.

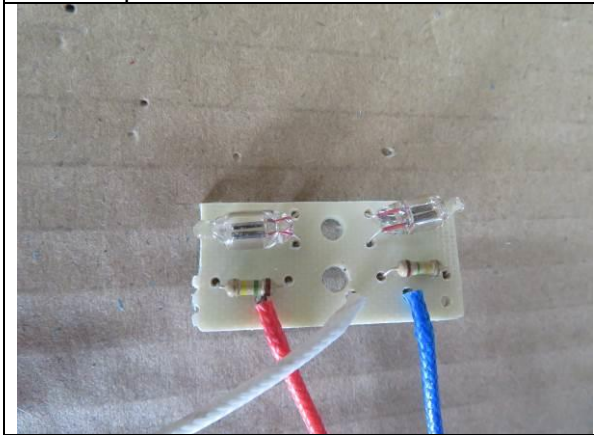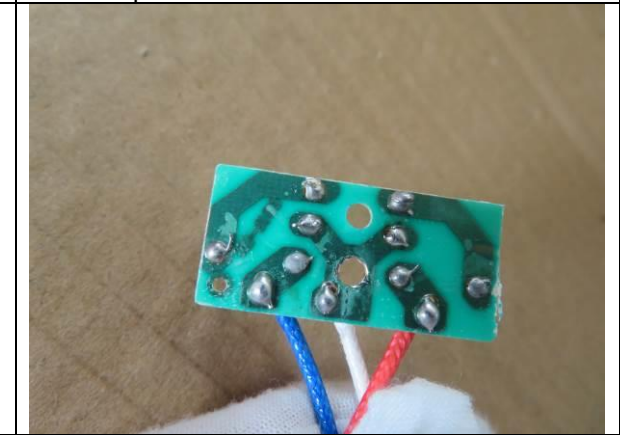This is to supersede our report 4907024.00-6 issued on 2023-07-28

	
<p>175. Heating element</p>	<p>176. Heating element</p>
	
<p>177. Temperature limiter</p>	<p>178. Keep warm heater</p>
	
<p>179. PCB</p>	<p>180. PCB</p>

The report reflects the findings at the time and place of inspection. This report does not relieve the sellers/manufacturers from their contractual liabilities or prejudice the buyer's right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment. This report is not used for social proof function in China market.

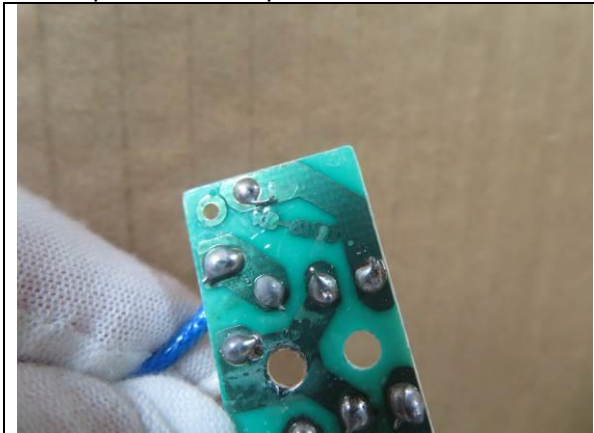This is to supersede our report 4907024.00-6 issued on 2023-07-28

	
<p>181. PCB</p>	<p>182. Internal view</p>
	
<p>183. Power switch</p>	<p>184. Thermal link</p>
	
<p>185. Thermal link</p>	<p>186. Internal wire</p>

The report reflects the findings at the time and place of inspection. This report does not relieve the sellers/manufacturers from their contractual liabilities or prejudice the buyer's right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment. This report is not used for social proof function in China market.

Report No.: 4907024.01-6

Report Date: 2023-07-28

This is to supersede our report 4907024.00-6 issued on 2023-07-28

	
<p>187. Internal wire</p>	<p>188. Export carton view (TCRV-2504)</p>
	
<p>189. Shipping mark</p>	<p>190. Barcode</p>
	
<p>191. Side mark</p>	<p>192. Side mark</p>

The report reflects the findings at the time and place of inspection. This report does not relieve the sellers/manufacturers from their contractual liabilities or prejudice the buyer's right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment. This report is not used for social proof function in China market.

This is to supersede our report 4907024.00-6 issued on 2023-07-28



193. Carton packing view




194. Gift box view




195. Marking on gift box



196. Marking on gift box

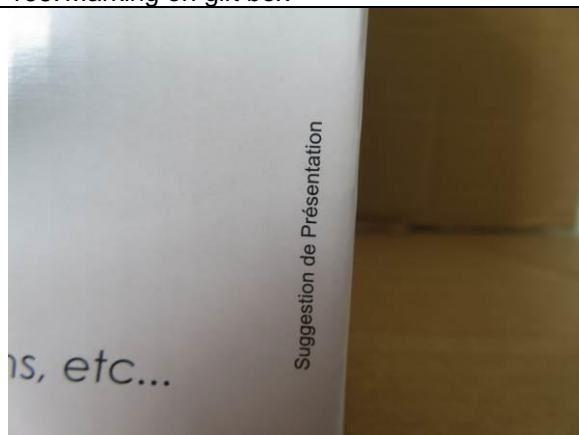

197. Marking on gift box

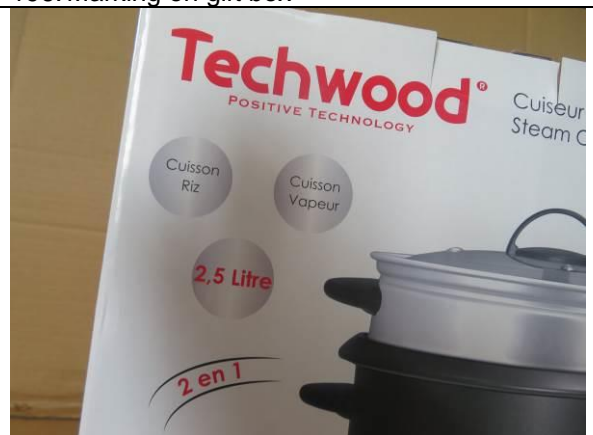

198. Marking on gift box

The report reflects the findings at the time and place of inspection. This report does not relieve the sellers/manufacturers from their contractual liabilities or prejudice the buyer's right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment. This report is not used for social proof function in China market.

This is to supersede our report 4907024.00-6 issued on 2023-07-28



199. Marking on gift box



200. Marking on gift box



201. Marking on gift box



202. Marking on gift box



203. Marking on gift box



204. Marking on gift box

The report reflects the findings at the time and place of inspection. This report does not relieve the sellers/manufacturers from their contractual liabilities or prejudice the buyer's right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment. This report is not used for social proof function in China market.


This is to supersede our report 4907024.00-6 issued on 2023-07-28



205. Marking on gift box



206. Marking on gift box

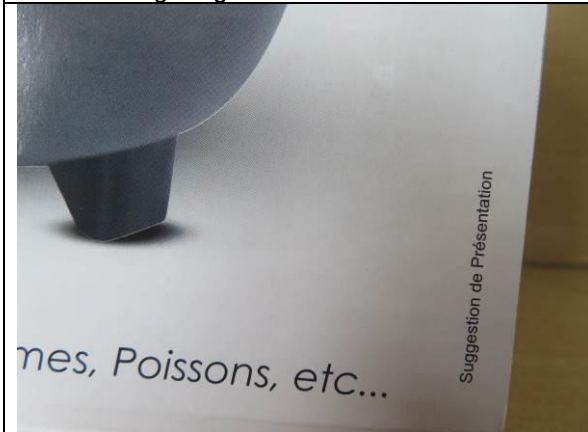


207. Marking on gift box



208. Marking on gift box




209. Marking on gift box

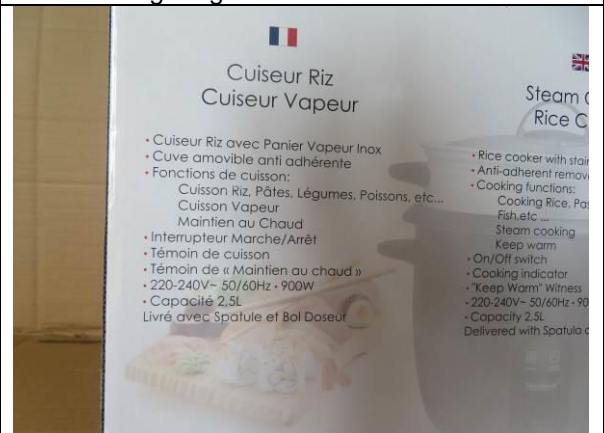

210. Marking on gift box

The report reflects the findings at the time and place of inspection. This report does not relieve the sellers/manufacturers from their contractual liabilities or prejudice the buyer's right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment. This report is not used for social proof function in China market.

This is to supersede our report 4907024.00-6 issued on 2023-07-28

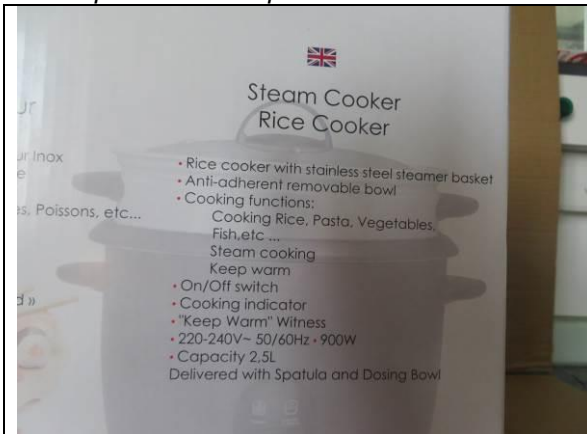

211. Marking on gift box

212. Marking on gift box



213. Marking on gift box

214. Marking on gift box




215. Marking on gift box

216. Marking on gift box

The report reflects the findings at the time and place of inspection. This report does not relieve the sellers/manufacturers from their contractual liabilities or prejudice the buyer's right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment. This report is not used for social proof function in China market.

This is to supersede our report 4907024.00-6 issued on 2023-07-28

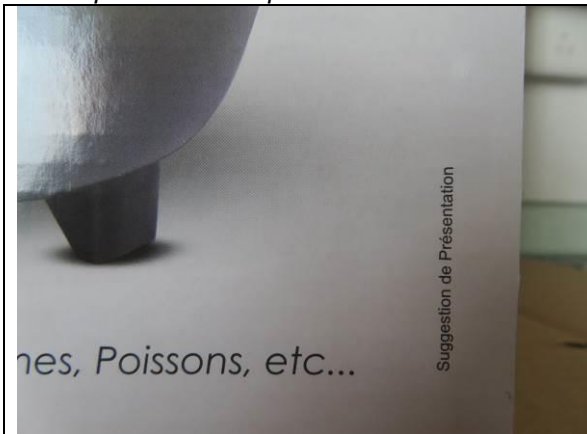

217. Marking on gift box



218. Marking on gift box



219. Marking on gift box



220. Marking on gift box



221. Marking on gift box



222. Marking on gift box

The report reflects the findings at the time and place of inspection. This report does not relieve the sellers/manufacturers from their contractual liabilities or prejudice the buyer's right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment. This report is not used for social proof function in China market.

This is to supersede our report 4907024.00-6 issued on 2023-07-28



223. Marking on gift box



224. Packing



225. Packing



226. Packing



227. Packing




228. All parts

The report reflects the findings at the time and place of inspection. This report does not relieve the sellers/manufacturers from their contractual liabilities or prejudice the buyer's right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment. This report is not used for social proof function in China market.

This is to supersede our report 4907024.00-6 issued on 2023-07-28



229. IM

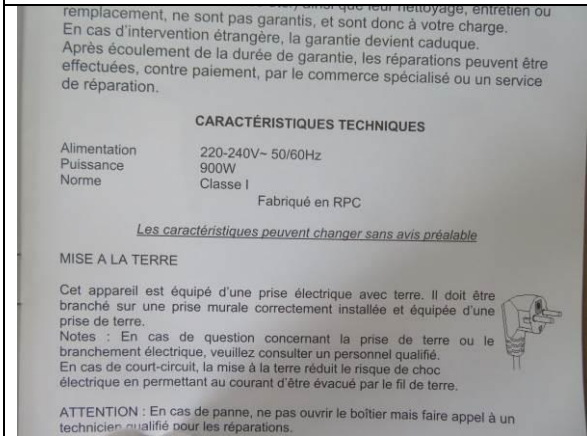

230. IM



231. IM



232. Measuring cup and spoon



233. Measuring cup and spoon

234. Marking on spoon







The report reflects the findings at the time and place of inspection. This report does not relieve the sellers/manufacturers from their contractual liabilities or prejudice the buyer's right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment. This report is not used for social proof function in China market.

This is to supersede our report 4907024.00-6 issued on 2023-07-28

	
<p>235. Marking on measuring cup</p>	<p>236. Marking on measuring cup</p>
	
<p>237. Marking on measuring cup</p>	<p>238. Steamer</p>
	
<p>239. Steamer</p>	<p>240. Steamer</p>

The report reflects the findings at the time and place of inspection. This report does not relieve the sellers/manufacturers from their contractual liabilities or prejudice the buyer's right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment. This report is not used for social proof function in China market.

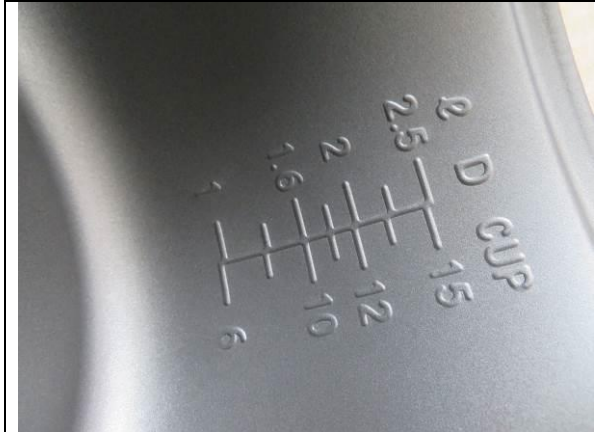This is to supersede our report 4907024.00-6 issued on 2023-07-28

	
<p>241. Inner pot</p>	<p>242. Inner pot</p>
	
<p>243. Marking on inner pot</p>	<p>244. Lid</p>
	
<p>245. Lid</p>	<p>246. Main unit</p>

The report reflects the findings at the time and place of inspection. This report does not relieve the sellers/manufacturers from their contractual liabilities or prejudice the buyer's right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment. This report is not used for social proof function in China market.

This is to supersede our report 4907024.00-6 issued on 2023-07-28

	
<p>247. Main unit</p>	
<p>248. Main unit</p>	
	
<p>249. Main unit</p>	<p>250. Earth symbol and cord entrance</p>
	
<p>251. Rating label</p>	<p>252. Product view</p>

The report reflects the findings at the time and place of inspection. This report does not relieve the sellers/manufacturers from their contractual liabilities or prejudice the buyer's right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment. This report is not used for social proof function in China market.

This is to supersede our report 4907024.00-6 issued on 2023-07-28



253. Product view



254. Product view



255. Product view



256. Product view



257. Product view



258. Product view

The report reflects the findings at the time and place of inspection. This report does not relieve the sellers/manufacturers from their contractual liabilities or prejudice the buyer's right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment. This report is not used for social proof function in China market.

This is to supersede our report 4907024.00-6 issued on 2023-07-28

	
<p>259. Product view</p>	<p>260. Product view</p>
	
<p>261. Product view</p>	<p>262. Product view</p>
	
<p>263. Control panel</p>	<p>264. Marking and brand logo</p>

The report reflects the findings at the time and place of inspection. This report does not relieve the sellers/manufacturers from their contractual liabilities or prejudice the buyer's right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment. This report is not used for social proof function in China market.

This is to supersede our report 4907024.00-6 issued on 2023-07-28



265. On / off button




266. Plug



267. Power cord



268. Internal view

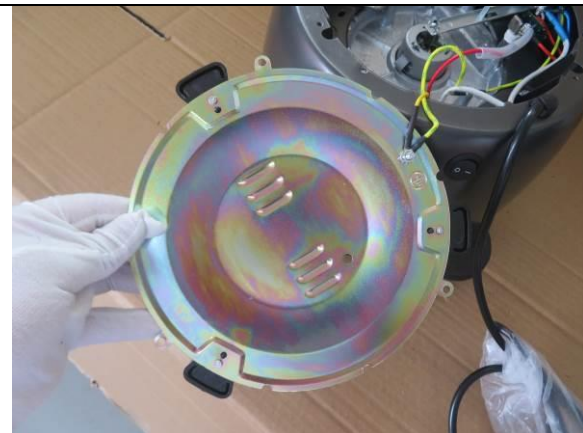

269. Internal view



270. Earth connection

The report reflects the findings at the time and place of inspection. This report does not relieve the sellers/manufacturers from their contractual liabilities or prejudice the buyer's right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment. This report is not used for social proof function in China market.


This is to supersede our report 4907024.00-6 issued on 2023-07-28




271. Internal view



272. Internal view

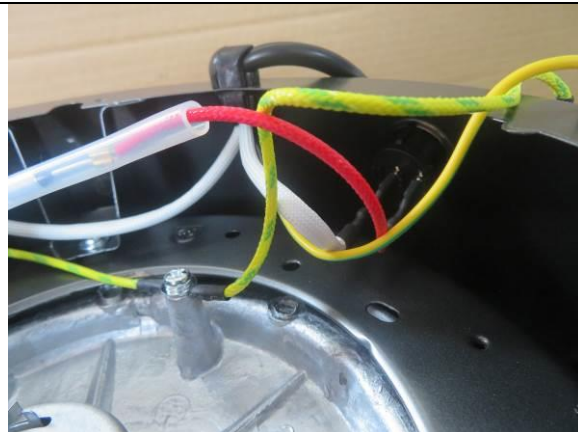

273. Internal view

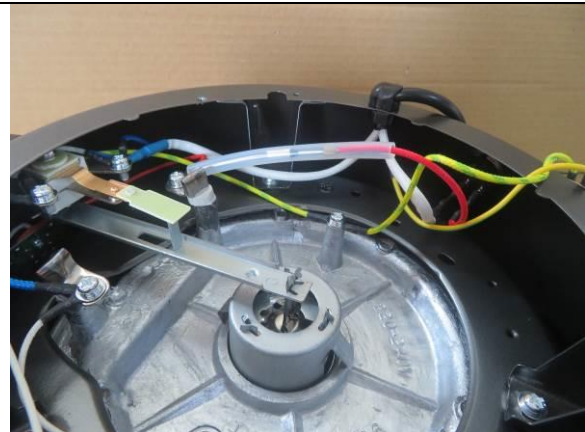

274. Internal view




275. Internal view



276. Internal view

The report reflects the findings at the time and place of inspection. This report does not relieve the sellers/manufacturers from their contractual liabilities or prejudice the buyer's right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment. This report is not used for social proof function in China market.


This is to supersede our report 4907024.00-6 issued on 2023-07-28

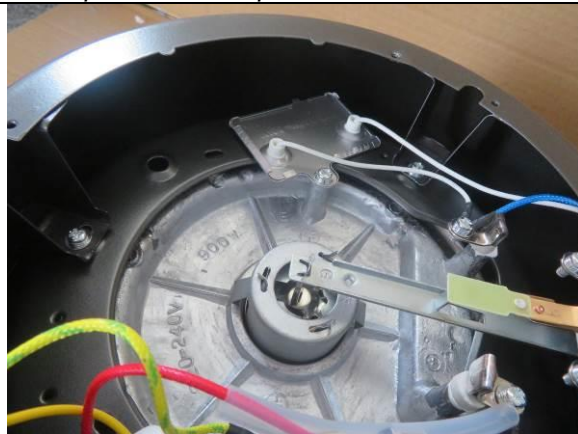


277. Internal view



278. Power switch

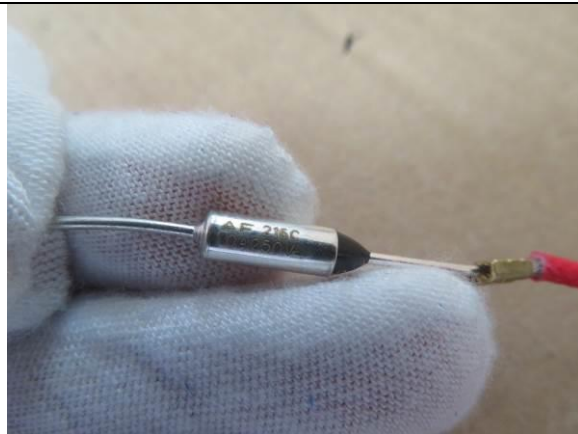

279. Thermal link

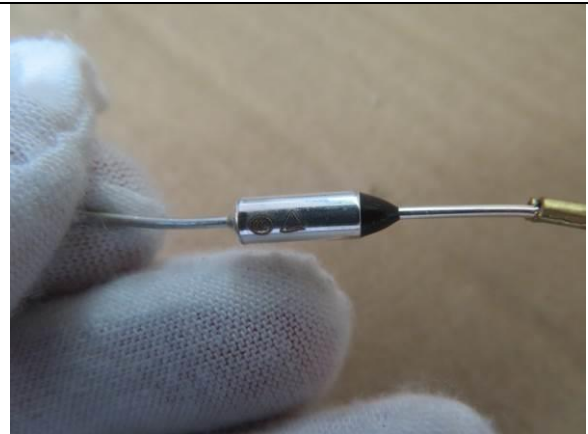

280. Thermal link




281. Heating element



282. Heating element


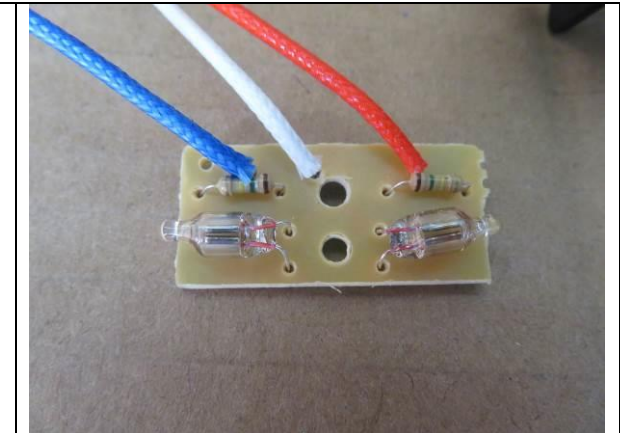
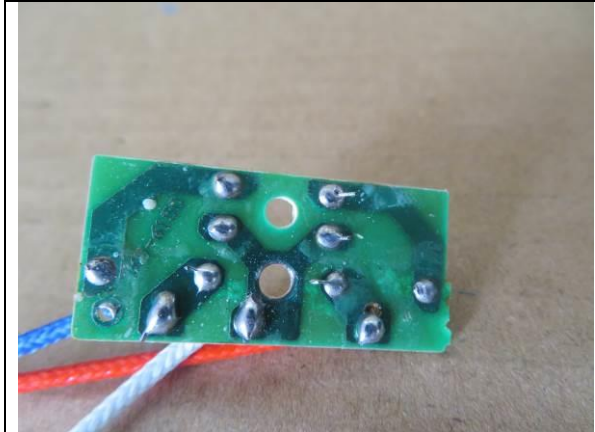



The report reflects the findings at the time and place of inspection. This report does not relieve the sellers/manufacturers from their contractual liabilities or prejudice the buyer's right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment. This report is not used for social proof function in China market.

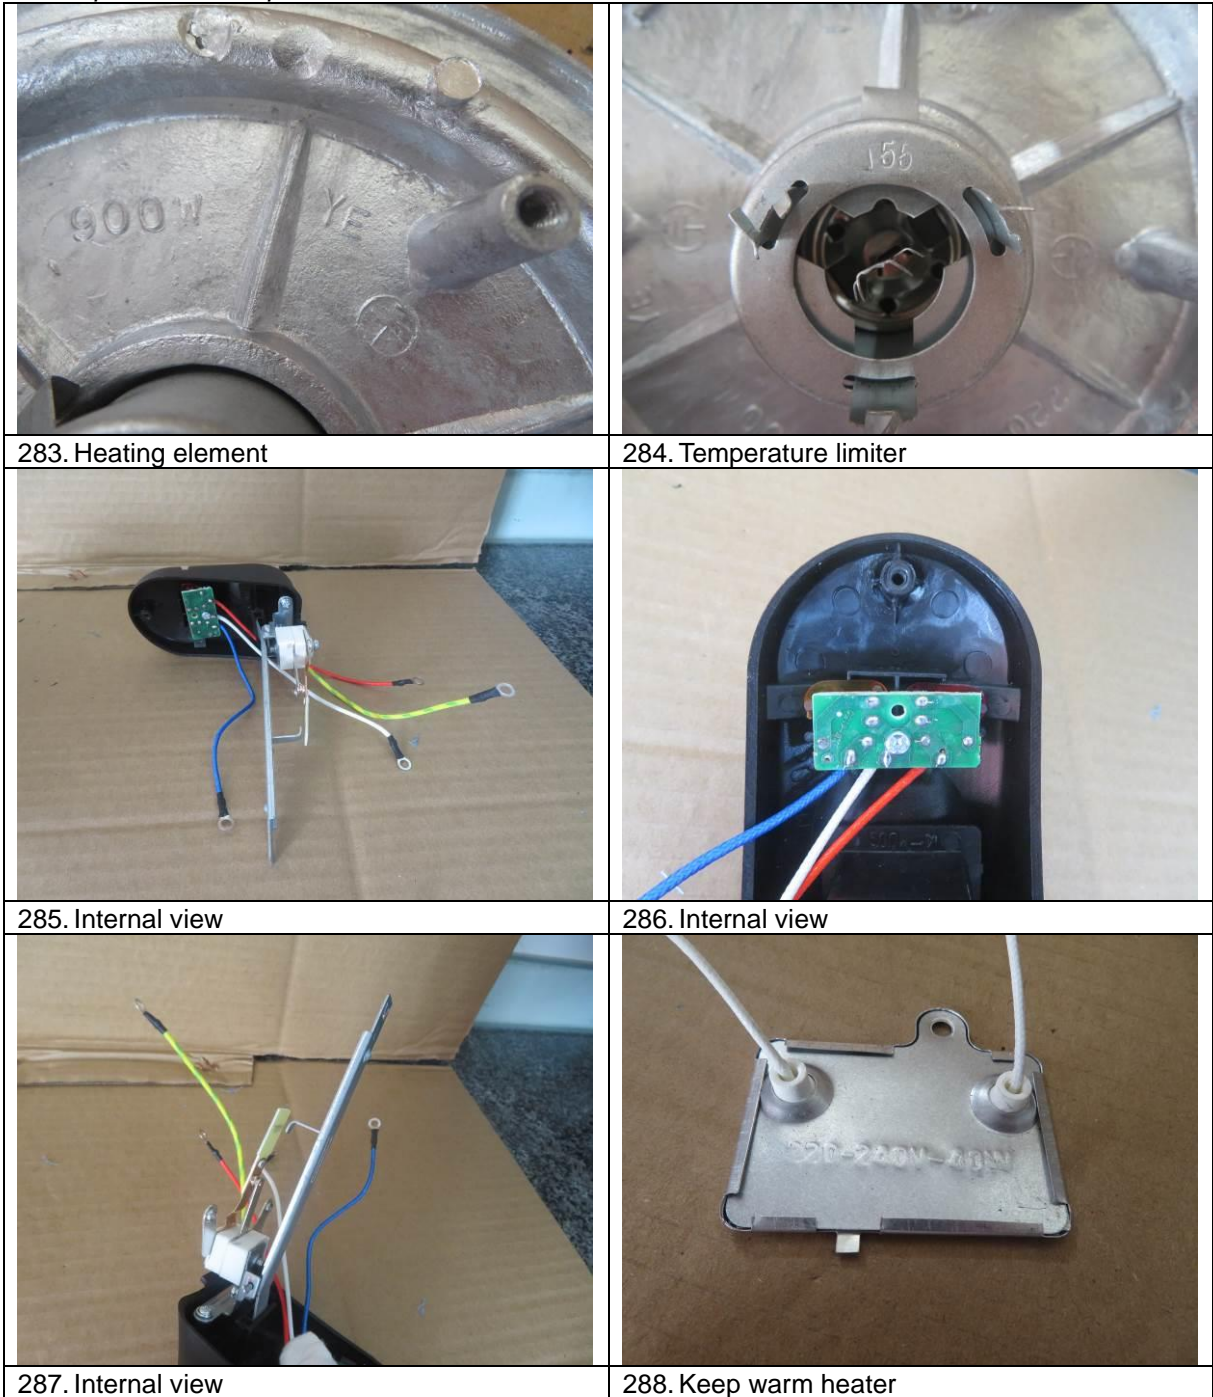This is to supersede our report 4907024.00-6 issued on 2023-07-28



The report reflects the findings at the time and place of inspection. This report does not relieve the sellers/manufacturers from their contractual liabilities or prejudice the buyer's right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment. This report is not used for social proof function in China market.

This is to supersede our report 4907024.00-6 issued on 2023-07-28

	
<p>289. Internal view</p>	<p>290. PCB</p>
	
<p>291. PCB</p>	<p>292. PCB</p>
	
<p>293. Internal wire</p>	<p>294. Internal wire</p>

The report reflects the findings at the time and place of inspection. This report does not relieve the sellers/manufacturers from their contractual liabilities or prejudice the buyer's right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment. This report is not used for social proof function in China market.

This is to supersede our report 4907024.00-6 issued on 2023-07-28



295. Hi-pot, earth continuity, keep warm power and input power consumption check

296. Hi-pot, earth continuity, keep warm power and input power consumption check



297. Hi-pot, earth continuity, keep warm power and input power consumption check

298. Hi-pot, earth continuity, keep warm power and input power consumption check



299. Hi-pot, earth continuity, keep warm power and input power consumption check

300. Hi-pot, earth continuity, keep warm power and input power consumption check

The report reflects the findings at the time and place of inspection. This report does not relieve the sellers/manufacturers from their contractual liabilities or prejudice the buyer's right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment. This report is not used for social proof function in China market.

This is to supersede our report 4907024.00-6 issued on 2023-07-28




301. Function check



302. Function check




303. Function check

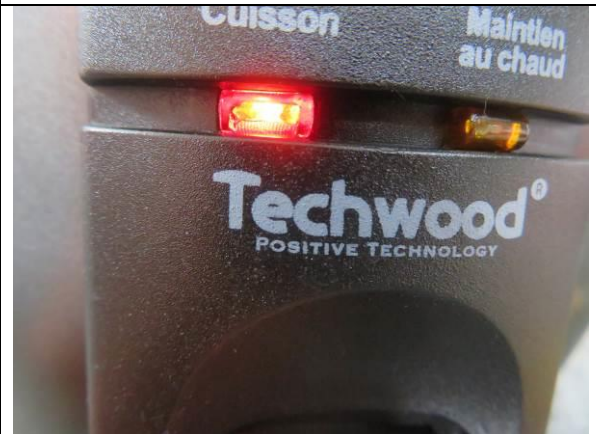

304. Function check



305. Function check

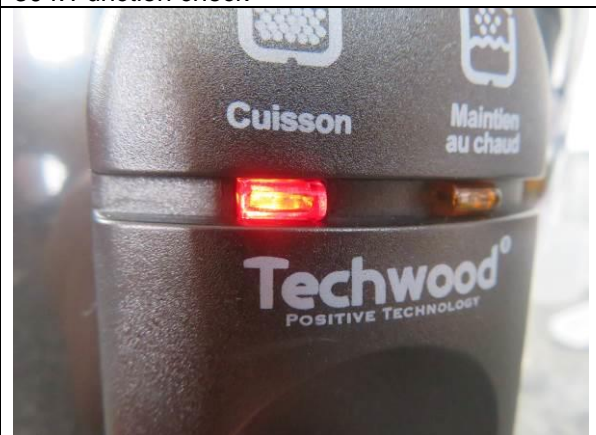

306. Function check

The report reflects the findings at the time and place of inspection. This report does not relieve the sellers/manufacturers from their contractual liabilities or prejudice the buyer's right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment. This report is not used for social proof function in China market.

This is to supersede our report 4907024.00-6 issued on 2023-07-28



307. Application check



308. Application check



309. Application check



310. Application check



311. Application check




312. Application check

The report reflects the findings at the time and place of inspection. This report does not relieve the sellers/manufacturers from their contractual liabilities or prejudice the buyer's right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment. This report is not used for social proof function in China market.

This is to supersede our report 4907024.00-6 issued on 2023-07-28



313. Endurance check

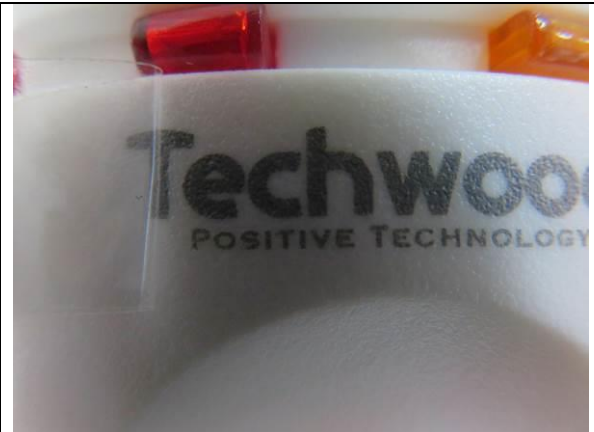

314. Tape check



315. Rub check



316. Rub check









317. Stability check



318. Strain relief check


The report reflects the findings at the time and place of inspection. This report does not relieve the sellers/manufacturers from their contractual liabilities or prejudice the buyer's right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment. This report is not used for social proof function in China market.

This is to supersede our report 4907024.00-6 issued on 2023-07-28


	
<p>319. Smell check</p>	<p>320. Power cord length measurement</p>
	
<p>321. CE / WEEE symbol size check</p>	<p>322. CE / WEEE symbol size check</p>
	
<p>323. CE / WEEE symbol size check</p>	<p>324. CE / WEEE symbol size check</p>

The report reflects the findings at the time and place of inspection. This report does not relieve the sellers/manufacturers from their contractual liabilities or prejudice the buyer's right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment. This report is not used for social proof function in China market.

This is to supersede our report 4907024.00-6 issued on 2023-07-28

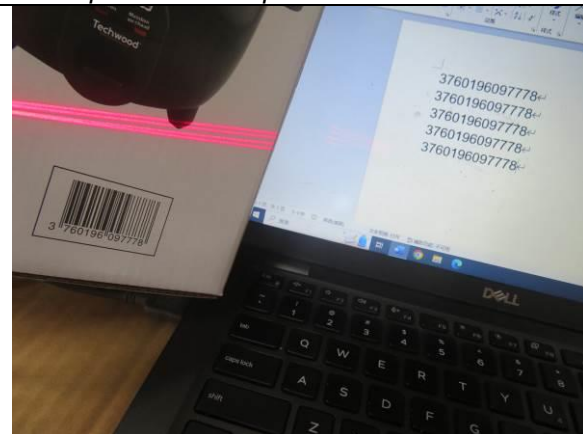

325. Barcode verification

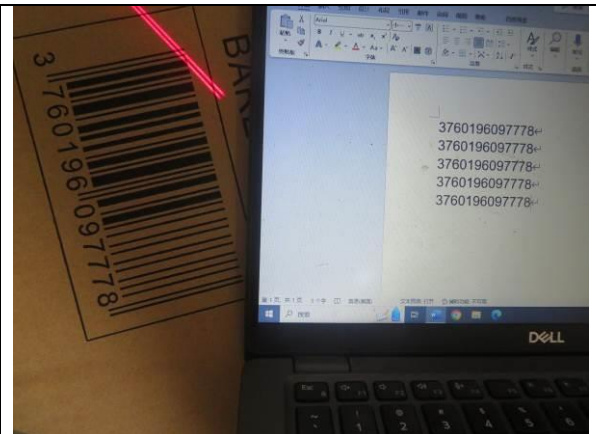

326. Barcode verification



327. QR code check



328. QR code check



329. Minor defect: Glue residual on control panel (TCR-105)



330. Minor defect: Dent mark on main housing (TCR-105)

The report reflects the findings at the time and place of inspection. This report does not relieve the sellers/manufacturers from their contractual liabilities or prejudice the buyer's right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment. This report is not used for social proof function in China market.

This is to supersede our report 4907024.00-6 issued on 2023-07-28

	
<p>331. Major defect: Poor coating on inner pot (TCR-156)</p>	<p>332. Minor defect: Scratch mark on control panel (TCR-156)</p>
	
<p>333. Minor defect: Slight poor silkscreen printing on the letter of "C" (TCR-156)</p>	<p>334. Minor defect: Scratch mark on control panel (TCRV-2504)</p>

-END OF REPORT-

The report reflects the findings at the time and place of inspection. This report does not relieve the sellers/manufacturers from their contractual liabilities or prejudice the buyer's right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment. This report is not used for social proof function in China market.