

Inspection Report

Client :	SOTECH	Tel:	+852-2525-7381	Fax:	--
Attn.:	Sunil	Supplier:	--		
Inspection Date:	2024-11-26	<input type="checkbox"/> 1 st /2 nd Re-inspection (Previous Report No.)			
Product Description:	Table Blender				
Manufacturer Name:	Guangdong Xinbao Electrical Appliances Holdings Co.,Ltd				
Manufacturer Location:	No. 11, Zhenghe South Road, Leliu Town, Foshan City, Shunde District, Guangdong Province, China.				
Manufacturer Contact:	Ms. Deng				
Service Required:	<input checked="" type="checkbox"/> FRI (Final Random Inspection)		<input type="checkbox"/> DPI (During Production Inspection)		<input type="checkbox"/>

P/O No.	Item No.	Order Qty.	Shipment Qty.:	Sales destination	Carton Qty.:	Inspected Qty.	Packed CTN (%)	Production (%)	Sample Size
2024288 (82743)	TBLI-370	2600 pcs	2600 pcs	France	1300ctns	2600 pcs	100%	100%	125pcs

INSPECTION RESULT:	<input checked="" type="checkbox"/> PASS <input type="checkbox"/> FAIL <input type="checkbox"/> PENDING (if Fail or Pending) due to Section A-2 remark#
ON-SITE CC (Construction check) INFORMATION:	<input type="checkbox"/> N/A <input checked="" type="checkbox"/> The On-site CC for this item was performed on 2024-11-26 as per our report no. 4929588.00-11 with the result - <input checked="" type="checkbox"/> PASS <input type="checkbox"/> FAIL <input type="checkbox"/> PENDING

A-1) AQL and Defects Finding					
Inspection Sampling Standard Adopted: <input checked="" type="checkbox"/> ISO 2859-1			Nonconformity (defective)		
Inspection Plan:	Single sampling plans for normal inspection		Critical	Major	Minor
Inspection Level:	GII		Not Allowed	2.5	4.0
Inspection with:	<input type="checkbox"/> Golden sample	AQL:	Not Allowed	2.5	4.0
<input type="checkbox"/> Specific check list	<input checked="" type="checkbox"/> General check list	Sample Size:	125	125	125
Defect Description					
Poor stuck for rating label.				2	
Impurity mark on glass cup.					1
Slightly scratch mark on housing.					3
Slightly scratch mark on glass cup.					2
Total Found:			0	2	6
Max. Allowed:			0	7	10

The report reflects the findings at the time and place of inspection. This report does not relieve the sellers/manufacturers from their contractual liabilities or prejudice the buyer's right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment. This report is not used for social proof function in China market.

A-2: Remarks and Comments		Status
Please confirm		Status
1.	Below spare parts from PI was not available during inspection. SPARE PARTS REQUIRED 30 PCS EXTRA GIFTBOXES 10 PCS EXTRA JARS WITH LIDS 10 PCS EXTRA KNOBS	Information
2.	Product number "VON-024" on carton, gift box and rating label.	Information

Inspected by	:	David RUAN	Signature	:	<i>David Ruan</i>
Reviewed by	:	Sanky Liu	Signature	:	<i>Sanky Liu</i>

The report reflects the findings at the time and place of inspection. This report does not relieve the sellers/manufacturers from their contractual liabilities or prejudice the buyer's right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment. This report is not used for social proof function in China market.

B. Quantity/Specification/Product requirement verification

B-1) Check inspection lot size against:

<input checked="" type="checkbox"/> Purchase order	<input checked="" type="checkbox"/> Conformed	<input type="checkbox"/> Not conformed
<input checked="" type="checkbox"/> Inspection booking form	<input checked="" type="checkbox"/> Conformed	<input type="checkbox"/> Not conformed
<input type="checkbox"/> Packing list	<input type="checkbox"/> Conformed	<input type="checkbox"/> Not conformed

B-2) Check product description/ Color /Style against:

<input checked="" type="checkbox"/> Purchase order	<input checked="" type="checkbox"/> Conformed	<input type="checkbox"/> Not conformed
<input type="checkbox"/> Product specification	<input type="checkbox"/> Conformed	<input type="checkbox"/> Not conformed
<input type="checkbox"/> Reference artwork	<input type="checkbox"/> Conformed	<input type="checkbox"/> Not conformed
<input type="checkbox"/> Golden sample	<input type="checkbox"/> Conformed	<input type="checkbox"/> Not conformed
<input type="checkbox"/> (others: please specify the sender and receiving date)	<input type="checkbox"/> Conformed	<input type="checkbox"/> Not conformed

B-3) Packing material

Export carton	New export carton	<input checked="" type="checkbox"/>
Fastening	Metal staples	<input type="checkbox"/>
Sealing	Transparent gummed tape	<input checked="" type="checkbox"/>
	Opaque gummed tape	<input type="checkbox"/>
	Paper tape	<input type="checkbox"/>
Strapping	Nylon	<input type="checkbox"/> Pcs
Material	Ply of cardboard	<input type="checkbox"/> 3ply (single wall) <input checked="" type="checkbox"/> 5ply (double wall) <input type="checkbox"/> 7ply (triple wall)
Others	Poly foam inside packing	<input checked="" type="checkbox"/> Yes <input type="checkbox"/> No

B-4) Packaging information

	Qty per selling unit	Carton size (cm)			N.W. (kg)	G.W. (kg)
		L(cm)	W(cm)	H(cm)		
Gift Box	1pc	29.5	21.8	34.5	2.912	3.637
Inner carton	N/A	N/A	N/A	N/A	N/A	N/A
Outer carton	2pcs	45.0	30.7	37.2	7.274	7.90

B-5) Barcode check

Overall result: <input checked="" type="checkbox"/> Pass <input type="checkbox"/> Fail <input type="checkbox"/> N/A (No barcode was found.)					
Barcode scanner brand and model number: SZI-117					
Item No.	Barcode on location	Visual/ Specification	Reading (Scanning Result)	Sample Size	Result
TBLI-370	Gift box	3760301556022	3760301556022	5	Pass
<small>The report reflects the findings at the time and place of inspection. This report does not relieve the sellers/manufacturers from their contractual liabilities or prejudice the buyer's right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment. This report is not used for social proof function in China market.</small>					

Report No.: 4929588.00-12

Report Date: 2024-11-27

TBLI-370	Outer carton	3760301556022	3760301556022	5	Pass
----------	--------------	---------------	---------------	---	------

B-6) Shipping marks: Yes

For export carton	Front side marks <input checked="" type="checkbox"/>	Side marks <input checked="" type="checkbox"/>
For inner box	Front side marks <input type="checkbox"/>	Side marks <input type="checkbox"/>

B-7) Color / Style / Material Conform to Golden Sample?

<input type="checkbox"/> Yes
<input type="checkbox"/> No, please see remark
<input checked="" type="checkbox"/> N/A, no Golden sample

C. ON-SITE CHECKING

Test performed		Sample size	Result	Comments
1.	Hi-pot check	125 pcs	Pass	3,300Vac, 2sec no breakdown
2.	Basic function check	125 pcs	Pass	Switch on/off
3.	Smell check	125 pcs	Pass	No abnormal smell
4.	Full function check	20 pcs	Pass	Check full function against instruction manual, package artwork
5.	Input power consumption	20 pcs	Pass	230V/50Hz without load:240-290W
6.	Endurance check	5 pcs	Pass	230V~50Hz : 2min on/ 5min off for 10cycles
7.	Internal check	5 pcs	Pass	Check internal workmanship
8.	Stability check	5 pcs	Pass	10° plate, not overturn
9.	Strain relief check	5 pcs	Pass	60N/25 times, displacement <= 2mm
10.	Cord length measurement	5 pcs	Reference	87-88cm without plug
11.	Rub check	5 pcs	Pass	Rub 15s with water & then 15s with hexane
12.	Tape check	5 pcs	Pass	With 3M tape 810#
13.	Application check	5 pcs	Pass	Actual use
14.	Critical component check	1 pc	Pass	Check against the CDF provided by the factory.

D. CLIENT'S SPECIAL CHECKPOINTS N/A

No.	Descriptions / Requirements	Actual Findings/ Comments	Result/ Observation
1.			

E. OTHER INFORMATION

	Please note											
1.	63 Cartons were randomly sampled from the batch of above item subjected for inspection											
2.	<input checked="" type="checkbox"/> Selected carton number:											
	1181	1009	85	973	1187	790	1969	103	174	1291	915	137
	886	438	738	888	878	979	857	1241	1274	829	823	943

The report reflects the findings at the time and place of inspection. This report does not relieve the sellers/manufacturers from their contractual liabilities or prejudice the buyer's right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment. This report is not used for social proof function in China market.

	918	736	78	949	1070	1151	828	795	851	700	522	28
	900	558	328	642	250	418	177	901	579	1038	211	79
	30	1039	469	706	928	139	38	470	766	760	648	432
	411	114	288	/	/	/	/	/	/	/	/	/
3.	<input type="checkbox"/> Carton no. was not assigned.											

F. CRITICAL COMPONENT DATA N/A

	Component	Trade Mark	Model	Technical data	Conformity mark	Results
1.	Power cord	UNIRISE	H05VVH2-F	2x 0,75 mm ²	VDE	Pass
2.	Plug	UNIRISE	UE-212	250 V~, 16A	VDE	Pass
3.	X2 capacitor	--	HD 224	275 V~, X2, 0,22µF, T85	VDE	Pass
4.	Speed switch	ZX	AK-09	6A, 250 V~, T105	TUV	Pass
5.	Internal wire	KELIN	1015	22AWG, 105°C, 600V	Tested with appliance	Pass
6.	Motor	--	KH76/20-Q	AC220-240 V~, 50-60 Hz, 500W, Class 155	Tested with appliance	Pass
7.	Current fuse on the motor	--	3N	T2,5 A, 250 V~	Tested with appliance	Pass
8.	Y capacitor	SEC	SF	332M, 300 V~	VDE	Pass
9.	Interlock switch	ZX	KW11-3Z	250V~, 5 A, T85 5E4	TUV	Pass
10.	Closed-end connector	--	KX-C2	--	Tested with appliance	Pass

Remark: Above components are tested against CDF under TÜV SÜD_ test report#: _64.110.18.0198.26 on 2022-05-12.

The report reflects the findings at the time and place of inspection. This report does not relieve the sellers/manufacturers from their contractual liabilities or prejudice the buyer's right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment. This report is not used for social proof function in China market.

G. PICTURES



1). Warehouse



2). Warehouse



3). Carton view



4). Carton view



5). Barcode



6). Carton view

The report reflects the findings at the time and place of inspection. This report does not relieve the sellers/manufacturers from their contractual liabilities or prejudice the buyer's right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment. This report is not used for social proof function in China market.



7). Carton open view



8). Gift box view



9). Gift box view



10). Gift box view




11). Gift box view



12). Gift box view

The report reflects the findings at the time and place of inspection. This report does not relieve the sellers/manufacturers from their contractual liabilities or prejudice the buyer's right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment. This report is not used for social proof function in China market.

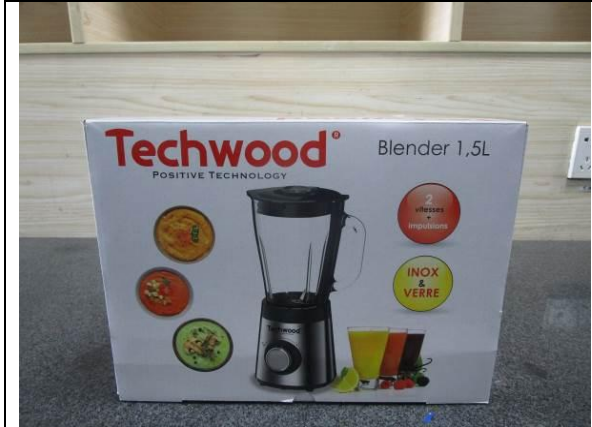

13). Gift box view



14). Gift box view



15). Gift box detail



16). Gift box detail



17). Gift box detail



18). Gift box open view


The report reflects the findings at the time and place of inspection. This report does not relieve the sellers/manufacturers from their contractual liabilities or prejudice the buyer's right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment. This report is not used for social proof function in China market.



19). Package detail view



20). Package detail view

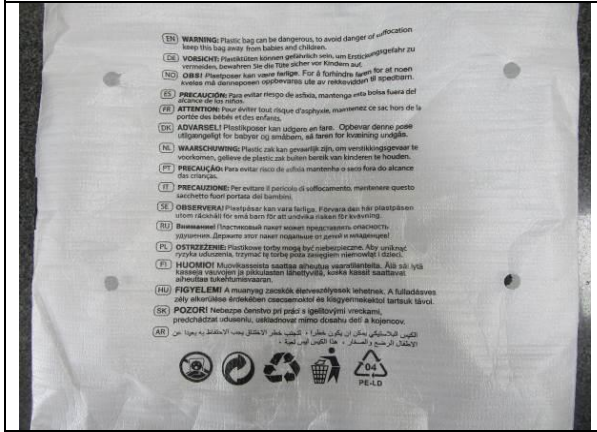

21). Poly bag



22). Poly bag




23). Product detail view



24). Manual

The report reflects the findings at the time and place of inspection. This report does not relieve the sellers/manufacturers from their contractual liabilities or prejudice the buyer's right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment. This report is not used for social proof function in China market.

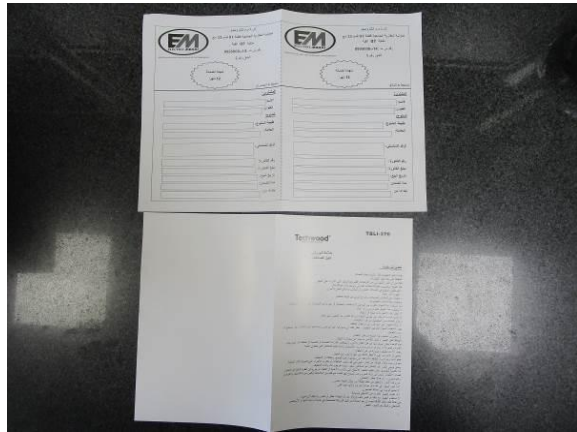

25). Leaflet



26). Product view



27). Product view



28). Product view



29). Product view



30). Product view

The report reflects the findings at the time and place of inspection. This report does not relieve the sellers/manufacturers from their contractual liabilities or prejudice the buyer's right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment. This report is not used for social proof function in China market.



31). Product view



32). Product view



33). Product view



34). Lock switch



35). Lock switch



36). Blade view

The report reflects the findings at the time and place of inspection. This report does not relieve the sellers/manufacturers from their contractual liabilities or prejudice the buyer's right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment. This report is not used for social proof function in China market.




37). Blade view



38). Lid and small measured cup



39). Small measured cup

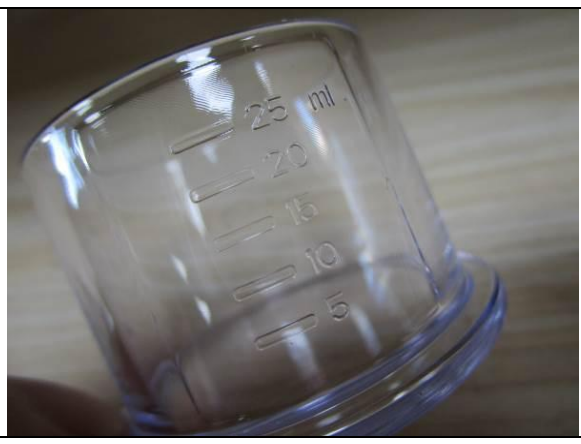

40). Marking on small cup



41). Water level marking



42). Water level marking

The report reflects the findings at the time and place of inspection. This report does not relieve the sellers/manufacturers from their contractual liabilities or prejudice the buyer's right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment. This report is not used for social proof function in China market.



43). Logo



44). Marking



45). Rating label



46). Marking on lid



47). Cord entrance



48). Plug


The report reflects the findings at the time and place of inspection. This report does not relieve the sellers/manufacturers from their contractual liabilities or prejudice the buyer's right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment. This report is not used for social proof function in China market.



49). Power cord



50). Internal view

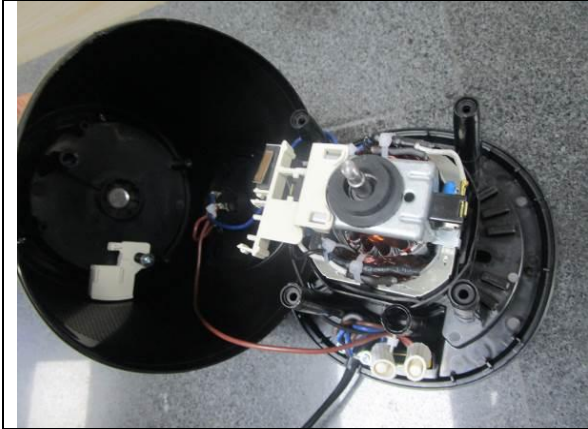


51). Internal view



52). Internal view




53). Internal view

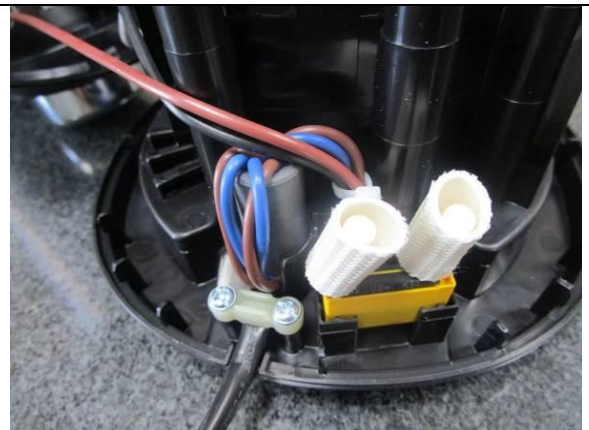

54). Internal view


The report reflects the findings at the time and place of inspection. This report does not relieve the sellers/manufacturers from their contractual liabilities or prejudice the buyer's right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment. This report is not used for social proof function in China market.

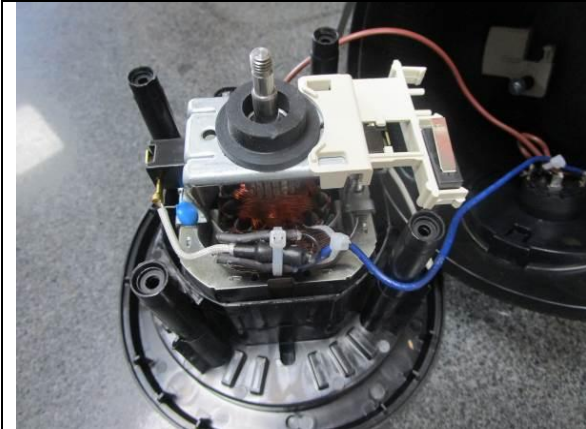


55). Internal view




56). Internal view

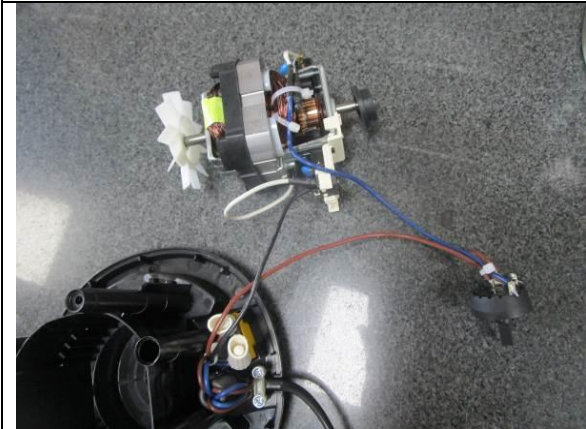


57). Internal view

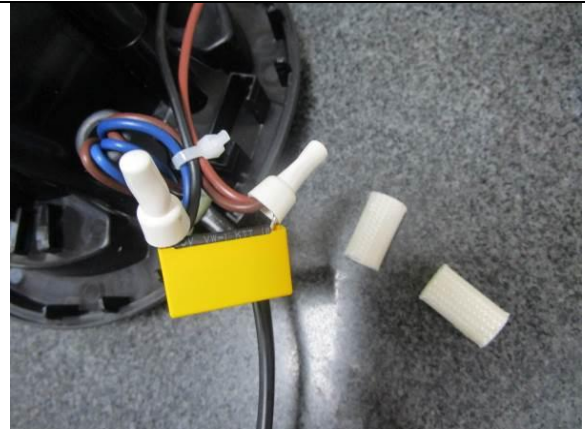

58). Internal view

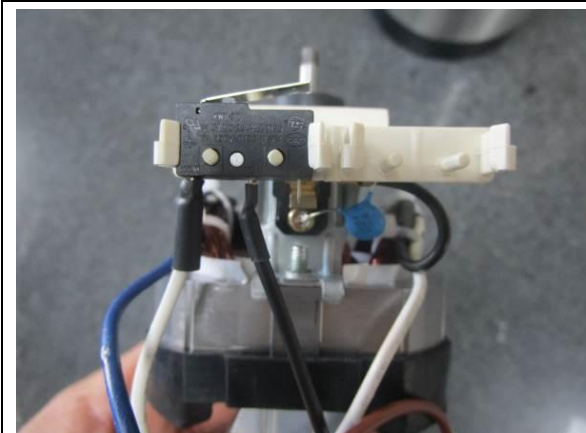


59). Internal view

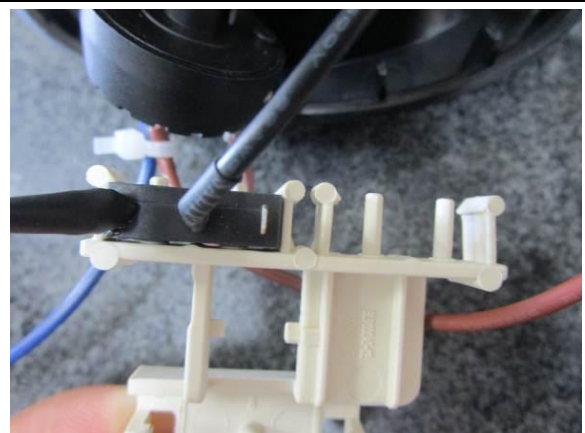


60). Internal view


The report reflects the findings at the time and place of inspection. This report does not relieve the sellers/manufacturers from their contractual liabilities or prejudice the buyer's right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment. This report is not used for social proof function in China market.

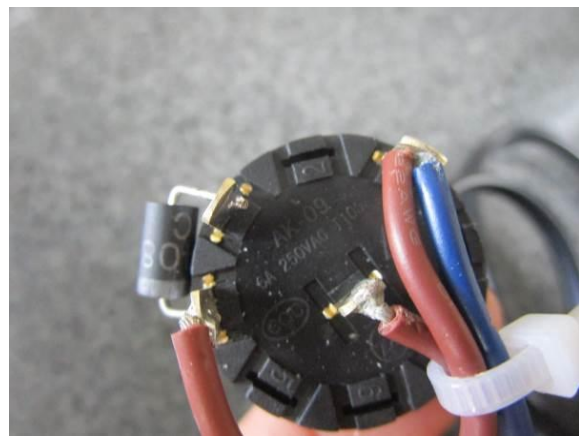


61). Speed switch

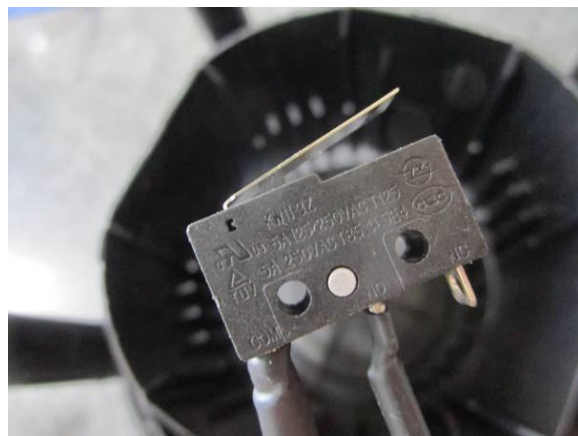


62). Micro switch

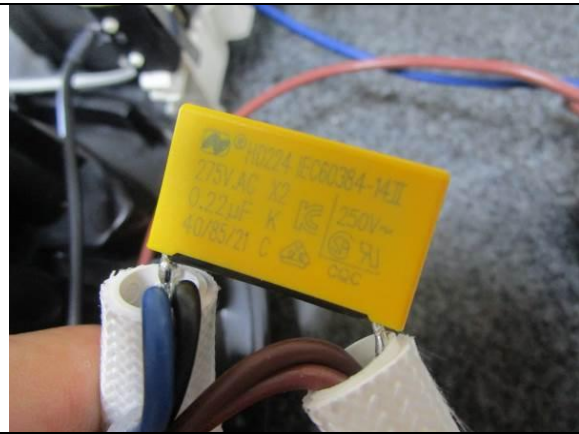

63). X capacitor

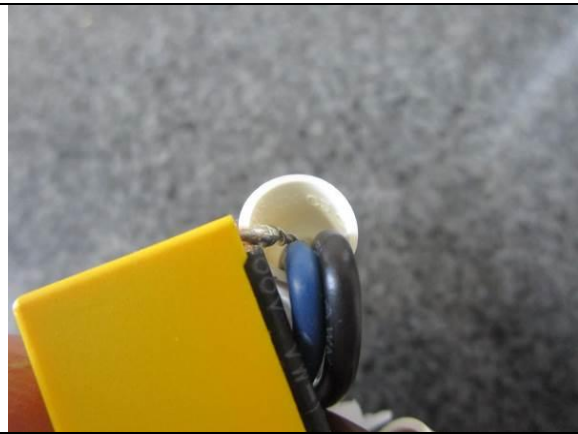

64). Wire nut

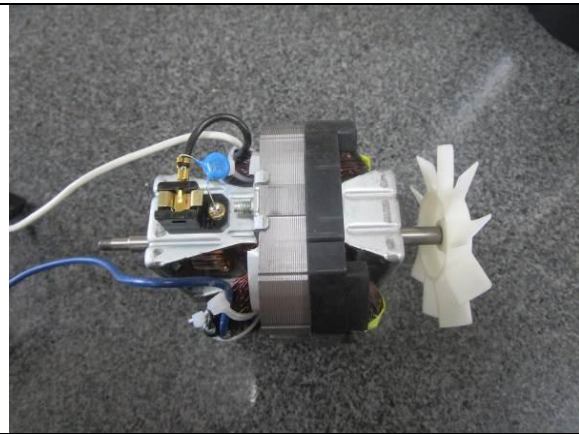

65). Internal view



66). Motor


The report reflects the findings at the time and place of inspection. This report does not relieve the sellers/manufacturers from their contractual liabilities or prejudice the buyer's right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment. This report is not used for social proof function in China market.




67). Motor



68). Motor

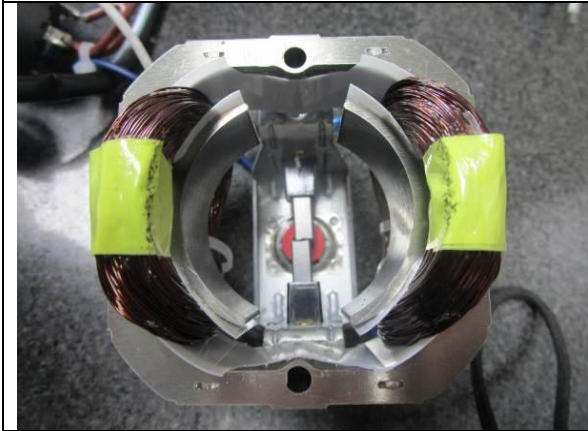

69). Internal view

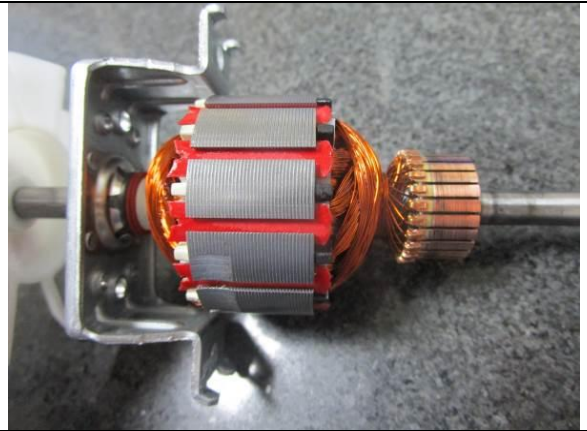

70). Internal view




71). Fuse in motor



72). Fuse in motor

The report reflects the findings at the time and place of inspection. This report does not relieve the sellers/manufacturers from their contractual liabilities or prejudice the buyer's right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment. This report is not used for social proof function in China market.

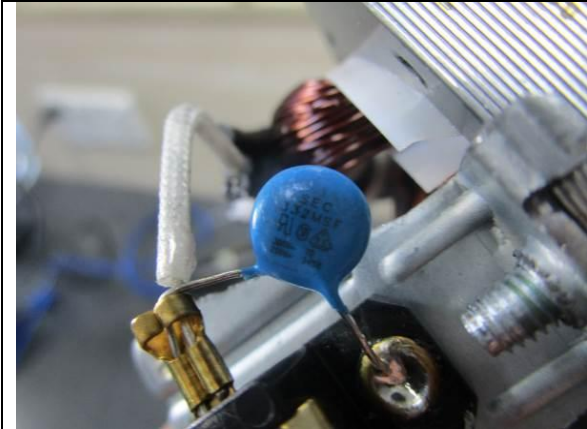

73). Y capacitor



74). Internal wire



75). Endurance test



76). Hi-pot test



77). Input power check for 2 setting



78). Function check for P setting

The report reflects the findings at the time and place of inspection. This report does not relieve the sellers/manufacturers from their contractual liabilities or prejudice the buyer's right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment. This report is not used for social proof function in China market.



79). Strain relief test



80). Power cord length check



81). Capacity check



82). Stability test



83). Rub test



84). Rub test

The report reflects the findings at the time and place of inspection. This report does not relieve the sellers/manufacturers from their contractual liabilities or prejudice the buyer's right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment. This report is not used for social proof function in China market.



85). Tape check



86). Smell check



87). Application check



88). Application check



89). Application check



90). Application check

The report reflects the findings at the time and place of inspection. This report does not relieve the sellers/manufacturers from their contractual liabilities or prejudice the buyer's right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment. This report is not used for social proof function in China market.




91). Application check

92). Application check



93). Barcode check

94). Barcode check

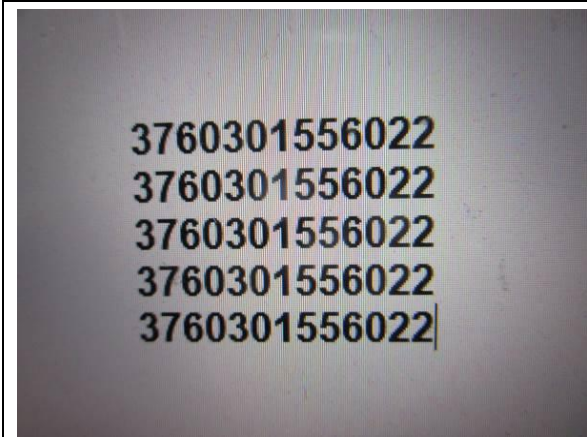

95).Barcode check

96).QR code check

The report reflects the findings at the time and place of inspection. This report does not relieve the sellers/manufacturers from their contractual liabilities or prejudice the buyer's right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment. This report is not used for social proof function in China market.



97). Speed check



98). Stop blade time



99). CE&WEEE size check



100). CE&WEEE size check



101). CE&WEEE size check



102). CE&WEEE size check

The report reflects the findings at the time and place of inspection. This report does not relieve the sellers/manufacturers from their contractual liabilities or prejudice the buyer's right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment. This report is not used for social proof function in China market.



103). Spare parts



104). Spare parts



105). Poor stuck for rating label



106). Poor stuck for rating label



107). Impurity mark on glass cup



108). Slightly scratch mark on housing

The report reflects the findings at the time and place of inspection. This report does not relieve the sellers/manufacturers from their contractual liabilities or prejudice the buyer's right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment. This report is not used for social proof function in China market.



109). Slightly scratch mark on housing



110). Slightly scratch mark on housing



111). Slightly scratch mark on glass cup



112). Slightly scratch mark on glass cup

- END OF REPORT -

The report reflects the findings at the time and place of inspection. This report does not relieve the sellers/manufacturers from their contractual liabilities or prejudice the buyer's right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment. This report is not used for social proof function in China market.